

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

Section number _____ Page _____

SUPPLEMENTARY LISTING RECORD

NRIS Reference Number: 03001136

Date of Listing: November 17, 2003

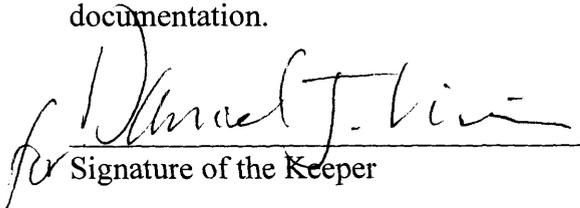
Property Name: South Highlands of East Lake Historic District

County: Jefferson

State: Alabama

none
Multiple Name

This property is listed in the National Register of Historic Places in accordance with the attached nomination documentation subject to the following exceptions, exclusions, or amendments, notwithstanding the National Park Service certification included in the nomination documentation.


Signature of the Keeper

November 17, 2003
Date of Action

Amended Items in Nomination:

Section 2. Location

The street & number is hereby changed to: roughly bounded by 8th Avenue, 85th Street, 5th Avenue, and 78th Street.

The Alabama State Historic Preservation Office was notified of this amendment.

DISTRIBUTION:

**National Register property file
Nominating Authority (without nomination attachment)**

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
REGISTRATION FORM



1. Name of Property

historic name South Highlands of East Lake Historic District

other names/site number N/A

2. Location

street & number see continuation sheet not for publication N/A
city or town Birmingham vicinity N/A
state Alabama code AL county Jefferson code 073 zip code 35211

3. State/Federal Agency Certification

As the designated authority under the National Historic Preservation Act of 1966, as amended, I hereby certify that this X nomination request for determination of eligibility meets the documentation standards for registering properties in the National Register of Historic Places and meets the procedural and professional requirements set forth in 36 CFR Part 60. In my opinion, the property X meets does not meet the National Register Criteria. I recommend that this property be considered significant nationally statewide X locally. (See continuation sheet for additional comments.)

Shirley Ann Brown
Signature of certifying official

September 29, 2003
Date

Alabama Historical Commission (State Historic Preservation Office)
State or Federal agency and bureau

In my opinion, the property meets does not meet the National Register criteria.
(See continuation sheet for additional comments.)

Signature of commenting or other official

Date

State or Federal agency and bureau

4. National Park Service Certification

- I hereby certify that this property is:
- entered in the National Register
 See continuation sheet.
 - determined eligible for the National Register
 See continuation sheet.
 - determined not eligible for the National Register
 - removed from the National Register
 - other (explain):

for Signature of the Keeper Date of Action
Daniel J. Keenan
11/17/03

5. Classification

Ownership of Property (Check as many boxes as apply.) count.)	Category of Property (Check only one box.)	Number of Resources within Property (Do not include previously listed resources in the count.)	
		Contributing	Noncontributing
<input checked="" type="checkbox"/> private	<input type="checkbox"/> building(s)	<u>786</u>	<u>174</u> buildings
<input type="checkbox"/> public-local	<input checked="" type="checkbox"/> district	_____	_____ sites
<input type="checkbox"/> public-state	<input type="checkbox"/> site	_____	_____ structures
<input type="checkbox"/> public-Federal	<input type="checkbox"/> structure	_____	_____ objects
	<input type="checkbox"/> object	<u>786</u>	<u>174</u> Total

Name of related multiple property listing
(Enter "N/A" if property is not part of a multiple property listing.)

Number of contributing resources previously listed in the National Register

N/A

0

6. Function or Use

Historic Functions (Enter categories from instructions)

Cat: DOMESTIC Sub: single dwelling
DOMESTIC multiple dwelling
COMMERCE/TRADE specialty store

Current Functions (Enter categories from instructions)

Cat: DOMESTIC Sub: single dwelling
DOMESTIC multiple dwelling
COMMERCE/TRADE specialty store
VACANT/NOT IN USE

7. Description

Architectural Classification (Enter categories from instructions)

Bungalow/Craftsman
Minimal Traditional
Tudor Revival

Materials (Enter categories from instructions)

foundation brick
roof asphalt
walls wood: weatherboard
brick
other stone
ceramic tile

Narrative Description (Describe the historic and current condition on continuation sheet/s.)

8. Statement of Significance

Applicable National Register Criteria (Mark "x" in one or more boxes for the criteria qualifying the property for National Register listing)

- A Property is associated with events that have made a significant contribution to the broad patterns of our history.
- B Property is associated with the lives of persons significant in our past.
- C Property embodies the distinctive characteristics of a type, period, or method of construction or represents the work of a master, or possesses high artistic values, or represents a significant and distinguishable entity whose components lack individual distinction.
- D Property has yielded, or is likely to yield information important in prehistory or history.

Criteria Considerations (Mark "X" in all the boxes that apply.) N/A

- A owned by a religious institution or used for religious purposes.
- B removed from its original location.
- C a birthplace or a grave.
- D a cemetery.
- E a reconstructed building, object, or structure.
- F a commemorative property.
- G less than 50 years of age or achieved significance within the past 50 years.

Areas of Significance (Enter categories from instructions)

Architecture _____

Period of Significance 1910 -1952 _____

Significant Dates N/A _____

Significant Person (Complete if Criterion B is marked above) N/A _____

Cultural Affiliation N/A _____

Architect/Builder N/A _____

Narrative Statement of Significance (Explain significance of the property on one or more continuation sheets.)

9. Major Bibliographical References

(Cite the books, articles, and other sources used in preparing this form on one or more continuation sheets.)

Previous documentation on file (NPS) N/A

- preliminary determination of individual listing (36 CFR 67) has been requested.
- previously listed in the National Register
- previously determined eligible by the National Register
- designated a National Historic Landmark
- recorded by Historic American Buildings Survey
Record # _____
- recorded by Historic American Engineering
Record # _____

Primary location of additional data: N/A

- State Historic Preservation Office
 - Other state agency
 - Federal agency
 - Local government
 - University
 - Other
- Name of repository _____

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 2.7 Page 1

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

2. Location

street & number

Street numbers included in the South Highlands of East Lake Historic District are:

8505-8637 2 nd Avenue South	600-741 84 th Place South
8500-8538 3 rd Avenue South	508-752 84 th Street South
8512-8622 4 th Avenue South	201-753 85 th Street South
7803-8439 5 th Avenue South	200-449 86 th Place South
7800-8448 6 th Avenue South	701-462 86 th Street South
7720-8447 7 th Avenue South	7782-8237 Rugby Avenue
7715-8336 7 th Court South	7820-7860 Rugby Court
8300-8334 7 th Terrace South	8207-8348 Vassar Avenue
7804-8448 8 th Avenue South	
756-772 78 th Place South	
601-785 78 th Street South	
751-781 79 th Street South	
578-715 79 th Street South	
500-777 80 th Place South	
501-784 80 th Place South	
615-785 81 st Place South	
508-783 81 st Street South	
725-773 82 nd Place South	
502-753 83 rd Place South	
715-766 83 rd Street South	

7. Description (cont'd)

Architectural Description

Spanish Revival
Dutch Colonial Revival
Other: foursquare
Other: T-cottage
Other: L-cottage
Other: pyramidal
Other: ranch
Other: no style
Other: modern

Materials

foundation: concrete

walls: brick
roof: asbestos

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 2

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

**South Highlands of East Lake Historic District
Narrative Description**

A residential neighborhood located in eastern Birmingham, Alabama, South Highlands is part of the East Lake neighborhood, one of Birmingham's oldest planned communities (1886) and one of its earliest streetcar suburbs. The original East Lake (NRHP - 03/07/97) development consisted of approximately 60 city blocks laid off on a typical grid pattern. These blocks surrounded a lake complete with bathhouse, pavilions, boathouses, and a hotel. In their efforts to create a desirable suburban neighborhood with the amenities of urban life, the developers of East Lake coaxed religious and educational institutions to their planned community. In 1887, the East Lake Land Company offered the trustees of Howard College 60 acres of land lying along the southern boundary of the original East Lake development. The trustees accepted their offer and moved Howard College from the small town of Marion in Perry County, Alabama to the new location in East Lake. In the early twentieth century, however, the East Lake Land Company began to develop those lands to the south and west of the original neighborhood, creating Central Highlands, South Highlands of East Lake (to differentiate this development from the earlier South Highlands neighborhood located south of downtown Birmingham), Howard College Estates (NRHP - 04/22/99), and Lakewood (NRHP - 06/22/00). The streets of Central Highlands and South Highlands of East Lake were plotted in 1906 and three years later, on March 20, 1909, the plans for Lakewood were filed with the city engineer. Due to the close proximity of South Highlands of East Lake to Howard College, the officers of the East Lake Land Company named the streets and avenues for universities and towns that were home to other institutions of higher learning. Soon, residents of South Highlands found themselves living on Ann Arbor, Oxford, Rugby, Columbia, Harvard, Yale, Princeton, and Vanderbilt Streets. Similarly, streets in the Central Highlands neighborhood were named for European cities such as London, Paris, Madrid, and Naples.

While the developers of East Lake laid off the original neighborhood (1886) in a typical grid pattern, by 1909, real estate planners and developers had abandoned this particular plan for ones which complemented the natural terrain of the hills and mountains surrounding Birmingham. Robert Jemison, Sr., a principal investor in the East Lake development, had abandoned the grid pattern for his subdivisions at Glen Iris. In 1910, the East Lake Land Company would annex the Roebuck Springs addition, a residential suburb lying immediately north of South Highlands that included the city's first professionally designed golf course, pleasure drives, gardens, and clubhouse. Located at the foot of Ruffner Mountain with rolling terrain, portions of East Lake were ill suited for the typical grid pattern of development. For the South Highlands section of East Lake, the land company chose to construct a broad avenue, Rugby Avenue, running in a semi-circle from Oporto-Madrid Boulevard at the southwest to 83rd Street at the northeast. Vassar Avenue runs parallel to Rugby for a short distance. The resulting lot configuration of the district, therefore, is an extension of the grid system with irregularly sized block and some triangular blocks containing 18 to 24 lots adjoining or near a semi-circular avenue.

Throughout the South Highlands of East Lake Historic District, residential lots are random sizes, ranging from 50' to 60' in width and 96' to 125' in depth. All lots back up to common alleys. Residences are uniformly set close to the street with secondary structures located to the rear along common alleyways. This particular arrangement strengthens the visual appeal of the neighborhood, providing stretches of houses in various styles popular during the district's period of significance. Too, by placing the primary residence closer to the street, homeowners typically have large and spacious rear lawns and yards. Throughout the area, one finds the Southern flora typically found in such neighborhoods, varieties of oak, pecan, dogwood, pine and sweet gum. Lots are usually embellished with attractive landscaping and the district is embellished with curbs and sidewalks. Occasionally, a dwelling may boast attractive stone or rubblestone retaining walls.

The terrain of South Highlands of East Lake Historic District is undulating, particularly to the south and east at the foothills of the Appalachian Mountains found in the Birmingham District. An economically stable middle-class neighborhood, South Highlands of East Lake Historic District contains an impressive collection of architecture dating from the early 20th century through the 1950s, reflecting the creation of this specific area within the East Lake development, as well as the continued growth and popularity of the entire East Lake neighborhood through the mid-twentieth century.

The styles of residential architecture found in the South Highlands of East Lake Historic District include Tudor, Colonial, Dutch Colonial and Spanish Revival, Craftsman/Bungalow, Pyramidal, Minimal Traditional, Ranch, Split-Level, L-cottage, and Modern. The primary form of construction is wood frame while the exterior wall material ranges from simple weatherboard and wooden shingles to brick veneer and stucco. Most dwellings are one story although there are some one-and-a-half and two-storied dwellings in the district. The topography of the district allows for the accommodation of basements and indeed, the majority of dwellings constructed in the 1920s and 1930s, rest on full basements.

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 3

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

One of the most interesting architectural aspects of the South Highlands of East Lake Historic District is the Spanish Revival style architecture. These dwellings are attributed to George Turner, a Birmingham architect who drafted plans for over 30 Spanish Revival style houses in eastern Birmingham as well as a number of homes in the Hollywood section of Homewood. These houses are usually one-story with flat roofs hidden behind low-lying parapet walls that are often capped with ceramic tiles. The exterior chimneys are typically capped with elaborate roofs. These dwellings are embellished with partial-width porches with spiral columns, semi-circular arches and tiled floors.

The most prevalent architectural style in the South Highlands of East Lake Historic District is Bungalow/Craftsman. These structures are primarily frame with cross-gable roofs, wide overhanging eaves with exposed rafter ends, partial or full-width porches supported by tapered posts on low piers. While some Bungalows/Craftsman dwellings have brick piers, a number of them in the South Highlands district have rubblestone foundations, balustrades and piers.

Included in the South Highlands Historic District are examples of Tudor Revival style dwellings. All of these houses feature brick veneered exterior wall material and most have exterior end or front-facing chimneys, some are often capped with decorative chimney pots. These houses feature complex rooflines; steeply pitched roofs are often pierced with gable-roofed dormers or are broken by projecting wall dormers rising above arched windows. The entrances are often set in gable-roofed projections that typically are embellished with decorative stone quoins framing an arched single-leaf entrance. Almost all of the Tudor Revival dwellings contain a porch, located on the façade or to one side, often supported by arched brick piers with radiating voussoirs and decorative keystones.

The Colonial Revival dwellings in the South Highlands of East Lake Historic District are simple one-story frame cottages covered in wooden shingles. Typically, they have symmetrical facades, side-gable roofs, exterior-end chimneys, and a small porch supported by classical colonettes. There are two examples of Dutch Colonial Revival architecture with gambrel roofs accommodating shed roof dormers.

The district also contains examples of vernacular architectural forms such as the pyramidal and L-shaped cottages. The pyramidal roofed cottages usually feature hip-with-cross gable roofs with front-facing gable wings, partial-width porches, interior chimneys, and single-leaf entrances with transoms and sidelights. The L-cottages are usually simple frame dwelling with front-facing gable wings and partial-width porches.

The houses in the district that are categorized as Minimal Traditional reflect the continued popularity of East Lake in post-World War II Birmingham. City Directories indicate that many of these dwellings were constructed in 1948. Additionally, during the late 1940s and early-to-mid 1950s, new residents to South Highlands of East Lake were building ranch-style houses with low-pitched cross-hipped roofs, brick veneer exterior wall material, slab or slightly-raised foundations, interior chimneys, carports, and bands of metal windows. Typically, the contributing ranch houses have a central tripartite window with a single-pane plate glass window framed by sash windows. Any porch is usually supported by decorative ironwork posts.

Modern houses are dwellings constructed during the post World-War II building boom of the late 1940s and 1950s. Box—like in shape and plan, low in price and relatively quick to build, these dwellings have uncovered stoops and covered carports or garages as integral features. Factory-made materials such as aluminum siding and windows, asbestos shingles, pressed fiber-siding, and concrete block foundations are the material hallmarks of these structures. Some modern houses were built after the period of significance and due to age, are considered non-contributing resources. Other structures which are described as modern are A-frame and split-level dwellings.

The resources categorized as non-contributing were constructed after the district's period of significance or resources that have been significantly altered and no longer retain a high degree of integrity.

Today, the South Highlands of East Lake Historic District contains an important assemblage of historic architecture reflecting the period of significance from 1910 to 1953. The buildings contained within the boundaries of the neighborhood clearly reflect the development of the area during the period of significance. The South Highlands of East Lake Historic District contains contributing buildings and non-contributing resources.

Archaeological Component

Although no formal archaeological testing has been conducted, there is some potential for subsurface material. Subsurface remains could reveal information that may be useful in interpreting the district.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 4

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

**South Highlands of East Lake
Historic Resource Inventory**

2nd Avenue South

1. 8505 2nd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, cross-gable roof with primary side-gable roof, interior chimney, three-bay facade, single and paired sash windows, single-leaf off-centered entrance, near full-width gable roof porch supported by tall end brick piers connected with open brickwork balustrades, weatherboard exterior wall material. C (Roll #42-14)
2. 8511 2nd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, full-width recessed porch supported by decorative ironwork posts, three-bay facade, central single-leaf entrance, paired 12/1 sash windows, exposed rafter ends and decorative brackets. C (Roll #42-15)
3. 8517 2nd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, double-front facing gable roof, brick pier foundation (in-filled), facade heavily altered with use of faux-stone work, board-and-batten siding, carport with metal posts. NC (Roll #42-16)
4. 8523 2nd Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof with dominant front-facing gable and subordinate secondary gable, full-width recessed porch under main gable wing, three-bay facade, single-leaf entrance, paired 6/1 sash windows, aluminum siding exterior wall material, wraparound metal awning. C (Roll #42-17)
5. 8531 2nd Avenue South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear ell resting on side-gable roofline, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by brick balustrade, weatherboard exterior wall material. C (Roll #42-18)
6. 8533 2nd Avenue South, ca. 1910, Pyramidal. One-story frame dwelling, brick pier foundation (in-filled), hip-with-cross gable roof, two interior chimneys, front-facing gable wing with shingles over projecting wing, three-bay facade, single-leaf entrance, sash windows, full-width porch that follows the contours of the front facade, paneled posts on low brick piers connected by wooden balustrade. C (Roll #42-19)
7. 8615 2nd Avenue South, ca. 1970, Modern. One-story frame dwelling, brick veneer exterior wall material, front-facing gable roof, three-bay facade, single-leaf entrance, vertical sash windows, gable-roof porch supported by classical colonettes. NC (Roll #38-21)
8. 8637 2nd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick and concrete block foundation, front-facing gable roof extending out over full-width recessed porch supported by decorative metal posts, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, interior chimney. C (Roll #39-24)

3rd Avenue South

9. 8500 3rd Avenue South, ca. 1925, Pyramidal. One-story frame dwelling, low-pitched hipped roof, continuous brick foundation, five-bay facade, central single-leaf entrance, 1/1 sash windows, three-quarter width half-hipped roof porch supported by four square posts. C (Roll #42-11)
10. 8503 3rd Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, central gable roof porch with archway supported by pairs of boxed classical colonettes. C (Roll #36-21)
11. 8506 3rd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, full-width recessed porch supported by tall brick piers and interior metalwork supports, three-bay facade, single-leaf entrance, single sash windows, full-width metal awning. C (Roll #42-10)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 5

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

12. 8509 3rd Avenue South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof over full-width recessed porch with tall brick piers and low brick balustrades, three-bay facade, central single-leaf entrance, 1/1 sash windows, aluminum siding exterior wall material. C (Roll #36-22)
13. 8510 3rd Avenue South, ca. 1925, Bungalow. One-story frame dwelling, clipped side-gable roof porch, front-facing stucco chimney, three-bay facade, small recessed porch to right supported by single wooden post, sash windows, weatherboard exterior wall material. C (Roll #42-9)
14. 8511 3rd Avenue South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof over full-width recessed porch supported by decorative turned posts, three-bay facade, single-leaf entrance with sidelights, weatherboard exterior wall material. C (Roll #36-23)
15. 8516 3rd Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof, front-facing gable wing, three-bay facade, single-leaf entrance, paired sash windows, partial-width shed roof porch. C (Roll #42-8)
16. 8517 3rd Avenue South, ca. 1955, Ranch. One-story frame dwelling, low-pitched hipped roof, three-bay facade with side carport, single-leaf entrance, paired aluminum sash windows, asbestos shingle and brick veneer exterior wall material. NC (Roll #36-24)
17. 8520 3rd Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, principal three-bay facade with side porch and large open carport, single-leaf entrance, paired sash windows, small gable roof entrance porch supported by slender wooden posts, continuous brick foundation. C (Roll #42-7)
18. 8525 3rd Avenue South, ca. 1955, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, cross-hip roof, interior chimney, five-bay facade, single-leaf entrance, gable-roof porch supported by round colonettes, aluminum siding exterior wall material, aluminum replacement windows, addition of bay window. NC (Roll #37-1)
19. 8528 3rd Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, four-bay facade, sash windows, single-leaf entrance, small gable-roof entrance porch supported by decorative metal posts, weatherboard exterior wall material. C (Roll #42-6)
20. 8532 3rd Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, sash windows, small gable-roof entrance porch supported by decorative metal posts. C (Roll #42-5)
21. 8535 3rd Avenue South, ca. 1952, Minimal Traditional. One-story frame dwelling on raised continuous brick foundation, low-pitched cross-hip roof with slightly projecting hip roof wing, four-bay facade with glassed-in porch to far left with louvered glass panels, paired 6/6 sash windows, single-leaf entrance, small hipped-roof entrance porch supported by slender wooden posts, asbestos shingle exterior wall material. C (Roll #37-2)
22. 8538 3rd Avenue South, ca. 1920, Pyramidal. One-story frame dwelling, brick pier foundation, hip-with-cross gable roof, front-facing gable wing, full-width wrap around porch supported by plain wooden posts, 1/1 sash windows, single-leaf entrance with sidelights, aluminum siding exterior wall material. C (Roll #42-4)

4th Avenue South

23. 8512 4th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, brick veneer exterior wall material, side-gable roof with subordinate side-gable wing, interior-end chimney, four-bay facade, large centrally-placed gable-roof dormer, four-bay facade, single-leaf entrance with sidelights, paired and single 4/1 sash windows. C (Roll #37-6)
24. 8513 4th Avenue South, ca. 1952, Modern. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof with slightly-projecting central hipped roof section, three-bay facade, single sash and central picture window, single-leaf entrance on side of small recessed porch supported by single decorative metal post. C (Roll #37-7)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 6

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

25. 8516 4th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, hipped-roof with side gable extending out over open porch supported by boxed wooden supports, interior chimney at juncture with side-porch, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, gable-roof porch supported by classical colonettes. C (Roll #42-4)
26. 8517 4th Avenue South, ca. 1952, Minimal Traditional. One-story frame dwelling, brick veneer wall material, side-gable roof with central gable-roof wall dormer, three-bay facade, single sash windows and centrally-placed picture window, single-leaf entrance, recessed porch supported by wooden post. C (Roll #37-8)
27. 8521 4th Avenue South, ca. 1952, Modern. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof with projecting hip-roof wing, exterior-side chimney, three-bay facade, single-leaf entrance, picture window and paired 6/6 sash window, small recessed porch supported by decorative metal post. C (Roll #37-9)
28. 8600 4th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, hip-with-cross-gable roof, front-facing gable and small centrally placed gable-roof dormer, three-bay facade, single and triple 6/6 sash windows, single-leaf entrance onto small recessed louvered glassed-in porch at right. C (Roll #39-10)
29. 8601 4th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing gable, interior chimney, three-bay facade, single-leaf entrance, single and triple 6/6 sash windows, small recessed porch supported by single wooden posts. C (Roll #39-11)
30. 8612 4th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof, continuous brick foundation, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, gable-roof entrance porch supported by pairs of slender wooden posts, Chippendale-style balustrade. C (Roll #39-12)
31. 8615 4th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof extending out over full-width recessed porch now partially enclosed with band of four 6/6 sash windows, interior chimney, four-bay facade, single-leaf entrance, aluminum siding and brick veneer exterior wall material. C (Roll #38-7)
32. 8616 4th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof with decorative front-facing gable, interior chimney, three-bay facade, former flat-roof front porch has been glassed-in, single and paired 6/6 sash windows. C (Roll #42-2)
33. 8617 4th Avenue South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hipped roof, three-bay facade, single and paired vertical-sash windows, small recessed porch at right, single-leaf entrance, asbestos shingle exterior wall material. C (Roll #38-6)
34. 8624 4th Avenue South, ca. 1940, L-cottage. One-and-a-half story frame dwelling, brick pier foundation, cross-gable roof, front-facing gable wing with three gable-roof dormers on side, partial width shed roof porch supported by square wooden posts. C (Roll #42-3)
35. 8627 4th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, interior rubblestone chimney, front-facing gable roof extending out over full-width recessed porch supported by rubblestone piers, gable-roof dormer on side, three-bay facade, single-leaf entrance, paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #38-5)

5th Avenue South

36. 7803 5th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with double front-facing gable with front-facing chimney, four-bay facade, single-leaf entrance set in arched entrance opening, 4/1 paired sash windows. C (Roll #26-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 7

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

37. 7805 5th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with two front-facing gables, front-facing chimney, exterior-side chimney, gable-roof porch supported by arched openings, 4/1 sash windows. C (Roll #26-17)
38. 7813 5th Avenue South, ca. 1925, Craftsman. Two-story frame dwelling, continuous brick foundation, low-pitched hipped roof, interior chimney, 4/4 bay facade, full-width porch with large gable-roof section rising above and resting on first floor porch roof, porch supported by tapered post on low brick piers and two massive interior piers. C (Roll #26-16)
39. 7815 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, aluminum siding exterior wall material, continuous brick foundation, side-gable roof, central gable-roof porch supported by massive piers, decorative gable-roof dormers flanking porch, four-bay facade, paired sash windows, single-leaf entrance. C (Roll #26-15)
40. 7825 5th Avenue South, ca. 1925, Colonial Revival. One-story frame dwelling, brick and concrete block foundation, side-gable roof, exterior-side chimney, three-bay facade, central single-leaf entrance, small gable-roof entrance porch supported by two classical colonettes, paired sash windows, two small gable-roof dormers, small side screened-in porch. C (Roll #26-14)
41. 7829 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, complex roofline with primary side gable, crest of rear ell resting on main roof ridge, full-width shed roof porch with central entrance gable, porch supported by tall end rubblestone piers and paneled wooden posts on low brick piers, all connected by low-lying brick balustrade, three-bay facade, central single-leaf entrance, paired 4/1 sash windows. C (Roll #26-13)
42. 7833 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick veneer exterior wall material, primary side-gable roof with crest of rear gable resting on main roof ridge, three-bay facade, central single-leaf entrance, paired sash windows, central gable-roof porch supported by tall end brick piers, exterior side chimney. C (Roll #26-12)
43. 7837 5th Avenue South, ca. 1925, Craftsman. Two-story frame dwelling, rubblestone foundation, clipped side-gable roof with central shed roof dormer, interior chimney, 3/4 bay facade, single and paired 4/1 sash windows, single-leaf entrance, three-quarter width flat-roof porch supported by four square supports. C (Roll #26-11)
44. 7841 5th Avenue South, ca. 1940, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, full-width recessed porch supported by decorative metal posts, three-bay facade, central single-leaf entrance, single and paired sash windows. C (Roll #26-10)
45. 7901 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, interior chimney, side-gable roof, four-bay facade, 1/1 sash windows, central gable-roof porch supported by boxed columns, weather board exterior wall material, exposed rafter ends and decorative brackets. C (Roll #26-9)
46. 7909 5th Avenue South, ca. 1910, Pyramidal. One-story frame dwelling, brick pier foundation, steeply pitched hipped roof with central hipped roof dormer and front-facing decorative gable, three-bay facade, central single leaf entrance, multi-pane sash windows, interior chimney, wraparound porch supported by paneled posts on low brick piers. C (Roll #26-8)
47. 7911/7913 5th Avenue South, ca. 1960. Restoration Christian Ministries. Large one-story gable front religious structure, brick veneer, single bay facade containing recessed double-leaf entrance, side two-story brick veneer educational wing. NC (Roll #26-6,7)
48. 7925 5th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, 1/1 sash windows, small gable roof porch supported by decorative metal posts. C (Roll #26-5)
49. 7933 5th Avenue South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete foundation, steeply-pitched hipped roof, front-facing chimney, aluminum casement windows, five-bay facade, single-leaf entrance, rear screened-in porch. C (Roll #26-4)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 8

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
50. 8031 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, exterior-end chimney, three-bay facade, single-leaf entrance, paired sash windows, three-quarter width gable-roof porch supported by tapered posts on low brick piers connected by open brick work balustrade. C (Roll #18-16)
51. 8033 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, double front-facing gable roof, three-bay facade, single-leaf entrance, paired and single sash windows, gable-roof porch which has been partially enclosed but could easily be removed, alteration has not jeopardized significantly the integrity of the house, weatherboard and siding exterior wall material. C (Roll #18-15)
52. 8035 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, complex roofline with gable of rear ell resting on ridge of primary side-gable roof, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by decorative wooden posts on brick piers connected by low brick balustrade. C (Roll #18-14)
53. 8037 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof with central interior chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, partial width recessed porch supported by tapered posts on low brick piers. C (Roll #18-13)
54. 8039 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous rubblestone foundation, side-gable roof with exterior-side chimney, small gable roof dormer, three-bay facade, single-leaf entrance, house and chimney covered in modern vertical weatherboard siding, porch replaced and rubblestone does not appear to be original, all windows replaced, house suffers from loss of integrity. NC (Roll #18-12)
55. 8045 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof with exterior side chimney, shed roof dormer, full-width recessed porch supported by tall end brick piers, three-bay facade, single-leaf entrance, single and paired sash windows, decorative brackets. C (Roll #18-11)
56. 8215 5th Avenue South, ca. 1920, Pyramidal. One-story frame dwelling, continuous brick foundation with some use of rubblestone, hipped-roof with front-facing gable wing, partial-width shed roof porch supported by decorative ironwork posts, asbestos shingle exterior wall material, two-bay facade, single-leaf entrance, 6/6 sash windows. C (Roll #15-16)
57. 8219 5th Avenue South, ca. 1920, No Style. One-story frame dwelling, side-gable roof, continuous brick foundation, five-bay facade, single-leaf entrance, 4/4 sash windows, partial-width shed roof porch supported by simple wooden posts, exposed rafter ends and decorative brackets. C (Roll #15-15)
58. 8221 5th Avenue South, ca. 1952, Modern. One-story frame dwelling, cross-hip roof, continuous concrete block foundation, three-bay facade, single sash and tripartite windows, small recessed porch supported by decorative ironwork posts, side entrance off porch. C (Roll #15-14)
59. 8229 5th Avenue South, ca. 1952, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof, front-facing gable wing with partial width recessed porch supported by decorative metal post, single-leaf entrance off side porch, paired aluminum sash windows, asbestos shingle exterior wall material. C (Roll #15-13)
60. 8345 5th Avenue South, ca. 1910, Pyramidal. One-story frame dwelling, brick pier foundation, steeply pitched hipped roof, front-facing gable, three-bay facade, single-leaf entrance, wraparound screened-in porch supported by wooden supports, recessed side wing. C (Roll #28-16)
61. 8401 5th Avenue South, ca. 1930, Bungalow. One-and-a-half story frame dwelling, continuous brick foundation, cross-gable roof with front-facing decorative gable and front-facing gable roof porch supported by decorative metal posts on low brick piers, four-bay facade, single-leaf entrance, single and triple aluminum vertical-sash windows, aluminum siding exterior wall material C (Roll #36-6)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 9

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
62. 8403 5th Avenue South, ca. 1940, Minimal Traditional. One-and-a-half story frame dwelling on full basement, cross-gable roof with large front-facing decorative gable, three-bay facade, single-leaf entrance, paired and triple 6/6 sash windows, small gable-roof overhang, partial-width brick terrace, aluminum siding exterior wall material. C (Roll #36-5)
63. 8409 5th Avenue South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, asbestos shingle exterior wall material, three-bay facade, single-leaf entrance, large multi-pane fixed windows, terrace with metal railing. C (Roll #36-4)
64. 8413 5th Avenue South, ca. 1960, Modern. One-story frame dwelling with full basement garage, brick veneer exterior wall material, low-pitched hipped roof, three-bay facade, small recessed porch supported by decorative metal post, aluminum casement windows. House may be earlier with later brick veneer exterior. NC (Roll #36-3)
65. 8417 5th Avenue South, ca. 1930, Minimal Traditional. One-and-a-half story frame dwelling, continuous brick foundation, exterior-end brick chimney, cross-gable roof with dominant front-facing decorative gable, three-bay facade, central single-leaf entrance, triple and paired 6/6 sash windows, partial-width brick terrace, aluminum siding exterior wall material. C (Roll #36-2)
66. 8421 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, primary side-gable roof with rear ell, exterior-side chimney, brick pier foundation, weatherboard exterior wall material, three-quarter width gable-roof porch supported by tall end brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows. C (Roll #36-1)
67. 8425 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, double front-facing gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, paired 6/1 sash windows, weatherboard exterior wall material, metal awnings over all three bays. C (Roll #35-23)
68. 8429 5th Avenue South, ca. 1960, Modern. One-story frame dwelling over garage, brick veneer exterior wall material, cross-gable roof with front-facing gable wing, three-bay facade, single and paired 6/6 sash windows, single-leaf entrance, partial-width shed roof porch. NC (Roll #35-22)
69. 8435 5th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, stucco foundation, side-gable roof with central interior chimney and front-facing decorative gable over projecting bay window with half-hipped roof, subordinate side-gable roof porch to left, five-bay facade, single-leaf arched entrance beneath shed-roof overhang, 4/1 bay sash windows. C (Roll #35-21)
70. 8439 5th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick veneer exterior wall material, primary side-gable roof with rear ell, interior chimney, four-bay facade, single-leaf entrance, single and triple 4/1 sash windows, single-leaf entrance, front-facing gable porch supported by tall end brick piers connected by open brickwork balustrade. C (Roll #35-20)

6th Avenue South

71. 7800 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, primary side-gable roof, exterior and interior chimneys capped with chimney pots, three-bay facade, central single-leaf entrance, paired 3/1 sash windows, gable-roof porch supported by boxed columns on low-brick piers connected by metalwork balustrade. C (Roll #25-13)
72. 7801 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, primary side-gable roof, exterior side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, full-width gable roof porch supported by tall end-brick piers connected by low-lying brick balustrade and a flattened arch, decorative brackets along eaves. C (Roll #25-12)
73. 7803 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, brick foundation, gable roof porch supported by decorative metalwork supports, three-bay facade, central single-leaf entrance, single and paired sash windows, weatherboard exterior wall material. C (Roll #25-11)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 10

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
74. 7804 6th Avenue South, ca. 1952, Modern. One-story frame dwelling, concrete foundation, low-lying hipped roof, three-bay facade, single and paired sash windows, recessed porch, asbestos shingle exterior wall material. C (Roll #25-14)
 75. 7807 6th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, side-gable roof with rear ell, exterior side chimney, three-bay facade, central single-leaf entrance, single and paired sash windows, central gable-roof entrance porch supported by boxed posts. C (Roll #25-10)
 76. 7810 6th Avenue South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, cross-gable roof, front-facing gable chimney, brick foundation, dominant front-facing gable roof porch supported by tall end brick piers, faux-timber work on front and side gables, four-bay facade, paired sash windows, weatherboard exterior wall material. C (Roll #25-15)
 77. 7815 6th Avenue South, ca. 1925, Spanish Revival. One-story frame dwelling, side-gable roof, stucco exterior wall material, three-bay facade, open recessed porch to side supported by tall stuccoed piers, single-leaf entrance, multi-pane sash-over-one windows. C (Roll #25-7)
 78. 7817 6th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, primary side-gable roof with dominant double front-facing gable containing a front-facing brick chimney, small gable entrance portico supported by tall brick piers, open side-porch supported by tall brick piers, five-bay facade comprised of a picture window and 6/6 sash windows. C (Roll #25-6)
 79. 7818 6th Avenue South, ca. 1925, Dutch Colonial Revival. One-story frame dwelling, gambrel roof with full-width shed gable, side-porch, paired and single sash windows, small gable roof overhang on primary entrance. C (Roll #25-16)
 80. 7819 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, central interior chimney, five-bay facade, central single-leaf entrance flanked by single and paired sash windows, central gable-roof porch supported by tall end brick piers connected by low brick balustrade, brick foundation. C (Roll #25-5)
 81. 7820 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, dominant front-facing gable roof, recessed wraparound porch supported by tall brick piers, three-bay facade, single-leaf entrance, single and paired sash windows, later addition of side porte cochere supported by identical brick piers. C (Roll #25-17)
 82. 7821 6th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling resting on high concrete block foundation, exterior-end chimney, cross-gable roof with front facing gable wing, three-bay facade, central single-leaf entrance, picture window, aluminum siding. C (Roll #25-4)
 83. 7822 6th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, side-gable roof, central interior chimney, three-bay facade, central single-leaf entrance, paired sash windows, gable-roof porch supported by tall end brick piers. C (Roll #25-18)
 84. 7824 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, full-width gable-roof porch supported by squat tapered posts on tall brick piers, low-lying metalwork balustrade. C (Roll #25-19)
 85. 7900 6th Avenue South, ca. 1940, Bungalow. One-story frame dwelling, rubblestone foundation, front-facing gable roof, three-bay facade, single-leaf entrance, pairs of 2/2 sash windows, partial-width gable roof porch supported by fluted boxed columns, side porch. C (Roll #25-23)
 86. 7901 6th Avenue South, ca. 1940, Bungalow. One-story frame dwelling, brick basement, front-facing gable roof with exposed rafter ends, gable roof porch supported by decorative metal posts resting on low brick piers, three-bay facade, single-leaf entrance, paired sash windows, weatherboard exterior wall material. C (Roll #25-1)
 87. 7903 6th Avenue South, ca. 1940, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior side chimney, asbestos shingle exterior wall material, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by decorative ironwork supports. C (Roll #24-24)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 11

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

88. 7905 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, exterior-end chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by open brickwork balustrade, weatherboard exterior wall material. C (Roll #24-23)
89. 7906 6th Avenue South, ca. 1910, Pyramidal. One-story frame dwelling, brick pier foundation, hip-with-cross gable roof, front-facing gable wing with shinglework in gable, three-bay facade, single-leaf entrance, single and paired sash windows, interior chimney, wraparound hipped roof porch supported by boxed supports. C (Roll #25-24)
90. 7911 6th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, exterior-side chimney, front-facing gable wing, three-bay facade, picture and sash windows, single-leaf entrance, partial-width shed roof porch supported by decorative metal posts, asbestos shingle exterior wall material. C (Roll #24-22)
91. 7912 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, complex roofline with side-gables and elongated gable resting on main ridge, full-width shed roof porch with central decorative gable over arched entrance opening, porch supported by four brick piers, three-bay facade, central single-leaf entrance, pairs of sash windows. C (Roll #26-1)
92. 7915 6th Avenue South, c. 1920. L-cottage. One-story frame dwelling, interior chimney, brick pier foundation (in-filled), front-facing gable wing, five-bay facade, two single-leaf entrances, single and paired sash windows, wraparound porch supported by plain posts. C (Roll #24-21)
93. 7917 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, primary side-gable roof, interior chimney, three-bay facade, central single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by paired tapered posts on brick piers connected by brick balustrade. C (Roll #24-20)
94. 7921 6th Avenue South, ca. 1920. Pyramidal. One-story frame dwelling, cross-gable roof, brick pier foundation (in-filled), front-facing gable wing, full-width porch following contours of facade, paneled wooden supports, three-bay facade, single leaf entrance with transom, 1/1 sash windows, recessed side-wing. C (Roll #24-19)
95. 7931 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof with dominant front-facing gable wing, full-width recessed porch supported by tall end brick piers with low-lying wooden balustrades, three-bay facade, central single-leaf entrance, paired 4/1 paired sash windows, decorative brackets, weatherboard exterior wall material, basement level area has been enclosed. C (Roll #24-18)
96. 8201 6th Avenue South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, metal casement windows, side carport supported by metal posts. NC (Roll #15-21)
97. 8212 6th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, rusticated stone foundation and exterior-end chimney, side-gable roof, three-bay facade, single-leaf entrance, paired 6/6 sash windows, gable roof porch supported by three slender wooden posts connected by wooden balustrades, aluminum siding exterior wall material. C (Roll #15-22)
98. 8214 6th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, aluminum siding and brick veneer exterior wall material, side-gable roof, four-bay facade, concrete block foundation visible beneath brick veneer, four-bay facade, single-leaf entrance, sash aluminum windows, gable-roof porch supported by four slender wooden posts, appears an early house type that has been altered extensively. NC (Roll #15-23)
99. 8408 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tapered posts on medium height brick piers, weatherboard wall material. C (Roll #29-24)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 12

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
100. 8411 6th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, poured concrete foundation, side-gable roof, central interior chimney, weatherboard exterior wall material, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, central gable-roof porch supported by tall end brick piers. C (Roll #29-22)
 101. 8412 6th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, gable-on-hip roof with side shed dormers, hip roof porch supported by tall end brick piers and connected by decorative open-brickwork balustrade, appears that former side-porch has been enclosed, three-bay facade, single-leaf entrance, sash windows and sliding glass door. C (Roll #29-23)
 102. 8420 6th Avenue South, ca. 1955, Modern. One-story frame dwelling, low-pitched hip roof, poured concrete foundation, two-bay facade, sash and picture window, partial-width recessed porch supported by decorative ironwork support, siding and brick veneer exterior wall material. NC (Roll #29-21)
 103. 8424 6th Avenue South, ca. 1940, No Style. One-story frame dwelling, front-facing gable roof, three-bay facade, single-leaf entrance, 4/4 sash windows, shed roof porch. C (Roll #29-20)
 104. 8437 6th Avenue South, ca. 1930, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, two-bay facade, single-leaf entrance, band of triple windows, weatherboard exterior wall material, full-width terrace. C (Roll 36-10)
 105. 8440 6th Avenue South, ca. 1930, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, primary side-gable roof with rear ell and two-front facing gable wings, front-facing chimney between wings, one gable contains band of three sash windows, right gable contains open porch supported by arched openings and single-leaf entrance. C (Roll #36-7)
 106. 8444 6th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, interior chimney, four-bay facade, single-leaf entrance, single and paired sash windows, small round window at left, aluminum siding exterior wall material. C (Roll #36-8)
 107. 8448 6th Avenue South, ca. 1940, Minimal Traditional. One-and-a-half story frame dwelling, side-gable roof, 2/3 bay facade, central single-leaf entrance, 6/6 sash windows. C (Roll #36-9)

7th Avenue South

108. 7720 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, side-gable roof, four-bay facade, single-leaf entrance, sash windows, small gable-roof portico supported by decorative ironwork posts. C (Roll #23-23)
109. 7721 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roofline with primary side-gable roof, exterior end chimney, three-bay facade, single-leaf entrance, paired sash windows, gable roof porch supported by squat tapered posts on brick piers, brick balustrade, decorative brackets and louvered vents. C (Roll #23-22)
110. 7722 7th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear ell resting on primary side-gable roof, three-bay facade, central single-leaf entrance, small gable-roof portico supported by decorative iron supports. C (Roll #23-24)
111. 7723 7th Avenue South, ca. 1930, Minimal Traditional. One-and-a-half story frame dwelling, front-facing gable wing containing small 6/1 sash window in gable, interior chimney, partial-width shed roof porch supported by two slender colonettes, three-bay facade, single and paired sash windows, single-leaf entrance, secondary single-leaf entrance in side off projecting gable wing, asbestos shingle exterior wall material. C (Roll #23-21)
112. 7724 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, interior chimney, three-bay facade, gable-roof porch partially enclosed, single-leaf entrance. C (Roll #24-1)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 13

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
113. 7725 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, front-facing clipped gable roof, small partial-width recessed porch supported by decorative metalwork post, single and paired sash windows, single-leaf entrance, weatherboard exterior wall material. C (Roll #23-20)
 114. 7726 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, exterior-end chimney, three-bay facade, central single-leaf entrance, gable-roof porch supported by squat posts on tall brick piers, paired sash windows, weatherboard exterior wall material. C (Roll #24-2)
 115. 7727 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous concrete foundation, side-gable roof with tip of rear ell resting on primary roofline, three-bay facade, central single-leaf entrance, paired sash windows, front-facing broken-gable roof porch supported by tall tapered posts resting on rubblestone balustrade. C (Roll #23-19)
 116. 7729 7th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, side-gable roof, exterior side chimney, three-bay facade, single-leaf entrance, picture and sash windows, gable-roof entrance porch supported by two square columns, asbestos shingle exterior wall material. C (Roll #23-18)
 117. 7730 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, continuous brick foundation, exterior-end chimney, three-bay facade, central single-leaf entrance, paired sash windows, gable-roof porch supported by tall end brick piers. C (Roll #24-3)
 118. 7731 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, cross-gable roof with front-facing gable wing, partial-width shed roof porch supported by wooden posts, asbestos shingle exterior wall material. C (Roll #23-17)
 119. 7800 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, exterior-side chimney, three-bay facade, central single-leaf entrance, gable-roof porch supported by tapered posts on brick piers connected by low-lying brick balustrade. C (Roll #24-4)
 120. 7801 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, aluminum siding exterior wall material, three-bay facade, single-leaf entrance, replacement aluminum windows, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade. C (Roll #23-16)
 121. 7804 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, clipped side-gable roof, continuous brick foundation, interior chimney, three-bay facade, single and paired sash windows, single-leaf entrance, gable-roof porch supported by tall piers. C (Roll #24-5)
 122. 7805 7th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, continuous brick foundation, cross-gable roof with two-front facing gables, gable-front porch (glassed-in), partial terrace, three-bay facade, single-leaf entrance, sash and casement windows, stucco material in gables. C (#23-15)
 123. 7809 7th Avenue South, ca. 1925, Tudor Revival. One-story frame dwelling, continuous brick foundation, cross-gable roof, front-facing chimney, gable-roof porch supported by tall end brick piers, three-bay facade, small single-light to left of chimney, single-leaf entrance and paired sash window, weatherboard exterior wall material. C (Roll #23-14)
 124. 7810 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, slightly clipped side-gable roof, exterior side chimney, three-bay facade, pairs of sash windows, single-leaf entrance, full-width gable-roof porch supported by tall end brick piers and open brickwork balustrade. C (Roll #24-6)
 125. 7820 7th Avenue South, ca. 1930, Bungalow/Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, side-gable roof, interior chimney, four-bay facade, single-leaf entrance set in gable-roof entrance, gable-roof porch supported by decorative arches. C (Roll #24-7)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 14

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
126. 7821 7th Avenue South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, side-gable roof with shed roof dormer, 3/5 bay facade, chimney located between main body of dwelling and subordinate side-gable glassed-in porch with arched openings, gable-roof entrance porch with arched opening, 1/1 sash windows. C (Roll #23-13)
 127. 7823 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, stucco foundation material, interior chimney, front-facing gable roof, three-bay facade, single-leaf entrance, paired aluminum (replacement) windows, single-leaf entrance, gable-roof porch supported by decorative metalwork supports, aluminum siding. C (Roll #23-12)
 128. 7826 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior side chimney, three-bay facade, single-leaf entrance, single and paired sash windows, gable-roof porch supported by tapered posts on brick piers, exposed rafter ends and decorative brackets, asbestos shingle exterior wall material. C (Roll #24-8)
 129. 7827 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, complex roofline with gable of rear ell resting on ridge of primary side-gable roof, rear cross-gables, exterior-end chimney, three-bay facade, single and paired supports, single-leaf entrance, tapered lattice work supports on low brick piers connected by decorative concrete block balustrade. C (Roll #24-10)
 130. 7828 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with dominant front-facing gable-roof porch (partially enclosed), two-bay facade, single-leaf entrance, single brick pier remaining. House still retains high degree of integrity. C (Roll #24-9)
 131. 7831 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof with dominant front-facing gable, continuous brick foundation, exterior-side chimney, three-bay facade, single-leaf entrance, sash windows, gable-roof porch supported by tapered posts on low brick balustrade, decorative brackets. C (Roll #23-10)
 132. 7901 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, continuous brick foundation, weatherboard exterior wall material, three-bay facade, two tripartite windows, gable-roof porch extending left to side-gable roof porte cochere, tall stuccoed supports. C (Roll #23-9)
 133. 7909 7th Avenue South, ca. 1970, Modern. Two-story duplex, faux-Mansard roof, with paired arched windows, 2/4 bay facade, two single leaf entrances, aluminum sash windows, brick veneer exterior wall material. NC (Roll #23-8)
 134. 7910 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, two-bay facade, partial-width recessed porch supported by single pier, single and paired sash windows, weatherboard exterior wall material, exposed rafter ends and decorative brackets. C (Roll #24-11)
 135. 7912 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof extending over full-width recessed porch supported by three tall brick piers and connected by low-lying brick balustrade, three-bay facade, central single-leaf entrance, multi-pane/one sash windows, exposed rafter ends and decorative brackets. C (Roll #24-12)
 136. 7914 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof over full-width recessed porch supported by square posts on brick piers, three-bay facade, single-leaf entrance, interior chimney, weatherboard exterior wall material, sash windows. C (Roll #24-13)
 137. 7915 7th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear ell resting on primary side-gable roofline, exterior-side chimney, aluminum siding exterior wall material, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by brick balustrade. C (Roll #23-7)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 15

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

138. 7916 7th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, aluminum siding exterior wall material, former gable-roof porch enclosed with band of 4/4 sash windows, squat tapered posts on tall brick piers still evident, decorative brick work evident on former balustrade, small porch to side of original porch created by adding a small aluminum shed and metal post. C (Roll #24-14)
139. 7917 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with primary side-gable roofline, exterior-side chimney, asbestos shingle exterior wall material, three-bay facade, single-leaf entrance, paired 4/1 sash windows, near full-width gable roof with tall end brick piers, low lying brick balustrades, decorative brackets. C (Roll #23-6)
140. 7919 7th Avenue South, ca. 1920, Pyramidal. One-story frame dwelling, metal hipped roof with front-facing gable wing, partial recessed porch supported by three tall brick piers connected by open brickwork balustrade, porch supports and balustrade not original but appear to be historic, four-bay facade, single-leaf entrance with transom and sidelights, 1/1 sash windows, C (Roll #42-5)
141. 7921 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, continuous brick foundation, three-bay facade, off-centered single-leaf entrance, paired 6/6 sash windows, gable-roof porch supported by tall end brick piers connected by open brickwork balustrade, aluminum siding exterior wall material. C (Roll #42-4)
142. 7924 7th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, primary side-gable roof, interior chimney, gable-roof porch supported by squat posts on brick piers, small flat-roofed side porch to right, four-bay facade, single-leaf entrance, 4/1 sash windows, aluminum siding exterior wall material. C (Roll #24-15)
143. 7927 7th Avenue South, ca. 1925, L-cottage. One-story frame dwelling on brick pier foundation (in-filled), cross-gable roof with front-facing gable wing, three-bay facade, single-leaf entrance, former partial-width porch partially enclosed, house suffers high degree of loss in regard to integrity. NC (Roll #42-3)
144. 7928 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, front-facing gable wing extending out over recessed porch, tall tapered rubblestone porch supports with secondary interior plain wooden posts, single-leaf entrance located in gable wing, band of three 5/1 sash windows to left, rubblestone foundation, decorative brackets and exposed rafter ends, two-light window located in front gable. C (Roll #24-16)
145. 7930 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, interior chimney, three-quarter width gable-roof porch supported by squat tapered posts on tall brick piers connected by low brick balustrade, three-bay facade, single-leaf entrance, paired 4/1 sash windows, single-leaf entrance, weatherboard exterior wall material. C (Roll #24-17)
146. 7931 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, cross-gable roof with dominant front-facing gable, partially recessed porch with gable roof supported by tall brick piers, three-bay facade, single-leaf entrance, single and paired sash windows, decorative brackets, multi-light windows in gables, asbestos shingle exterior wall material. C (Roll #23-2)
147. 8007 7th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof, asbestos shingle exterior wall material, three-bay facade, single-leaf entrance off small side-gable roof porch supported by wooden posts, 6/1 sash windows. C (Roll #21-1)
148. 8011 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, weatherboard exterior wall material, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tall end brick piers. C (Roll #21-2)
149. 7th Avenue South, ca. 1930, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant central decorative wall gable, exterior end chimney, three-bay facade, central single-leaf entrance, single and paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #17-3)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 16

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

150. 8103 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, dominant front-facing gable-roof with subordinate rear gables, three-quarter width recessed porch supported by short wooden posts on tall end brick piers, four-bay facade with single and paired sash windows, single-leaf entrance, aluminum siding exterior wall material. C (Roll #17-2)
151. 8105 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with rear ell, gable of rear ell resting on primary roofline, exterior side chimney, three-bay facade, single-leaf entrance, near-full width gable roof porch supported by squat tapered piers on tall end brick piers, weatherboard exterior wall material. C (Roll #17-1)
152. 8106 7th Avenue South, ca. 1952, Modern. One-story frame dwelling on basement, continuous concrete block foundation, cross-hip roof with two front facing hipped-roof wings, four-bay facade, metal casement and multi-pane glass windows, single-leaf entrance, small terrace between two wings, asbestos shingle and brick veneer exterior wall material. C (Roll #17-2)
153. 8110 7th Avenue South, ca. 1952, Modern. One-story frame dwelling, continuous concrete foundation, gable-on-hip roof with projecting half-hipped roof porch supported by decorative metal posts, three-bay facade, single-leaf entrance, multi-pane and sash windows, aluminum siding exterior wall material. C (Roll #16-23)
154. 8114 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, three-bay facade, central single-leaf entrance, single and paired casement windows, gable-roof porch supported by decorative ironwork posts, vertical weatherboard exterior wall material. C (Roll #16-22)
155. 8115 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, stucco over brick foundation, side-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, near full-width gable-roof porch supported by tall end stuccoed piers with low stuccoed balustrade. C (Roll #16-24)
156. 8118 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof, front-facing gable wing, former partial-width porch enclosed, three-bay facade, windows configuration obscured by piece of latticework, aluminum siding exterior wall material. NC (Roll #16-21)
157. 8124 7th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, three-bay facade, single and paired 6/6 double-hung sash windows, small recessed porch supported by square posts and connected by wooden balustrades, single-leaf entrance. C (Roll #16-20)
158. 8301 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick and stucco foundation, dominant front-facing gable with side gable-wing, four-bay facade, two single-leaf entrances, arched entrance set in side wing, 4/1 sash windows, small gable-roof porch supported by highly decorative slender wooden posts and balustrade, decorative brackets, interior and exterior side chimneys. C (Roll #9-12)
159. 8311 7th Avenue South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, low-pitched hipped roof, four-bay facade, single-leaf entrance, single, paired and triple sash windows. C (Roll #9-10)
160. 8312 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof with side shed roof dormers, four-bay facade, 4/1 sash windows, single-leaf entrance, wooden shingle exterior wall material, three-quarter width gable roof porch supported by three wooden posts on low brick piers. C (Roll #9-11)
161. 8319 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with rear shed and dominant front-facing gable roof porch supported by tall end brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows, weatherboard exterior wall material. C (Roll #9-9)
162. 8321 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling on concrete foundation, side-gable roof, interior and exterior-side chimney, five-bay facade, sash and fixed multi-pane windows, small gable-roof porch supported by wooden posts. C (Roll #9-8)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 17

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

163. 8325 7th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling on concrete block foundation, cross-gable roof with double-front facing gables, three-bay facade, single-leaf entrance, single and triple sash windows, exterior-side chimney, aluminum siding exterior wall material. C (Roll #9-7)
164. 8335 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof with front-facing gable wing containing glassed-in porch, three-bay facade, single-leaf entrance, paired sash windows, brick foundation. C (Roll #9-6)
165. 8337 7th Avenue South, ca. 1955, Modern. House may be earlier but appears to have undergone a recent remodeling. One-story frame on continuous brick foundation, side-gable roof, four-bay facade, single-leaf entrance, aluminum sash and plate glass windows, small gable-roof porch supported by ironwork posts. NC (Roll #9-5)
166. 8339 7th Avenue South, ca. 1952, Modern. One-story frame dwelling on concrete block foundation, full basement, hip and cross-gable roof, three-bay facade, single-leaf entrance, sash windows, picture window flanked by sash windows, low-pitched hipped roof supported by decorative ironwork posts. C (Roll #9-4)
167. 8346 7th Avenue South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, gable-on-hip roof, interior chimney, three-bay facade, single sash and picture window, single-leaf entrance on small recessed porch, asbestos shingle exterior wall material. C (Roll #32-11)
168. 8412 7th Avenue South, ca. 1930, Bungalow. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof, five-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by tall brick piers, aluminum siding. C (Roll #36-11)
169. 8432 7th Avenue South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, cross-hip roof, four-bay facade, single-leaf entrance, paired sash windows and picture window, aluminum siding exterior wall material, small recessed stoop. C (Roll #32-10)
170. 8440 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, near full-width gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #32-12)
171. 8442 7th Avenue South, ca. 1960, Modern. One-story frame dwelling with brick veneer exterior wall material, concrete slab foundation, cross-hip roof, four-bay facade, single-leaf entrance, paired vertical sash windows, gable-roof porch supported by three decorative metal posts. NC (Roll #32-13)
172. 8443 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, paired sash windows, three-quarter width gable-roof porch supported by tall brick piers. C (Roll #32-17)
173. 8444 7th Avenue South, ca. 1955, Modern. One-story concrete block dwelling, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, paired vertical-sash windows. NC (Roll #32-14)
174. 8445 7th Avenue South, ca. 1925, Bungalow. One-story frame dwelling with rubblestone exterior wall material, side-gable roof with exterior-side chimney, three-bay facade, central single-leaf entrance, paired multi-pane-over-one sash windows, central gable-roof over arched porch on full terrace supported by tall rubblestone piers and rubblestone balustrade. C (Roll #32-16)
175. 8447 7th Avenue South, ca. 1952, Minimal Traditional. Two-story dwelling over basement level garage, two-story block with wing extending off left side, 2/2 bay facade with three-bay wing, partial-width one-story porch on main block, single-leaf entrance with five-pane sidelight to right, sash windows. Second level appears to have been later addition. NC (Roll #32-15)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 18

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

7th Court South

176. 7715 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, weatherboard and wood shingle exterior wall material, single-leaf entrance, vertical sash windows, gable-roof porch supported by decorative metal posts. C (Roll #22-3)
177. 7718 7th Court South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, low-pitched hipped roof, five-bay facade, single-leaf entrance, aluminum sash windows, single-leaf entrance, small hipped-roof porch supported by decorative metal posts. NC (Roll #22-5)
178. 7719 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, aluminum sash windows, single-leaf entrance, gable-roof porch supported by decorative metal posts, asbestos-shingle exterior wall material. C (Roll #22-2)
179. 7720 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, brick veneer exterior wall material, front-facing gable roof, three-bay facade, single-leaf entrance, single and paired aluminum vertical-sash windows, gable-roof porch supported by end brick piers connected by low brick balustrade. C (Roll #22-6)
180. 7721 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof with front-facing gable wing, exterior-end chimney, three-bay facade, single-leaf entrance, sash and picture windows, partial-width shed roof porch supported by wooden posts and cross-brace balustrade, asbestos shingle exterior wall material. C (Roll #22-4)
181. 7722 7th Court South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, side-gable roof, exterior-side chimney, weatherboard exterior wall material, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #22-7)
182. 7723 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof, continuous concrete block foundation, four-bay facade, single-leaf entrance, gable-roof porch supported by slender wooden posts, single-sash windows, asbestos shingle-exterior wall material. C (Roll #22-1)
183. 7728 7th Court South, ca. 1955, Ranch. One-story frame dwelling, brick veneer and vertical weatherboard exterior wall material, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, and aluminum windows. NC (Roll #22-8)
184. 7729 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by squat tapered posts on brick piers connected by low-lying brick balustrade. C (Roll #21-24)
185. 7731 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof with front-facing gable, continuous brick foundation, two interior chimneys located in rear ell, three-bay facade, single and paired sash windows, single-leaf entrance, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade. C (Roll #21-23)
186. 7732 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, exterior-end chimney, three-bay facade, three-quarter width recessed porch, picture and sash windows, single-leaf entrance to side of porch, asbestos shingle exterior wall material. C (Roll #22-9)
187. 7800 7th Court South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with gable roof porch supported by arched openings, front-facing chimney, four-bay facade, 6/6 sash windows, single-leaf entrance. C (Roll #22-12)
188. 7804 7th Court South, ca. 1952, Modern. One-story frame dwelling, continuous concrete foundation, gable-on-hip roof, interior chimney, three-bay facade, aluminum casement windows, three-bay facade, small recessed porch supported by decorative metal post, asbestos shingle exterior wall material. C (Roll #22-13)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 19

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

189. 7805 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-side chimney, three-bay facade, paired 4/1 sash windows, single-leaf entrance, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade, aluminum siding exterior wall material. C (Roll #21-22)
190. 7809 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with primary side-gable with central decorative gable dormer, central interior chimney, three-bay facade, single-leaf entrance, paired and single 6/1 sash windows, gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #21-21)
191. 7811 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing gable, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 6/1 sash windows, full-width shed roof porch with central arched roofline supported by paired classical colonettes, weatherboard exterior wall material. C (Roll #21-20)
192. 7814 7th Court South, ca. 1925, Tudor Revival. One-story frame dwelling, cross-gable roof with front-facing gable containing gable-roof entrance porch supported by arched opening and front-facing double-stacked chimney, recessed porch supported by arched openings, gable-roof dormer to right of front-facing gable, four-bay facade, aluminum vertical sash windows and French doors. C (Roll #22-14)
193. 7818 7th Court South, ca. 1950, Minimal Traditional. One-and-a-half story frame dwelling that has been covered with later brick veneer exterior wall material, primary side-gable roof, double-front facing gable containing arched entrance, single and paired sash windows, interior chimney. C (Roll #22-15)
194. 7820 7th Court South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, four-bay facade, paired sash and large multi-pane windows, single-leaf entrance, asbestos shingle exterior wall material, small gable-roof porch supported by decorative metal posts. C (Roll #22-16)
195. 7821 7th Court South, ca. 1930, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with two front-facing gables located at each end of the facade, central front-facing double-stacked chimney with elaborate chimney tops, three-bay facade, 6/1 sash windows in far-right gable, large picture windows located on either side of chimney, side-porch supported by arched openings in far left gable. C (Roll #21-19)
196. 7824 7th Court South, ca. 1952, Modern. One-story frame dwelling, concrete foundation, low-pitched hipped roof, asbestos shingle and brick veneer exterior wall material, four-bay facade, aluminum sash and picture windows. C (Roll #22-17)
197. 7827 7th Court South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with two front-facing gables, one gable contains gable-roof arched entrance alcove and front-facing chimney, side-porch supported by ogee arched openings, paired sash windows. C (Roll #21-18)
198. 7901 7th Court South, ca. 1940, Minimal Traditional. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with front-facing gable, interior chimney, four-bay facade, 4/1 sash and picture windows, single-leaf entrance, small gable roof entrance porch supported by decorative metal posts, side glassed-in porch. C (Roll #21-17)
199. 7911 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, paired 4/1 sash windows, single-leaf entrance, partial-width gable-roof porch (glassed-in) supported by tall end brick piers connected by low brick balustrade. C (Roll #21-16)
200. 7914 7th Court South, ca. 1925, Bungalow. One-story frame dwelling on full basement, cross-gable roof with gable of rear ell resting on roofline of primary side-gable roof, exterior-side chimney, four-bay facade, aluminum sash and 4/1 wooden sash windows, single-leaf entrance, gable roof porch supported by tall stuccoed piers, asbestos shingle and stucco exterior wall material. C (Roll #22-19)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 20

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
201. 7915 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side and interior chimneys, three-bay facade, central single-leaf entrance, 4/1 sash windows, squat tapered piers on medium brick piers connected by open brickwork balustrade, aluminum siding exterior wall material. C (Roll #21-15)
 202. 7916 7th Court South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with front-facing gable with front-facing chimney and gable-roof porch supported by arched opening, four-bay facade, wooden casement and sash windows. C (Roll #22-20)
 203. 7917 7th Court South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable, exterior-end chimney, three-bay facade, single-leaf entrance, paired sash and picture window, partial-width shed-roof porch supported by decorative metal posts, garage and connecting passageway set back on lot to rear of main dwelling. C (Roll #21-14)
 204. 7918 7th Court South, ca. 1940, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with three front-facing gables, central gable-roof porch (glassed-in) flanked by gable with front-facing chimney, wood sash and casement windows. C (Roll #22-21)
 205. 7920 7th Court South, ca. 1940, Tudor Revival. One-story frame dwelling, continuous brick foundation, cross-gable roof with asymmetrical gable and gable roof porch flanking a centrally placed front-facing chimney, three-bay facade, arched entrance in left-gable, paired 6/6 sash windows and French doors. C (Roll #22-22)
 206. 7921 7th Court South, ca. 1940, Bungalow. One-story frame dwelling, continuous brick foundation, low-pitched hipped roof with front-facing decorative gable, three-bay facade, single-leaf entrance, single sash windows, full-width shed roof porch supported by slender wooden posts, asbestos shingle exterior wall material. C (Roll #21-13)
 207. 7924 7th Court South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, cross-gable roof with front-facing gable-roof porch supported by arched openings, front-facing chimney, two-bay facade, single-leaf entrance located to side of porch, paired sash windows. C (Roll #22-23)
 208. 7925 7th Court South, ca. 1980, Modern. One-story manufactured dwelling, rectangular in shape, five-bay facade, side-gable roof, and single-leaf entrance. NC (Roll #21-12)
 209. 7928 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, three-bay facade, single-leaf entrance, 4/1 sash windows, gable roof porch supported by wooden posts on low brick piers, aluminum siding exterior wall material. C (Roll #22-24)
 210. 7929 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear ell resting on roofline of primary side-gable roof, exterior-side chimney, three-bay facade, gable-roof porch (glassed-in) supported by tall end brick piers, 4/1 sash windows. C (Roll #21-11)
 211. 7930 7th Court South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, exterior-side chimney, four-bay facade, central single-leaf entrance, 6/6 and 1/1 sash windows, partial-width shed roof porch supported by decorative iron-work posts. C (Roll #23-1)
 212. 7931 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing decorative gable, three-bay facade, vertical sash windows, single-leaf entrance, full-width half-hipped roof porch supported by four-decorative metal posts. C (Roll#21-10)
 213. 8301 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, masonry foundation covered with stucco, side-gable roof, weatherboard exterior wall material, three-bay facade, paired 4/1 sash windows, gable-roof porch supported by tall end stucco piers. C (Roll #8-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 21

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
214. 8304 7th Court South ca. 1960, Modern. One-story frame dwelling on concrete block foundation with front-facing garage door opening, four-bay facade, single-leaf entrance, aluminum casement windows, partial-width shed roof porch supported by decorative metal posts. NC (Roll #9-3)
 215. 8308 7th Court South, ca. 1940, Bungalow. Small one-story frame dwelling, side-gable roof, three-bay facade, 6/6 sash window (original) and 2/2 aluminum sash window, central single-leaf entrance, gable-roof porch supported by slender posts, exposed rafter ends, side carport. C (Roll #9-2)
 216. 8309 7th Court South, ca. 1948, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof with front-facing gable wing, three-bay facade, partial-width shed roof porch supported by slender wooden posts, asbestos shingle exterior wall material. C (Roll #8-14)
 217. 8312 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, side-gable roof, three-bay facade, single-leaf entrance, paired 6/1 sash windows, three-bay facade, single-leaf entrance, gable-roof porch supported by tapered posts on low brick piers, aluminum siding exterior wall material. C (Roll #9-1)
 218. 8315 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior-chimney, three-bay facade, 8/1 sash windows, single-leaf entrance, full-width gable roof porch supported by wooden posts on low-brick piers connected by wooden balustrades, decorative brackets and exposed rafter ends. C (Roll #8-15)
 219. 8316 7th Court South, ca. 1940, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, three-bay facade, single-leaf entrance, aluminum windows, gable-roof porch supported by decorative metal work supports. C (Roll #8-22)
 220. 8320 7th Court South, ca. 1950, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, four-bay facade, single, triple and tripartite windows, small hipped-roof entrance porch supported by decorative metal support, aluminum siding wall material. C (Roll #8-21)
 221. 8321 7th Court South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hip roof with central hip roof projecting bay, three-bay facade, single and triple sash windows, small recessed porch to left, single-leaf entrance, aluminum siding exterior wall material. C (Roll #8-17)
 222. 8324 7th Court South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, interior chimney, three-bay facade, single-leaf entrance, paired and triple 4/1 sash windows, inset porch extending out into side-gable, supported by paired posts incorporating diamond-shaped designs, asbestos shingle exterior wall material. C (Roll #8-19)
 223. 8325 7th Court South, ca. 1965, Modern. One-story frame dwelling over basement garage, cross-gable roof with front-facing gable wing, four-bay facade, single-leaf entrance, single and paired sash windows, brick veneer exterior wall material. NC (Roll #8-18)
 224. 8328 7th Court South, ca. 1952, One-story frame dwelling, concrete foundation, low-pitched cross-hip roof, interior chimney, four-bay facade, single-leaf entrance, paired and tripartite window, sliding glass door, small hipped roof porch supported by decorative metal post. C (Roll #8-4)
 225. 8329 7th Court South, ca. 1965, Modern. One-story frame dwelling over basement garage, cross-gable roof with front-facing gable wing, four-bay facade, single-leaf entrance, single and paired sash windows, brick veneer exterior wall material. NC (Roll #8-18)
 226. 8330 7th Court South, ca. 1952, Modern. One-story frame dwelling, low-pitched cross-hip roof, concrete block foundation, central slightly projecting bay with triple sash window, single-leaf entrance. C (Roll #8-5)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 22

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

7th Terrace

227. 8300 7th Terrace, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior-side chimney, clipped-gable roof porch (enclosed) supported by tall end brick piers connected by tall brick balustrade, two-bay facade, paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #8-5)
228. 8301 7th Terrace, ca. 1948, Bungalow. One-story frame dwelling, continuous concrete foundation, low-pitched hipped roof, three-bay facade, single-leaf entrance, asbestos shingle exterior wall material, small gable-roof entrance porch supported by three slender posts. C (Roll #8-6)
229. 8303 7th Terrace, ca. 1948, Bungalow. One-story frame dwelling, continuous concrete foundation, front-facing gable roof, three-bay facade, single-leaf entrance, replacement aluminum windows, small gable-roof porch supported by slender wooden posts. C (Roll #8-7)
230. 8305 7th Terrace, ca. 1945, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, interior-chimney, four-bay facade, single-leaf entrance, paired 8/8 sash windows, aluminum siding exterior wall material. C (Roll #8-8)
231. 8312 7th Terrace, ca. 1952, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, small recessed porch to left, three-bay facade, paired and tripartite aluminum windows, aluminum siding exterior wall material. C (Roll #8-4)
232. 8317 7th Terrace, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, gable-on-hip roof, asbestos shingle exterior wall material, single-leaf entrance, paired aluminum sash windows. C (Roll #8-9)
233. 8320 7th Terrace, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation with faux stonework applied to front of the foundation, cross-hip roof with projecting hip roof wing, four-bay facade, single, paired and tripartite aluminum windows, single-leaf entrance, small hipped roof porch supported by decorative metal posts. C (Roll #8-3)
234. 8321 7th Terrace, ca. 1955, Modern. One-story frame dwelling, concrete block foundation with partial brick veneer exterior wall material, side-gable roof, four-bay facade, single-leaf entrance, paired aluminum sash windows. NC (Roll #8-10)
235. 8325 7th Terrace, ca. 1940, Bungalow. One-story frame dwelling, continuous brick and concrete block foundation, front-facing gable roof, three-bay facade, single-leaf entrance, gable-roof porch supported by metal posts on low brick piers, side shed-roof addition, aluminum siding wall material. C (Roll #8-11)
236. 8329 7th Terrace, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched hipped roof, three-bay facade, partial-width recessed porch supported by decorative metal posts, asbestos shingle exterior wall material. C (Roll #8-12)
237. 8331 7th Terrace, ca. 1935, Bungalow. One-story frame dwelling, continuous concrete block foundation covered with stucco, front-facing gable roof with exterior side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade. C (Roll #8-13)
238. 8332 7th Terrace, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, continuous brick foundation, house totally altered with the application of brick veneer, aluminum siding, total reworking of the front porch, replacement aluminum windows. NC (Roll #8-2)
239. 8334 7th Terrace, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by paired posts on low brick piers, weatherboard exterior wall material. C (Roll #8-1)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 23

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

8th Avenue South

240. 7804 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof, interior chimney, gable-roof porch (enclosed), single-leaf entrance, single-bay facade. C (Roll #1-20)
241. 7820 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing, interior chimney, four-bay facade, single and tripartite window, single-leaf entrance, small shed roof porch. C (Roll #1-21)
242. 7824 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, two-bay facade, single-leaf side entrance off open porch supported by metal posts, shingle exterior wall material. C (Roll #1-22)
243. 7828 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, exterior side chimney, four-bay facade, single and tripartite windows, single-leaf entrance, gable roof porch supported by simple posts, asbestos shingle exterior wall material. C (Roll #1-23)
244. 7832 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with central gable-roof wing, three-bay facade, multi-pane and tripartite window, side porch, central interior chimney, asbestos shingle exterior wall material. C (Roll #1-24)
245. 7836 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable-roof wing, interior chimney, three-bay facade, tripartite window, small gable roof porch, asbestos shingle exterior wall material. C (Roll #2-3)
246. 7840 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side gable roof, interior chimney, five-bay facade, central single-leaf entrance, tripartite window, aluminum casement windows, asbestos shingle exterior wall material. C (Roll #2-4)
247. 7844 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, exterior-end chimney, four-bay facade, single-leaf entrance, tripartite window and aluminum casement windows, partial-width flat roof porch supported by decorative metal posts, asbestos shingle exterior wall material. C (Roll #2-5)
248. 7848 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, double-hung sash windows, small gable roof porch supported by decorative ironwork posts. C (Roll #2-6)
249. 7852 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with central front-facing gable wing, interior chimney, three-bay facade, single-leaf entrance opening onto later open deck. C (Roll #2-7)
250. 8204 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, cross-gable roof, front-facing gable wing, exterior-end chimney, four-bay facade, single-leaf entrance, tripart and paired sash windows. C (Roll #6-4)
251. 8214 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling on full basement, primary side-gable roof with subordinate rear gables, three-bay facade, 4/1 sash windows, former gable-roof porch enclosed, double-leaf entrance with flanking sidelights. C (Roll #6-5)
252. 8216 8th Avenue South, ca. 1930, Minimal Traditional. One-story frame dwelling, cross-gable roof with three front-facing gables, front-facing brick chimney, three-bay facade, 6/6 sash windows, gable roof porch and gable roof entrance porch, square wooden post supports. C (Roll #6-6)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 24

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

253. 8220 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, dominant side-gable roof with small front-facing gable wing, front-facing stucco chimney, side porch, four-bay facade, single-leaf entrance, wooden shingle exterior wall material. C (Roll #7-3)
254. 8224 8th Avenue South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, dominant side-gable roof with front-facing gable wing incorporating gable roof entrance porch, side porch, three-bay facade, single leaf entrance, triple and single sash windows, wooden shingle wall material. C (Roll #7-4)
255. 8228 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling on full basement, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, partial-width gable roof porch supported by tall end brick piers. C (Roll #7-5)
256. 8304 8th Avenue South, ca. 1960, Split-Level. Two-story split level dwelling, low-pitched cross-hipped roof, two-over-two bay adjacent to two bay one-story wing, aluminum siding and brick veneer exterior wall material, single-leaf entrance. NC (Roll #7-22)
257. 8308 8th Avenue South, ca. 1960, Split-Level. Two-story split level dwelling, cross-gable roof, two-over-two bay adjacent to two bay one-story wing, brick veneer and wood siding exterior wall material, aluminum sash windows. NC (Roll #7-23)
258. 8310 8th Avenue South, ca. 1940, Bungalow. One-story frame dwelling on concrete block foundation, cross-gable roof, interior chimney, sash and casement windows, single-leaf entrance. C (Roll #7-24)
259. 8400 8th Avenue South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, hip roof with front-facing hip-roof wing, three-bay facade, sash and picture window, central single-leaf entrance, exterior side-chimney, partial-width recessed porch supported by decorative metal posts. C (Roll #30-22)
260. 8404 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low-brick balustrade. C (Roll #30-23)
261. 8406 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick basement, cross-gable roof with two front-facing gables, three-bay facade, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers and connected by brick balustrade, exterior-side chimney, aluminum siding exterior wall material. C (Roll #30-24)
262. 8410 8th Avenue South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, interior-end chimney, five-bay facade in addition to a recessed secondary entrance to far left, central single-leaf entrance, 3/1 sash windows, former side porch to right is now glassed-in. C (Roll #31-1)
263. 8416 8th Avenue South, ca. 1950, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, aluminum sash windows, asbestos shingle exterior wall material. C (Roll #31-2)
264. 8420 8th Avenue South, ca. 1952, Ranch. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hip roof, open carport, four-bay facade, single-leaf entrance, aluminum siding exterior wall material, small recessed porch with single ironwork support. C (Roll #31-3)
265. 8428 8th Avenue South, ca. 1960, Modern. One-story frame dwelling over basement garage, concrete block foundation, low-pitched cross-hip roof, interior chimney, four-bay facade, single-leaf entrance, sash and picture windows. NC (Roll #31-4)
266. 8432 8th Avenue South, ca. 1952, Modern. One-story frame dwelling over basement garage, cross-hip roof, three-bay facade, central single-leaf entrance, aluminum siding exterior wall material, aluminum 2/2 sash windows. C (Roll #33-5)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 25

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

267. 8436 8th Avenue South, ca. 1952, Modern. One-story frame dwelling over basement garage, cross-hip roof, three-bay facade, small recessed porch supported by decorative metal post, sash and picture windows, aluminum siding exterior wall material. C (Roll #33-6)
268. 8444 8th Avenue South, ca. 1940, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, two-bay facade, single-leaf entrance, small recessed porch, picture window. C (Roll #33-7)
269. 8448 8th Avenue South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, aluminum siding exterior wall material, gable-roof porch supported by tall end brick piers. C (Roll #33-8)

78th Place South

270. 750 78th Place South, ca. 1960, Ranch. One-story frame dwelling on full basement with front-facing garage door, brick veneer exterior wall material, poured concrete foundation, cross-hip roof, four bay facade, large picture window, single leaf entrance, concrete stoop, aluminum sash windows. NC (Roll #3-7)
271. 751 78th Place South, ca. 1954, Modern. One-story frame dwelling on full basement with front-facing garage door, asbestos shingle exterior wall material, low-pitched hip roof, three-bay facade, tripartite and sash windows, single-leaf entrance off small recessed porch supported by decorative metal post. NC (Roll #3-9)
272. 755 78th Place South, ca. 1955, Modern. One-story frame dwelling on full basement with front-facing garage door, asbestos shingle exterior wall material, concrete block foundation, three-bay facade, single leaf entrance, paired sash windows, partial-width shed roof porch. NC (Roll #3-8)
273. 764 78th Place South, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, exterior side chimney, continuous brick foundation, three-bay facade, central single-leaf entrance, paired sash windows, full-width gable roof porch supported by tall end brick piers connected by flattened arch and low brick balustrade, weatherboard exterior wall material. C (Roll #3-6)
274. 768 78th Place South, ca. 1955, Modern. One-story frame dwelling on full basement, low-pitched cross-hip roof, interior chimney, five-bay facade, single leaf entrance, aluminum sash windows, tripartite window, asbestos shingle exterior wall material. NC (Roll #3-5)
275. 772 78th Place South, ca. 1960, Ranch. One-story frame dwelling on full basement, poured concrete foundation, low-pitched cross-hip roof, interior chimney, four-bay facade, single-leaf entrance, tripartite window, paired sash windows, small hip-roof entrance porch supported by decorative ironwork posts, side hip-roof porch, asbestos shingle wall material. C (Roll #3-4)

78th Street South

276. 601 78th Street South, ca. 1930, Bungalow. One-story frame dwelling, primary side-gable roof with gable of rear ell resting on main ridgeline, three-bay facade, central single-leaf entrance, single and paired sash windows, gable roof entrance porch supported by massive stucco piers, aluminum siding exterior wall material. C (Roll #25-8)
277. 609 78th Street South, ca. 1930, Bungalow. One-story frame dwelling, primary side-gable roof with gable resting on main roofline, exterior side-chimney, three-bay facade, single and paired sash windows, central single-leaf entrance, gable-roof (screened-in) porch supported by decorative ironwork posts resting on stucco piers and balustrade. C (Roll #25-9)
278. 710 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, weatherboard exterior wall material, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tapered posts on tall end brick piers connected by open brickwork balustrade. C (Roll #22-11)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 26

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
279. 718 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, front-facing chimney, five-bay facade, 4/1 sash windows, single-leaf entrance, side-porch supported by tall brick piers, aluminum siding exterior wall material. C (Roll #22-10)
280. 740 78th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, exterior-side chimney, front-facing gable wing, partial-width shed roof porch supported by decorative ironwork supports, single and tripartite window, single-leaf entrance. C (Roll #1-19)
281. 742 78th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, brick and concrete foundation, cross-gable roof, exterior-side chimney, three bay facade, single-leaf entrance, single and paired double-hung-sash aluminum windows, small gable-roof porch attached to aluminum flat-roof porch, decorative ironwork supports. C (Roll #1-1)
282. 750 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof, former full-width porch now enclosed, three-bay facade, central single-leaf entrance, weatherboard exterior wall material, exposed rafter ends and decorative brackets. C (Roll #1-2)
283. 753 78th Street South, ca. 1920, Pyramidal. One-story frame dwelling, continuous brick pier foundation, steeply-pitched hipped roof with cross-gable wings, front-facing gable roof wing, interior chimneys, three-bay facade, former partial-width shed roof porch (enclosed), single-leaf entrance, 1/1 double-hung-sash windows. C (Roll #1-18)
284. 754 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, spraddle roof, exterior side chimney, central gable-roof dormer with three lights, full-width porch supported by tall brick piers (glassed-in), three-bay facade, central single-leaf entrance, paired windows, weatherboard exterior wall material. C (Roll #1-3)
285. 758 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, cross gable roof, small decorative gable at roofline, exterior-side chimney, partial-width gable roof porch supported by tall end brick piers and low-lying balustrade (glassed-in), three-bay facade, central single-leaf entrance. C (Roll #1-4)
286. 759 78th Street South, ca. 1955, Modern. One-story frame dwelling on full basement with garage door opening, cross-hipped roof with front-facing hipped roof wing, three-bay facade, single-leaf entrance, partial width recessed porch supported by decorative ironwork supports, asbestos shingle exterior wall material. NC (Roll #1-17)
287. 763 78th Street South, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, cross low-pitched hipped roof, four-bay facade, central single-leaf entrance, single, paired and triple windows, small hipped-roof porch supported by decorative ironwork support. NC (Roll #1-16)
288. 767 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, three-bay facade, single-leaf entrance, paired 4/1 double-hung-sash windows, gable-roof porch supported by squat tapered posts on tall brick piers connected by low lying brick balustrade (porch glassed-in). C (Roll #1-15)
289. 768 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, cross-gable roof, interior chimney, three-bay facade, central single-leaf entrance, paired 1/1 double-hung-sash windows, three-quarter width gable-roof porch supported by squat paneled piers on fieldstone bases and fieldstone balustrades. C (Roll #1-5)
290. 771 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous stucco foundation, side-gable roof, three-bay facade, central single-leaf entrance, single and paired 4/1 double-hung-sash windows, gable roof porch supported by tapered posts on brick piers. C (Roll #1-14)
291. 774 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof, interior chimney, full-width recessed porch supported by tall decorative ironwork supports, three-bay facade, central single-leaf entrance, single 4/1 sash windows, later rear side wing. C (Roll #1-6)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 27

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
292. 775 78th Street South, ca. 1955, Ranch. One-story frame dwelling, concrete block foundation, low-pitched hipped roof, four-bay facade, central single-leaf entrance, single and triple windows, small hipped roof entrance porch supported by simple posts, side carport. NC (Roll #1-13)
293. 778 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side gable roof, interior chimney, central gable-roof porch supported by tall end brick piers (glassed-in), three-bay facade, central single-leaf entrance, paired 4/1 double-hung-sash windows. C (Roll #1-7)
294. 779 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, three-bay facade, central single-leaf entrance, paired 4/1 double-hung-sash windows, gable roof porch supported by tall brick piers, low lying brick balustrades, exterior side chimney. C (Roll #1-12)
295. 780 78th Street South, ca. 1925, Bungalow. One-story frame dwelling resting on basement, continuous brick foundation, interior chimney, four bay facade, single-leaf entrance, paired 4/1 double-hung-sash windows, gable-roof porch supported by tall end brick piers. C (Roll #1-8)
296. 783 78th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior end chimney, three-bay facade, single-leaf entrance, single and paired double-hung-sash windows, partial-width shed roof porch supported by simple wooden posts. C (Roll #1-11)
297. 784 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, exterior-side chimney, side gable roof, gable-roof porch supported by tall end brick piers (glassed-in), three-bay facade, central single-leaf entrance. C (Roll #1-9)
298. 785 78th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick, concrete and faux stone foundation, front-facing gable roof, three-bay facade, single-leaf entrance, 4/1 double-hung-sash windows, small gable-roof entrance porch supported by tall decorative ironwork supports. C (Roll #1-10)

79th Place South

299. 751 79th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, gable-roof porch with two windows supported by decorative ironwork posts, simple weatherboard exterior wall material, exposed rafter ends, decorative brackets. C (Roll #3-20)
300. 752 79th Place South, ca. 1925, Bungalow. One-story frame dwelling, fieldstone foundation, primary side-gable roof with three-quarter width gable roof porch supported by squat tapered posts on tall end fieldstone piers, exterior side chimney, three-bay facade, single leaf entrance, paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #3-10)
301. 754 79th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior and exterior side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by flattened arch, aluminum siding exterior wall material. C (Roll #3-11)
302. 757 79th Place South, ca. 1960, Modern. One-story frame dwelling, concrete foundation, gable on hip roof, three-bay facade, single sash and triple window, central single-leaf entrance, small gable-roof entrance porch supported by decorative ironwork posts, partial brick veneer facade, aluminum siding exterior wall material. NC (Roll #3-19)
303. 758 79th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear wing resting in center of primary side gable roof, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by decorative ironwork posts, exposed rafter ends and decorative brackets. C (Roll #3-12)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 28

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

304. 761 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, side-gable roof with dominant front-facing decorative gable, interior chimney, five-bay facade, central single leaf entrance, wooden and aluminum sash windows, tripartite multi-pane sash window, small gable roof porch beneath decorative gable, partial brick veneer facade, aluminum siding exterior wall material. C (Roll #3-18)
305. 765 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired sash windows, small gable roof porch supported by decorative metal posts. C (Roll #3-17)
306. 769 79th Place South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable, exterior end chimney, three-bay facade, single-leaf entrance, single and paired sash windows, partial-width shed roof porch supported by wooden post, wooden balustrades, aluminum siding exterior wall material. C (Roll #3-16)
307. 770 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, interior chimney, four-bay facade, single leaf entrance to far right, sash windows, wooden shingle wall material. C (Roll #2-10)
308. 772 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior-end chimney, three-bay facade, single-leaf entrance, single and paired sash windows, partial-width shed roof porch supported by decorative metal post, aluminum siding exterior wall material. C (Roll #2-9)
309. 773 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with dominant front-facing gable wing, three-bay facade, former recessed porch enclosed, asbestos shingle exterior wall material, exterior side chimney. C (Roll #3-15)
310. 776 79th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with decorative front-facing gable, three-bay facade, single leaf entrance, single and paired sash windows, small gable roof porch supported by decorative metal posts, side screened-in porch, wooden shingle exterior wall material. C (Roll #2-8)
311. 777 79th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, sash windows, single-leaf entrance, small gable roof overhang supported by decorative ironwork posts. C (Roll #3-14)
312. 781 79th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, poured concrete foundation, cross-gable roof, interior chimney, front-facing decorative gable, five-bay facade, central single-leaf entrance, aluminum casement windows, tripartite window, small gable roof entrance porch supported by decorative metal posts. C (Roll #3-13)

79th Street South

313. 510 79th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, full basement, side-gable roof, three-bay facade, single and paired 3/1 sash windows, gable roof porch supported by tapered posts on low brick balustrade, exterior side chimney. C (Roll #25-22)
314. 514 79th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, primary side-gable roof with two front-facing gables, three-bay facade, pairs of 4/1 sash windows, single leaf entrance, gable roof porch supported by tall end brick piers, low lying brick balustrade, decorative brackets along roofline. C (Roll #25-21)
315. 520 79th Street South, ca. 1960, Ranch. One-story frame dwelling, concrete and concrete block foundation, low-pitched cross-hip roof with wide overhanging eaves, picture and sash windows, four bay facade, single leaf entrance, small recessed porch with single wooden post support. NC (Roll #25-20)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 29

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

316. 602 79th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, side-gable roof with decorative elongated gable-roof dormer resting on main roofline, exterior-end chimney, three-bay facade, central single-leaf entrance, single and paired sash windows, full-width gable roof porch with central arched opening, decorative fan vent in arched opening, porch supported by four paneled posts on brick piers connected by open brickwork balustrade. C (Roll #25-2)
317. 608 79th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, side-gable roof with gable-roof dormer resting on main roofline, exterior end chimney, three-bay facade, central single-leaf entrance, single and paired sash windows, full-width gable roof porch supported by metal posts on low brick piers, low open brickwork balustrade, porch has central gable roof arched entrance. C (Roll #25-3)
318. 616 79th Street South, ca. 1960, Ranch. One-story brick veneer dwelling, concrete slab foundation, hipped roof, seven-bay facade, single-leaf entrance, aluminum sash windows. NC (Roll #24-10)
319. 715 79th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with central decorative wall gable, five-bay facade, 6/1 single and paired sash windows, partial-width recessed porch to left of gable, aluminum siding exterior wall material. C (Roll #22-18)

80th Street South

320. 501 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired sash windows, single-leaf entrance, partial-width gable roof porch supported by tapered paneled posts on brick piers, low brick balustrade. C (#20-12)
321. 507 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, paired 1/1 sash windows, single-leaf entrance, centrally placed gable-roof porch supported by tall brick piers connected by low brick balustrade, decorative brackets, aluminum siding exterior wall material. C (Roll #20-13)
322. 513 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, 8/8 sash windows, full-width recessed porch supported by tall brick piers, aluminum siding exterior wall material. C (Roll #20-14)
323. 515 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof entrance porch supported by tall end brick piers, side shed-roof porch (later). C (Roll #20-14)
324. 518 80th Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof with front-facing gable roof porch, front-addition to right of porch, three-bay facade, side-shed roof carport addition, aluminum siding. NC (Roll #26-3)
325. 521 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side clipped-gable roof, central interior chimney, three-bay facade, single-leaf entrance, first bay slightly changed by creating a single-leaf entrance in the left side of an original paired 4/1 sash window, gable-roof entrance porch supported by squat tapered posts on tall end brick piers connected by low-lying brick balustrade. C (Roll #20-16)
326. 525 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side clipped-gable roof, central interior chimney, two-bay facade, single-leaf entrance with sidelights, paired 4/1 sash window, gable roof porch supported by decorative-patterned two-tone brick. C (Roll #20-17)
327. 529 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation with stucco, cross-gable roof with front-facing gable wing and gable-roof entrance porch supported by two square posts, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows, former wraparound porch to left is partially enclosed. C (Roll #20-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 30

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

328. 530 80th Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, three-bay facade, central single-leaf entrance, paired sash windows, small entrance-width gable-roof porch supported by two simple wooden posts. C (Roll #26-2)
329. 601 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable roof porch supported by tapered posts on brick piers, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired sash windows. C (Roll #20-19)
330. 605 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, stucco foundation, front-facing gable roof with front-facing gable roof porch supported by tapered piers on stucco posts connected by low stucco balustrade, three-bay facade, single and paired sash windows, single-leaf entrance, aluminum siding exterior wall material, side shed-roof porch (later). C (Roll #20-20)
331. 607 80th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable wing, three-bay facade, single-leaf entrance, single sash and one picture window, partial-width shed roof porch, exterior-side chimney. C (Roll #20-21)
332. 619 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, central interior chimney, three-bay facade, single-leaf entrance, paired sash windows, gable-roof porch supported by tall brick piers. C (Roll #20-22)
333. 623 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, central interior chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof entrance porch supported by tall end brick piers. C (Roll #20-23)
334. 701 80th Street South, ca. 1925, Bungalow. This house was originally designed to face 7th Avenue but today, faces 80th Street. Original address was 8003 7th Avenue South. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, gable-roof entrance porch supported by tapered posts on low brick piers, former front porch enclosed, weatherboard exterior wall material. C (Roll #20-24)
335. 705 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, clipped side-gable roof porch, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by slender wooden posts on tall brick piers. C (Roll #21-3)
336. 709 80th Street South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, low-pitched hipped roof, asbestos shingle exterior wall material, three-bay facade, aluminum vertical-sash windows, single-leaf entrance off partial-width recessed porch. C (Roll #21-4)
337. 727 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof with two gable roof dormers flanking a central partial-width gable roof porch supported by tall end brick piers, central interior chimney, five-bay facade, central single-leaf entrance, paired and triple sash windows. C (Roll #21-5)
338. 731 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior side chimney, weatherboard exterior wall material, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #21-6)
339. 730 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, weatherboard exterior wall material, central interior chimney, three-bay facade, sash windows, central single-leaf entrance flanked by 4/1 sash windows, gable roof porch supported by decorative metal posts. C (Roll #21-9)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 31

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
340. 732 80th Street South, ca. 1925, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, five-bay facade, single-leaf entrance, sash and picture windows, small gable roof porch supported by decorative metal posts. C (Roll #21-8)
 341. 736 80th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing gable, interior chimney, five-bay facade, central single-leaf entrance, small gable-roof porch supported by turned posts, sash and picture windows, asbestos shingle exterior wall material. C (Roll #21-7)
 342. 750 80th Street South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof with two front-facing wings separated by shed roof porch, central front-facing chimney, four-bay facade, single-leaf entrance to right of chimney, multi-pane casement windows, asbestos shingle exterior wall material. C (Roll #3-21)
 343. 755 80th Street South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, front-facing gable roof porch (enclosed) supported by tall end brick piers and low brick balustrade, weatherboard and aluminum siding exterior wall material. C (Roll #3-22)
 344. 758 80th Street South, ca. 1925, Tudor Revival. One-story frame dwelling on basement, brick veneer and stucco exterior wall material, primary side-gable roof with two front-facing gable ends, central front-facing chimney, four-bay facade, single and paired 6/1 sash windows, screened-in entrance porch located in right projecting gable wing, faux half-timber application in gable ends, louvered vents in gables. C (Roll #3-24)
 345. 759 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, interior chimney, five bay facade, central single-leaf entrance, paired 6/1 sash windows, central gable-roof porch supported by triple slender posts resting on brick piers, brick balustrades and empty brick piers. C (Roll #3-23)
 346. 760 80th Street South, ca. 1970, Modern. One-story frame dwelling, resting on poured concrete, side-gable roof, four-bay facade, single-leaf entrance, aluminum sash windows, partial-width recessed porch supported by simple posts. NC (Roll #4-1)
 347. 766 80th Street South, ca. 1970, Modern. One-story frame dwelling resting on full basement, aluminum siding and brick veneer exterior wall material, side-gable roof, four-bay facade, single-leaf entrance, partial-width gable roof porch. NC (Roll #4-3)
 348. 768 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, interior chimney, two-bay facade, former gable roof porch enclosed, aluminum siding exterior wall material, house suffers loss of architectural integrity. NC (Roll #4-4)
 349. 769 80th Street South, ca. 1925, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material with stucco and faux half-timbering material in gables, continuous brick foundation, cross-gable roof with two front-facing gables, three-bay facade, single-leaf entrance, paired 6/6 sash windows, exterior side chimney. C (Roll #4-2)
 350. 773 80th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, side exterior chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by tall end brick piers connected by flattened arch and low brick balustrade, exposed rafter ends and decorative brackets. C (Roll #4-5)
 351. 777 80th Street South, ca. 1940, L-cottage. One-story frame dwelling, front-facing gable roof, interior chimney, single-leaf entrance, small gable roof porch, rear side wing. C (Roll #4-6)
 352. 780 80th Street South, ca. 1930, Bungalow. One-story frame dwelling, weatherboard and brick veneer exterior wall material, front-facing gable roof with exposed rafter ends and decorative brackets, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, partial width gable roof porch supported by tall brick piers connected by low brick balustrade, side porch. C (Roll #4-7)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 32

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

353. 781 80th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete foundation, side gable roof, four-bay facade, single-leaf entrance, single and paired 6/6 sash windows, small gable roof supported by tall metal posts. C (Roll #4-8)
354. 782 80th Street South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, steeply pitched cross-gable roof, front-facing chimney, front-facing gable extending out over porch supported by tall brick piers, three-bay facade, single leaf entrance set behind arched entrance, bay window in first bay position, French doors in third bay position. C (Roll #4-9)
355. 783 80th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof with front facing decorative gable, concrete foundation, five-bay facade, single-leaf entrance, paired aluminum sash window, small gable roof porch supported by slender posts. C (Roll #4-10)
356. 784 80th Street South, ca. 1925, Tudor Revival. One-story frame dwelling, steeply-pitched cross-gable roof, front-facing gable wing with centrally placed front-facing chimney flanked by small single square windows, single-leaf entrance set in projecting gable entrance, paired sash windows, small arched garden opening to left. C (Roll #4-11)

80th Place South

357. 500 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, front-facing gable-roof porch supported by tapered posts on tall brick piers, decorative metal work supports, single-leaf entrance, single and paired sash windows. C (Roll #20-10)
358. 504 80th Place South, c. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, single and paired sash windows, three-quarter width gable-roof porch supported by tall end brick piers, weatherboard exterior wall material. C (Roll #20-9)
359. 508 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-end chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, three-quarter width gable-roof porch supported by tapered posts on brick piers, aluminum siding exterior wall material. C (Roll #20-8)
360. 511 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with exterior-end chimney, three-bay facade, single-leaf entrance, paired sash windows, gable-roof porch supported by tall end brick piers connected by open brickwork balustrade. C (Roll #18-17)
361. 512 80th Place South, c1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, front-facing gable roof supported by tapered posts on low brick piers (enclosed), two-bay facade of multi-pane aluminum windows, single-leaf entrance to side of former porch, aluminum-siding exterior wall material, integrity compromised by alterations. NC (Roll #20-7)
362. 515 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, complex roofline with multiple cross-gables, three-bay facade, single-leaf entrance, single and paired sash windows, full-width porch with gable and shed portions supported by open woodwork supports resting on low brick piers, weatherboard exterior wall material. C (Roll #18-18)
363. 516 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation with stucco, cross-gable roof with dominant front-facing gable, exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by small round colonettes on tall brick piers, small addition to facade at left. C (Roll #20-6)
364. 519 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof with exterior-side chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers and connected by open brickwork balustrade. C (Roll #18-19)
365. 520 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary clipped side-gable roof with two front-facing gables, weatherboard and aluminum siding exterior wall material, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by tall brick piers. C (Roll #20-5)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 33

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

366. 523 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, dominant front-facing gable roof with subordinate rear cross-gables, former gable-roof porch enclosed, entrance now to side of former porch, aluminum replacement windows, house suffers from loss of integrity. NC (Roll #18-20)
367. 527 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with gable of rear ell resting on roofline of primary side-gable roof, exterior-end chimney, full-width porch with arched roofline at center flanked by flat-roof sections, porch supported by paired of classical colonettes, three-bay facade, central single-leaf entrance, paired 4/1 sash windows. C (Roll #18-21)
368. 528 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, 1/1 sash windows, aluminum siding exterior wall material, modern shed roof carport. C (Roll #20-4)
369. 600 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, continuous brick foundation, exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by decorative metal supports. C (Roll #20-3)
370. 601 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-side chimney, paired 4/1 sash windows, single-leaf entrance, gable-roof porch supported by tall end brick piers connected by highly decorative brick balustrade, decorative brackets. C (Roll #18-22)
371. 604 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-end chimney, partial-width gable roof porch supported by tall brick piers connected by low brick balustrade, 4/1 sash windows, single-leaf entrance, weatherboard and stucco exterior wall material. C (Roll #20-2)
372. 605 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof with exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by tall end brick piers and connected by low lying brick balustrade. C (Roll #18-23)
373. 609 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, exterior end chimney, three-bay facade, paired 4/1 sash windows, central single-leaf entrance, gable-roof porch supported by tall end brick piers and connected by low brick balustrade. C (Roll #18-24)
374. 610 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, primary side-gable roof with exterior-side chimney, rubblestone foundation and chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, three-quarter width gable-roof porch supported by tapered posts on rubblestone piers and balustrade. C (Roll #20-1)
375. 611 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, exterior side chimney, three-bay facade, single-leaf entrance with sidelights, single and paired 4/1 sash windows, near full-width gable roof porch supported by tall end brick piers, aluminum siding exterior wall material. C (Roll #19-1)
376. 614 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, primary side-gable roof, exterior side-chimney, continuous brick foundation, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers, side-gable roof porch supported by classical colonettes, aluminum siding exterior wall material. C (Roll #19-24)
377. 615 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall brick piers and connected by low brick balustrade, weatherboard exterior wall material. C (Roll #19-2)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 34

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
378. 618 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous rubblestone foundation, cross-gable roof, exterior-side rubblestone chimney, three-bay façade, single-leaf entrance, paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #19-23)
379. 620 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior-side chimney, front-facing gable roof porch supported by tall end brick piers, 4/1 sash windows, single-leaf entrance, integrity of the house is compromised by a full two-story addition to the rear. NC (Roll #19-22)
380. 621 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, weatherboard exterior wall material, three-bay façade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by square posts on low brick piers. C (Roll #19-3)
381. 701 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, exterior-side and interior brick chimneys, three-bay façade, central single-leaf entrance, paired 1/1 sash windows (replacement), gable roof porch supported by slender wooden posts on low brick balustrade, metal awnings. C (Roll #19-4)
382. 702 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tapered posts on tall brick piers, weatherboard exterior wall material. C (Roll #19-21)
383. 705 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, weatherboard exterior wall material, two-bay façade, paired 1/1 sash windows, near full-width gable roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #19-5)
384. 706 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side brick chimney, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers, weatherboard wall material. C (Roll #19-20)
385. 709 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, exterior-side chimney, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #19-6)
386. 712 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, central gable-roof porch supported by tall end brick piers, aluminum siding exterior wall material. C (Roll #19-19)
387. 713 80th Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, cross-gable roof with front-facing gable wing, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, partial-width shed-roof porch supported by tall stucco piers, stucco foundation material, aluminum siding exterior wall material. C (Roll #19-7)
388. 715 80th Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, stucco foundation material, cross-gable roof with primary side-gable and peak of rear ell resting on cross gable, near-full width gable-roof porch, three-bay façade, single-leaf entrance, single and paired sash windows (replacement). C (Roll #19-9)
389. 716 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, former gable-roof porch (enclosed), three-bay façade, 4/1 sash windows and 1/1 aluminum windows, aluminum siding exterior wall material. NC (Roll #19-18)
390. 717 80th Place South, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof with curvilinear parapet, three-bay façade, single-leaf entrance, paired sash windows, flat roof porch (glassed-in). C (Roll #19-8)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 35

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
391. 720 80th Place South, ca. 1910, Pyramidal. One-story frame dwelling, continuous brick foundation, hipped-with-cross gable roof, front-facing gable wing, three-bay façade, single-leaf entrance, 1/1 sash windows, partial-width hipped roof porch supported by decorative metal posts, aluminum siding exterior wall material. C (Roll #19-17)
392. 724 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, full-width recessed porch supported by square posts, three-bay façade, single-leaf entrance, 4/1 sash windows, weatherboard exterior wall material, brackets. C (Roll #19-16)
393. 727 80th Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, stucco foundation, cross-gable roof, three-bay façade, single and paired 4/1 sash windows, single-leaf entrance (French door), gable roof porch supported by tall stucco piers and stucco balustrade, weatherboard exterior wall material. C (Roll #19-10)
394. 729 80th Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, brick foundation, side-gable roof, weatherboard exterior wall material, three-bay façade, single-leaf entrance, single and paired sash windows, gable-roof porch supported tall brick piers. C (Roll #19-11)
395. 730 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable, central interior chimney, three-bay façade, 4/1 sash windows, single-leaf entrance, near full-width gable roof porch with stucco balustrade. C (Roll #19-15)
396. 731 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior-side chimney, three-bay façade, single-leaf entrance, single and paired 4/1 sash windows, three-quarter width gable-roof porch supported by tall end brick piers. C (Roll #19-12)
397. 737 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous stucco foundation, front-facing gable roof, two-bay façade, former gable roof porch (enclosed), remnant of tall stucco piers, aluminum siding exterior wall material. House retains enough integrity to be considered contributing. C (Roll #19-13)
398. 741 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, three-bay façade, single and paired 4/1 sash windows, central single-leaf entrance, partial-width gable roof porch supported by paired wooden posts on low brick piers, aluminum siding exterior wall material. C (Roll #19-14)
399. 752 80th Place South, ca. 1960, Modern. One-story frame dwelling, cross-gable roof with projecting front facing gable incorporating single window and small recessed porch supported by slender post, four-bay facade, single-leaf entrance, single and paired sash windows, aluminum siding and brick veneer exterior wall material. NC (Roll #4-16)
400. 753 80th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, front-facing spraddle roof with front-facing chimney and front-facing gable wing, three-bay facade, single and paired sash windows, concrete foundation, small side porch supported by single wooden post, aluminum siding exterior wall material. C (Roll #4-17)
401. 756 80th Place South, ca. 1965, Modern. One-story frame dwelling on full concrete block foundation, shallow hipped roof, large front-facing faux stone chimney, three-bay facade, large aluminum casement windows, side double-tiered porch supported by slender wooden posts, single leaf entrance reached by long expanse of concrete stairs. NC (Roll #4-15)
402. 757 80th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, front-facing spraddle roof, interior chimney, front-facing gable roof porch supported by simple wooden posts, four-bay facade, single-leaf entrance off porch and secondary entrance located in fourth bay position, rear side wing. C (Roll #4-18)
403. 761 80th Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, rubblestone foundation, side gable roof, original three-bay facade altered to create four-bay facade with the insertion of secondary single-leaf entrance, single and paired 4/1 sash windows, exterior side rubblestone fireplace, gable-roof porch supported by tapered wooden posts on low rubblestone piers connected by low rubblestone balustrade. C (Roll #4-19)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 36

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

404. 765 80th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete foundation, cross-gable roof, interior chimney, front-facing gable wing, three-bay facade, single and paired 6/6 sash windows, partial-width shed roof porch supported by pairs of slender colonettes. C (Roll #4-20)
405. 766 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, concrete and rubble-stone foundation, front-facing gable roof, former full-width recessed porch (partially enclosed) supported by tall end brick piers, aluminum and original sash windows, single-leaf entrance, small gable roof projection at entrance of porch. C (Roll #4-14)
406. 768 80th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick and concrete block foundation, clipped side-gable roof, exterior end chimney, three-bay facade, single-leaf entrance, paired and triple window, gable-roof porch supported by tall wooden posts, exposed rafter ends and decorative brackets. C (Roll #4-13)
407. 769 80th Place South, ca. 1925, Tudor Revival. One-story frame dwelling on full basement, brick veneer exterior wall material, cross-gable roof with two front-facing gables, four-bay facade, former open porch (enclosed), single-leaf entrance in gable wing, aluminum siding in gables. C (Roll #4-21)
408. 773 80th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with exterior end chimney, front-facing hip roof wing, two-bay facade, paired aluminum windows, small recessed porch supported by simple wooden post. C (Roll #4-22)
409. 776 80th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, projecting gable wing with aluminum tripartite window and small recessed porch supported by decorative ironwork post, three-bay facade, single-leaf entrance. C (Roll #4-12)
410. 777 80th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with exterior end chimney, front-facing hip roof wing, two-bay facade, paired aluminum windows, small recessed porch supported by simple wooden post. C (Roll #4-23)

81st Place South

411. 615 81st Place South, ca. 1940, Bungalow. One-story frame dwelling, concrete block foundation, side-gable roof, five-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by slender posts connected by wooden balustrade, asbestos shingle exterior wall material, may be earlier with later sympathetic modifications, house appears abandoned. C (Roll #16-3)
412. 617 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, complex roofline with cross-gables, interior and exterior end chimney, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by squat tapered posts on tall brick piers, weatherboard exterior wall material. C (Roll #16-4)
413. 700 81st Place South, ca. 1955, Modern. One-story frame dwelling, cross-hip roof with projecting hipped-roof wing incorporating recessed porch supported by decorative metal post, four-bay facade, aluminum sash windows, single-leaf entrance, asbestos shingle exterior wall material. NC (Roll #16-19)
414. 701 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, continuous concrete block foundation, exterior-end chimney, three-bay facade, single-leaf entrance, aluminum sash windows, tripartite window with plate glass center section flanked by 4/4 sash windows, three-quarter width recessed porch supported by pairs of square posts with lattice infill. C (Roll #16-5)
415. 708 81st Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof, exterior-end chimney, three-bay facade, paired 4/1 sash windows, central single-leaf entrance, gable-roof entrance porch supported by square posts, aluminum siding exterior wall material. C (Roll #16-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 37

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
416. 709 81st Place South, ca. 1920, Pyramidal. One-story frame dwelling, brick pier foundation, steeply pitched hipped roof, interior chimney, central hipped roof dormer with paired 6/6 sash windows, three-bay facade, 1/1 sash windows, central multi-pane door set in full transom and sidelights, near full-width half-hipped roof supported by four square columns. C (Roll #16-6)
417. 711 81st Place South, ca. 1920, Pyramidal. One-and-a-half story frame dwelling, brick pier foundation, complex roofline with multiple cross-gables, interior chimney, front-facing gable wing, interior chimney, three-bay facade, 1/1 sash window and single-pane window with transom, central single-leaf entrance with full transom and sidelights, full-width half-hipped roof porch supported by four wooden square columns, aluminum siding exterior wall material. C (Roll #16-7)
418. 713 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with exterior-side chimney, three-bay facade, single-leaf entrance, paired sash windows, central gable-roof porch supported by tall end brick piers, aluminum siding exterior wall material, decorative brackets. C (Roll #16-8)
419. 715 81st Place South, ca. 1940, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows, central gable-roof porch supported by tall massive paneled brick piers, decorative brackets. C (Roll #16-9)
420. 716 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-end chimney, four-bay facade, single-leaf entrance, 4/1 sash windows, gable roof porch supported by tall end brick piers. Although house retains original form and some decorative detailing, house has been covered with brick veneer. NC (Roll #16-17)
421. 717 81st Place South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, gable-on-hip roof, five-bay facade, single-leaf entrance, aluminum sash windows, small gable-roof porch supported by decorative metal posts, wood shingle exterior wall material. C (Roll #16-10)
422. 719 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, interior and exterior-side chimneys, double front-facing gable roof, three-bay facade, single-leaf entrance, former porch enclosed and now contains bands of aluminum casement windows, aluminum siding exterior wall material, house has been altered and suffers from a loss of integrity. C (Roll #16-11)
423. 720 81st Place South, ca. 1930, Bungalow. One-story frame dwelling, brick veneer exterior wall material, central interior chimney, gable roof porch supported by tall end brick piers, four-bay facade, single-leaf entrance, single and paired sash windows, aluminum siding exterior wall material. C (Roll #16-16)
424. 724 81st Place South, ca. 1960, Ranch. One-story frame dwelling on full basement with garage opening at one end, brick veneer exterior wall material, side-gable roof, four-bay facade, aluminum sash windows and aluminum multi-pane window, slightly recessed single-leaf entrance. NC (Roll #16-15)
425. 728 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, front-facing gable roof, weatherboard exterior wall material, three-bay facade, single-leaf entrance, gable-roof porch supported by decorative metal posts, sash windows. C (Roll #16-14)
426. 733 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, rusticated stone foundation, low-pitched hipped roof with central interior chimney, low-pitched hipped roof wing, four-bay facade, single-leaf entrance, single and paired vertical sash windows, small gable-roof overhang, wood shingle exterior wall material. C (Roll #12-2)
427. 736 81st Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, rubblestone foundation, primary side-gable roof with central interior chimney, original three-bay facade with subordinate side-gable wing containing single multi-pane window, single-leaf entrance, sash windows, gable roof porch across original section supported by tapered posts on low brick piers, weatherboard exterior wall material. C (Roll #16-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 38

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
428. 737 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable, interior chimney, small partial-width recessed porch, three-bay facade, single and triple sash windows, single-leaf entrance, wooden shingle exterior wall material. C (Roll #5-17)
429. 739 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hipped roof, central interior chimney, three-bay facade, single and triple sash windows, single-leaf entrance off small partial-width recessed porch. C (Roll #5-18)
430. 740 81st Place South, ca. 1925, L-cottage. One-story frame dwelling, continuous brick foundation, front-facing gable with rear side ell, interior chimney, side shed-roof porch off front gable, porch supported by decorative metal posts, aluminum siding and replacement aluminum windows. House retains original form. C (Roll #16-12)
431. 745 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof with rear ell, exterior side chimney, three-bay facade, former porch enclosed, sash and stationary plate glass windows. House remodeled to the point of being unable to discern original form or style. NC (Roll #5-19)
432. 747 81st Place South, ca. 1925, Spanish Revival. Identical to 769 81st Place South. One-story frame dwelling, stucco exterior wall material, roofline hidden behind low-lying tiled parapet, exterior side chimney, five-bay facade with additional bay consisting of garage opening, sash windows, partial-width shed roof porch with three arched openings, tile roofing material, single-leaf entrance. C (Roll #5-20)
433. 748 81st Place South, ca. 1980, Modern. One-story frame dwelling on concrete block foundation, basement garage opening facing street on right, low-pitched cross-hip roof, wood siding and brick veneer exterior wall material, three-bay facade, single leaf entrance on side of partial width porch supported by decorative metal post. NC (Roll #5-15)
434. 749 81st Place South, ca. 1925, Spanish Revival. Identical to 767 81st Place South. One-story frame dwelling, stucco exterior wall material, roofline hidden behind low-lying tiled parapet, exterior side chimney, five-bay facade with additional bay consisting of garage opening, sash windows, partial-width shed roof porch with three arched openings, asphalt roof material, single-leaf entrance. C (Roll #5-21)
435. 757 81st Place South, ca. 1955, Modern. One-story frame dwelling, concrete foundation, low-pitched cross-hip roof, wood siding and brick veneer exterior wall material, three-bay facade, sash and tripart windows, small recessed porch, side entrance. NC (Roll #5-22)
436. 766 81st Place South, ca. 1930, Bungalow. One-story frame dwelling on full basement, side-gable roof, central interior chimney, five bay facade, single and paired 4/1 sash windows, centrally placed single-leaf entrance, gable-roof porch supported by tall end brick piers, low brick balustrade, decorative brackets and paneling. C (Roll #5-16)
437. 768 81st Place South, ca. 1940, Colonial Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, exterior end chimney, dominant side-gable roof with rear wing, 2/3 bay facade with side sunroom, two gable-roof dormers, central single-leaf entrance set in decorative surround, aluminum casement windows. C (Roll #5-14)
438. 771 81st Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, aluminum siding exterior wall material, single-leaf entrance, paired sash windows, former side porch enclosed. C (Roll #5-23)
439. 775 81st Place South, ca 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, single and paired sash windows, full-width front-facing gable roof porch supported by square end posts, low wooden balustrades. C (Roll #5-24)
440. 780 81st Place South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, two interior chimneys, front-facing gable roof, former gable-roof porch now enclosed, three-bay facade, single-leaf entrance with aluminum louvered windows, central single-leaf entrance. C (Roll #5-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 39

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

441. 781 81st Place South, ca. 1920, L-cottage. One-story frame dwelling, brick pier foundation with concrete block infill, front-facing gable roof with subordinate rear wing, single bay with single-leaf entrance on side, small flat roof porch supported by wooden posts. C (Roll #5-25)
442. 784 81st Place South, ca. 1940, Bungalow. One-story frame dwelling, cross-gable roof, continuous brick foundation, side-gable extending out into porch supported by tapered posts on low brick piers, front-facing gable roof porch supported by tapered posts on low brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows, exterior chimney on side porch rising up through gable, aluminum siding exterior wall material. C (Roll #5-12)
443. 785 81st Place South, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, exterior side chimney, front-facing gable porch supported by squat tapered posts on tall stuccoed piers connected by flattened arch and low stucco balustrade, weatherboard exterior wall material, three-bay facade, single-leaf entrance, paired sash windows. C (Roll #5-26)

81st Street South

444. 508 81st Street South, ca. 1925. One-story frame dwelling, continuous brick foundation, side-gable roof, front-facing chimney, four-bay facade, paired sash windows, single leaf entrance flanked by multi-pane sash windows, small gable roof porch supported by decorative metal posts, side shed addition. C (Roll #18-10)
445. 510 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous rubblestone facade, side-gable roof, exterior side chimney, three-bay facade, single-leaf entrance, paired sash windows, gable-roof porch supported by tall rubblestone piers. C (Roll #18-9)
446. 512 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, double-front facing gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired sash windows, gable roof porch supported by tall end brick piers, side porte cochere supported by two tall brick piers. C (Roll #18-8)
447. 514 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, primary front-facing gable with subordinate rear gable, interior chimney, three-bay facade, single-leaf entrance, gable-roof porch supported by three slender posts, 4/1 sash windows, aluminum siding exterior wall material. C (Roll #18-7)
448. 521 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, remnants of rubblestone side chimney, front-facing gable roof, small recessed porch supported by paired posts on low rubblestone piers, single-bay facade. House partially destroyed by fire and abandoned. NC (Roll #17-7)
449. 525 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, brick veneer exterior wall material, side-gable roof, central interior chimney, five-bay facade, central single-leaf entrance, single and paired 6/6 sash windows, central gable-roof porch supported by tall end brick piers and connected by low brick balustrade, weatherboard exterior wall material and decorative brackets. C (Roll #17-6)
450. 526 81st Street South, ca. 1950, No Style. Two-story former garage for house no longer standing, brick and stucco, side-gable roof, former two garage door openings have been enclosed, one with vertical wood, the other is large multi-pane window, 3/3 bay facade, single-leaf entrance set in slightly projecting pediment. C (Roll #18-6)
451. 528 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, weatherboard exterior wall material, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade. C (Roll #18-5)
452. 531 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, brick veneer exterior wall material, side-gable roof, five-bay facade, central single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end brick piers, decorative brackets. C (Roll #17-5)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 40

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

453. 532 81st Street South, ca. 1960, Ranch. One-story frame dwelling, brick and concrete foundation, brick veneer exterior wall material, low-pitched cross hipped roof, three-bay facade, single-leaf entrance off carport, aluminum windows. NC (Roll #18-4)
454. 536 81st Street South, ca. 1960, Ranch. One-story frame dwelling, concrete foundation, low-lying pitched hip roof, brick veneer exterior wall material, carport, three-bay facade, single-leaf entrance off carport, aluminum windows. NC (Roll #18-3)
455. 540 81st Street South, ca. 1960, Ranch. One-story frame dwelling, concrete foundation, low-pitched hip roof, asbestos shingle exterior wall material, three-bay facade, carport, aluminum windows, side-entrance off carport. NC (Roll #18-2)
456. 701 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation and piers, destroyed by fire. NC (Roll #17-7)
457. 703 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, cross-gable roof, rubblestone foundation on front-facing gable roof porch, four-bay facade, single-leaf entrance, original 4/1 sash windows, some aluminum replacement windows, aluminum siding exterior wall material. C (Roll #17-8)
458. 705 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable-roof, full-width recessed porch supported by wooden posts (non-original), three-bay facade, single-leaf entrance, 4/1 sash windows. C (Roll #17-9)
459. 707 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-end chimney, three-bay facade central single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tapered posts on low brick piers connected by highly decorative brick balustrade, weatherboard exterior wall material. C (Roll #17-10)
460. 709 81st Street South, ca. 1930, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, four-bay facade, aluminum sash windows, central single-leaf entrance, gable-roof porch supported by two wooden posts. C (Roll #17-11)
461. 711 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, low-pitched hipped-roof with front-facing gable wing centrally placed in front, exterior-side chimney on gable wing, two bay facade, single-leaf entrance, 1/1 sash window, smaller gable-roof porch supported by slender wooden posts. C (Roll #17-12)
462. 712 81st Street South, ca. 1950, Bungalow. One-story frame dwelling, continuous concrete block foundation, double-front-facing gable roof with shed-roof over right facade, four-bay facade, single-leaf entrance, 6/6 sash and one large multi-pane window, gable roof porch. C (Roll #17-24)
463. 716 81st Street South, ca. 1950, Bungalow. One-story frame dwelling, continuous concrete block foundation, double-front facing gable roof with shed-roof over right facade, four-bay facade, single-leaf entrance, 6/6 sash and one large multi-pane window, gable roof porch. C (Roll #17-23)
464. 725 81st Street South, ca. 1930, Bungalow. One-story frame dwelling on high basement level, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by two tall end brick piers with brick balustrade. C (Roll #17-13)
465. 730 81st Street South, ca. 1930, Bungalow. One-story frame dwelling on low continuous brick foundation, cross-gable roof with gable of rear ell resting on ridge of primary side-gable roof, three-bay facade, central single-leaf entrance, 4/1 sash windows, central gable-roof porch supported by tall end brick piers, aluminum siding exterior wall material. C (Roll #17-22)
466. 731 81st Street South, ca. 1930, Bungalow. One-story frame dwelling on stuccoed foundation, side-gable roof with exterior-side chimney, four-bay facade, single and paired 4/1 sash windows, single-leaf entrance, partial-width gable roof porch supported by squat wooden posts on tall stuccoed piers connected by stuccoed balustrade, exposed rafter ends, decorative brackets and paneling. C (Roll #17-14)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 41

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
467. 732 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roofline, front-facing gable, three-bay facade, exterior-side chimney, single-leaf entrance, brick veneer exterior wall material applied to facade, alteration of windows from sash to plate glass, house significantly altered. NC (Roll #17-21)
468. 733 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, rubblestone foundation, gable of rear ell resting on primary side-gable roofline, former gable roof porch enclosed creating side entrance off new deck, aluminum window on former porch, original multi-pane-over-one sash windows still evident, aluminum siding exterior wall material. C (Roll #17-15)
469. 734 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-side chimney, three-bay facade, single and paired 6/1 sash windows, single-leaf entrance, three-quarter width gable-roof porch supported by tall end brick piers, decorative brackets. C (Roll #17-20)
470. 735 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, stuccoed foundation, primary side-gable roof, exterior-side chimney, three-bay facade, paired 4/1 sash windows, single-leaf entrance, small gable-roof porch supported by slender posts on tall stuccoed piers. C (Roll #17-16)
471. 736 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof with front-facing gable roof porch supported by decorative metal posts, four-bay facade, entrance bay is slightly recessed, 8/8 sash windows, central interior chimney, aluminum siding exterior wall material. C (Roll #17-19)
472. 737 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, original side-gable roof with gable of rear ell resting on primary roofline, original three-bay facade, single leaf entrance, original 4/1 windows still evident, side addition, porch supports altered. While attractive, this house has been significantly altered with a side addition. NC (Roll #17-17)
473. 739-741 81st Street South, ca. 1970, Modern Apartment Complex. Large two-storied brick veneer apartment building, brick veneer exterior wall material, aluminum windows, two-storied metal work balcony, primary side-gable roof. NC (Roll #17-18)
474. 745 81st Street South, ca. 1955, Modern. One-story frame dwelling, low-pitched cross-hip roof, concrete block foundation, asbestos shingle and brick veneer exterior wall material, five-bay facade, single-leaf entrance, sash windows. NC (Roll #5-29)
475. 749 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior side chimney, three-bay facade, paired 6/1 sash windows, single-leaf entrance, gable-roof porch supported by replacement posts, exposed rafter ends, side porch supported by classical colonettes. C (Roll #5-28)
476. 751 81st Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, central interior chimney, original five-bay facade with additional bay to left, central single-leaf entrance, 4/1 sash windows, small shed roof porch supported by metal posts. C (Roll #5-27)
477. 761 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation covered with stucco, side-gable roof, five-bay facade, central single-leaf entrance, 3/1 sash windows, gable roof porch supported by tall end piers, aluminum siding exterior wall material, central interior chimney. C (Roll #5-11)
478. 764 81st Street South, ca. 1970, Modern. Two-story apartment building, brick veneer facade, second floor set in steeply pitched "Mansard" style roof, 6/6 bay facade, large multi-pane aluminum windows. NC (Roll #4-24)
479. 765 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, rubblestone foundation, flared spraddle roof, exterior end rubblestone chimney, centrally placed gable roof dormer, three-bay facade, central single-leaf entrance, paired sash windows, full width shed roof porch supported by tapered posts on rubblestone piers, low rubblestone balustrades. C (Roll #5-10)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 42

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

480. 766 81st Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with rear gable, shed roof dormers containing band of slender windows, central interior chimney, five bay facade, central single-leaf entrance, single and paired 4/1 sash windows, central gable-roof porch supported by tall end brick piers, low brick balustrade, flattened arch, decorative brackets and dentil molding, exposed rafter ends. C (Roll #5-1)
481. 770 81st Street South, ca. 1930, Bungalow. Elements of this dwelling indicate that this may be a bungalow that has been totally altered. One-story frame, side gable roof with front-facing gable, partial porch, brick foundation, sash and picture windows, wooden particle board exterior wall material. House suffers from extreme loss of integrity. NC (Roll #5-2)
482. 771 81st Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable, three-bay facade, single-leaf entrance on side of partial width recessed porch, single and triple sash windows, wooden shingle exterior wall material. C (Roll #5-4)
483. 776 81st Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof, continuous brick foundation, two small gable-roof dormers flanking centrally-placed gable roof porch supported by four colonettes, five-bay facade, central single-leaf entrance, paired sash windows, aluminum siding exterior wall material. C (Roll #5-3)
484. 777 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, side-gable roof, rubblestone foundation, exterior-end rubblestone chimney, three-bay facade, single-leaf entrance, single and paired 3/1 sash windows, gable roof porch supported by tapered posts on rubblestone piers, wooden balustrade, decorative brackets, weatherboard exterior wall material. C (Roll #5-8)
485. 778 81st Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, primary side-gable roof with decorative front-facing gable, four-bay facade, single-leaf entrance, 3/1 sash windows, small gable roof porch supported by slender posts, interior chimney, asbestos shingle exterior wall material. C (Roll #5-4)
486. 781 81st Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, dominant front-facing gable roof supported by tapered posts on low brick piers, low brick balustrades, three-bay facade, single-leaf entrance, single and paired sash windows, exposed rafter ends and decorative brackets, weatherboard exterior wall material. C (Roll #5-7)
487. 783 81st Street South, ca. 1940, Colonial Revival. One-and-a-half story frame dwelling with brick veneer exterior wall material, steeply pitched gable roof with exterior side chimney, primary four-bay facade with sunroom set back on right side, single and paired 6/1 sash windows, central single-leaf entrance, small gable roof porch supported by metal posts. C (Roll #5-6)
488. 784 81st Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, 3/1 sash windows, small gable roof porch supported by slender wooden posts, interior chimney, aluminum siding exterior wall material. C (Roll #5-5)
489. 725 82nd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, interior chimney, four-bay facade, former carport has been enclosed, aluminum siding and aluminum sash window. NC (Roll #6-16)
490. 729 82nd Place South, ca. 1955, Modern. One-story frame dwelling, concrete foundation, low-pitched cross-hip roof, three-bay facade, single, paired and tripart sash windows, small recessed porch supported by metal posts, carport. NC (Roll #6-15)
491. 730 82nd Place South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, low-pitched hip roof with wide overhanging eaves, four-bay facade, single-leaf entrance, sash windows. NC (Roll #6-17)
492. 734 82nd Place South, ca. 1965, Modern. One-story frame dwelling on full basement with front-facing garage door opening, low-pitched hipped roof, five-bay facade, single, paired and tripart sash windows, single-leaf entrance, full flight of stairs across facade, wood siding and brick veneer exterior wall material. NC (Roll #6-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 43

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
493. 735 82nd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, brick and concrete foundation, side-gable roof, four-bay facade, single-leaf entrance, small side porch, sash windows. C (Roll #6-14)
494. 738 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, stucco foundation, side-gable roof, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by tall stuccoed piers, low stucco balustrade, exposed rafter ends and decorative brackets. C (Roll #6-19)
495. 739 82nd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, brick and concrete foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, sash windows, small gable porch supported by wooden posts. C (Roll #6-13)
496. 741 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by tall end brick piers, low brick balustrade, exposed rafter ends, decorative brackets. C (Roll #6-12)
497. 742 82nd Place South, ca. 1940, Colonial Revival. One-and-a-half story frame dwelling on continuous brick foundation, side-gable roof, exterior side chimney, two gable roof dormers, three-bay facade, single-leaf entrance with sidelights, paired 6/6 sash windows, aluminum siding exterior wall material. C (Roll #6-20)
498. 745 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, dominant front-facing gable with subordinate rear cross-gable roof, full width recessed porch supported by rubblestone piers, rubblestone foundation and exterior-side chimney, five-bay facade, central single-leaf entrance, single and paired 4/1 sash windows. C (Roll #6-11)
499. 746 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, primary side-gable roof with rear wing, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by metal posts, aluminum siding exterior wall material. C (Roll #6-21)
500. 750 82nd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete foundation, side-gable roof, former porch enclosed, five-bay facade, aluminum sash windows. NC (Roll #6-22)
501. 751 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, clipped-gable roof, two interior chimneys, partial width recessed porch supported by single square post, two bay facade, paired 4/1 sash windows, single-leaf side-entrance off porch. C (Roll #6-10)
502. 753 82nd Place South, ca. 1920, Pyramidal. One-story frame dwelling, continuous brick foundation, low-pitched hipped roof, central gable-roof dormer, full-width recessed porch supported by decorative metal posts, three-bay facade, central single-leaf entrance, paired 4/1 sash windows. C (Roll #6-9)
503. 754 82nd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, sash windows, small gable-roof porch supported by slender wooden posts. C (Roll #6-23)
504. 758 82nd Place South, ca. 1950, Minimal Traditional. At one time, this dwelling was probably identical to 754 82nd Place South, but has been enlarged and altered. One-story frame dwelling, side-gable roof, five-bay facade, single-leaf entrance, aluminum sash windows, small gable roof porch supported by metal posts. NC (Roll #6-24)
505. 762 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, front-facing gable roof, paired 4/1 sash windows, former three-quarter width porch enclosed, band of aluminum sash windows, aluminum siding exterior. C (Roll #7-1)
506. 763 82nd Place South, ca. 1955, Modern. One-story frame dwelling, continuous brick foundation, low-pitched cross-hip roof, interior chimney, four-bay facade, single-leaf entrance, sash windows and one large multi-pane window, partial-width half-hipped roof porch supported by decorative metal posts. NC (Roll #6-8)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 44

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

507. 766 82nd Place South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, double front-facing gable roof, three-bay facade, single-leaf entrance, single and paired sash windows, full-width screened-in porch supported by square wooden piers, exposed rafter ends, decorative brackets. C (Roll #7-2)

508. 767 82nd Place South, ca. 1955, Modern. One-story frame dwelling, concrete foundation, low-pitched hipped roof, interior chimney, four-bay facade, single-leaf entrance, sash windows, small gable roof porch supported by decorative metal posts. (NC) (Roll #6-7)

82nd Street South

509. 82nd Street South, ca. 1925, Bungalow. One-story frame dwelling on continuous brick foundation, primary side-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows, partial-width gable roof porch supported by tapered posts on low brick piers and brick balustrade, decorative brackets and panel work in porch gable. C (Roll #16-1)

510. 82nd Street South, ca. 1920, Pyramidal. One-story frame dwelling, brick and stucco foundation (infill), steeply pitched hip roof, former hipped roof (enclosed), replacement aluminum windows, rear shed additional, aluminum siding exterior. NC (Roll #16-2)

511. 501 82nd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, three-bay facade, single-leaf entrance, single and tripartite sash windows, partial-width recessed porch supported by decorative ironwork supports, aluminum siding exterior wall material. C (Roll #15-17)

512. 505 82nd Street South, ca. 1955, Modern. One-story frame dwelling, gable-on-hip roof, concrete block foundation, three-bay facade, single-leaf entrance, metal casement windows, partial-width recessed porch supported by decorative ironwork supports. NC (Roll #15-18)

513. 511 82nd Street South, ca. 1925, Bungalow. One-and-a-half story frame dwelling on full basement, side-gable roof, interior chimney, two hipped-roof dormers containing single square slightly recessed windows, four-bay facade, single-leaf entrance, 6/6 sash windows, wraparound porch supported by square wooden posts and decorative turned posts. C (Roll #15-19)

514. 525 82nd Street South, ca. 1930, Bungalow. One-story frame dwelling on basement, continuous brick foundation, side-gable roof, interior chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by decorative ironwork supports on low brick piers, aluminum siding exterior wall material, decorative brackets. C (Roll #15-20)

515. 748 82nd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior side chimney, porch has been enclosed, three-bay facade, single-leaf entrance, single and tripart window, aluminum siding exterior wall material. NC (Roll #5-30)

516. 752 82nd Street South, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, exterior side chimney, three-bay facade, single-leaf entrance, single and tripart windows, single-leaf entrance, partial-width recessed porch. NC (Roll #5-31)

517. 763 82nd Street South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, cross-gable roof, three-bay facade, single-leaf entrance, paired 4/1 sash windows, three-quarter width gable roof porch supported by tall end brick piers, weatherboard exterior wall material. C (Roll #6-2)

518. 764 82nd Street South, ca. 1955, Modern. One-story frame dwelling on full basement, concrete block foundation, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, sash windows. NC (Roll #5-33)

519. 765 82nd Street South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, three-quarter width gable roof porch supported by wooden posts, exposed rafter ends, decorative brackets. C (Roll #5-37)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 45

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
520. 768 82nd Street South, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, cross-gable roof with front facing wing incorporating window and partially recessed porch supported by metal pole, three-bay facade, tripart and sash window, single-leaf entrance. NC (Roll #6-3)
521. 769 82nd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, side gable with rear ell, interior chimney, four-bay facade, paired sash windows, aluminum siding exterior wall material, small gable-roof porch supported by metal posts. C (Roll #5-36)
522. 771 82nd Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior side chimney, front-facing gable porch (enclosed), aluminum siding exterior wall material, original sash windows. C (Roll #5-34)
523. 772 82nd Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by squat posts on tall brick piers, low brick balustrade, aluminum siding exterior wall material. C (Roll #5-32)
524. 773 82nd Street South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete foundation, interior chimney, aluminum windows. House appears to have undergone remodeling and the addition of front section. Original house hard to discern. NC (Roll #5-35)

83rd Street South

525. 715 83rd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, exterior-side chimney, side-gable roof, three-bay facade, 8/8 sash windows, central single-leaf entrance, gable-roof porch supported by slender posts. C (Roll #7-18)
526. 716 83rd Street South, ca. 1950, Minimal Traditional. Small one-story frame dwelling, side-gable roof, three-bay facade, single-leaf entrance, 6/6 sash windows, partial-width shed roof porch supported by five slender posts. C (Roll #7-17)
527. 717 83rd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing incorporating small gable wing, three-bay facade, sash windows, side porch. C (Roll #7-19)
528. 720 83rd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on concrete block foundation, side-gable foundation, small side porch supported by slender posts, three-bay facade, 1/1 sash windows, asbestos shingle exterior wall material. C (Roll #7-16)
529. 730 83rd Street South, ca. 1950, No Style. Two-story frame dwelling, side-gable roof with central interior chimney, three over three bay facade, 4/1 sash windows, two single-leaf entrances, upper screened-in porch supported by three lower level ironwork supports. C (Roll #7-15)
530. 738 83rd Street South, ca. 1925, Spanish Revival. One-story frame dwelling on full basement, stucco exterior wall material, flat roof hidden behind low-lying decorative parapet with exaggerated chimney stack, tile located along parapet, three-bay facade, single-leaf entrance, paired 6/1 sash windows, front-facing chimney, small shed-roof porch (non-original). C (Roll #7-14)
531. 740 83rd Street South, ca. 1960, Modern. One-story frame dwelling, low-pitched cross hipped roof, four bay facade, aluminum sash windows, partial porch supported by ironwork posts. NC (Roll #7-13)
532. 745 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling on stone foundation, dominant side-gable roof, four-bay facade, single-leaf entrance, paired sash windows, gable roof porch supported by tapered posts on stone balustrade, exposed rafter ends and decorative brackets, aluminum siding exterior wall material. C (Roll #7-20)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 46

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
533. 746 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling on brick foundation, cross-gable roof, interior and exterior-side chimney, gable-roof porch supported by tall end brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows, wood siding exterior wall material. C (Roll #7-12)
534. 748 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling on full brick basement, cross-gable roof with double-front facing gables, porch supported by tall end brick piers connected by low brick balustrade, three-bay facade, single-leaf entrance, paired 4/1 sash windows. C (Roll #7-11)
535. 750 83rd Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on brick basement, cross-gable roof with front-facing gable wing, three-bay facade, multi-pane sash windows, small side porch, interior chimney. C (Roll #7-10)
536. 760 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, primary side-gable roof with dominant front-facing gable roof porch supported by tall end brick piers, porte cochere/carport added to left side, three-bay facade, central single-leaf entrance, paired sash windows, aluminum siding exterior wall material. C (Roll #7-9)
537. 761 83rd Street South, ca. 1940, Minimal Traditional. Elements of Tudor Revival. Large two-story frame dwelling with aluminum siding and brick veneer exterior wall material, cross-gable roof with dominant front facing uneven gable wing incorporating arched entrance opening, one-over-two bay facade, replacement aluminum sash windows, single-leaf entrance. C (Roll #7-21)
538. 762 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, side-gable roof, former porch enclosed, two bay facade, sash windows, small porch remaining. House altered resulting in loss of integrity. NC (Roll #7-8)
539. 764 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, full-width recessed porch supported by tapered posts on low brick piers. C (Roll #7-7)
540. 766 83rd Street South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, paired 4/1 sash windows, partial-width gable roof porch supported by squat posts on brick piers, wood siding exterior wall material. C (Roll #7-6)
541. 500 83rd Place South, ca. 1940, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, concrete foundation, side-gable roof with front facing gable wing at left, four-bay facade, 6/6 single and paired sash windows, single-leaf entrance at right, gable-roof porch supported by tall brick piers, faux half-timber treatment in gables. C (Roll #28-13)
542. 501 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tapered paneled posts on brick piers connected by wooden balustrade. C (Roll #28-13)
543. 509 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, single and paired sash windows, gable-roof porch supported by tapered posts on tall brick piers. C (Roll #28-12)
544. 513 83rd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, original facade altered substantially, former porch enclosed, aluminum siding exterior wall material. NC (Roll #28-11)
545. 517 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, concrete foundation, front-facing gable roof, weatherboard exterior wall material, three-bay facade, single-leaf entrance, replacement aluminum sash windows, gable-roof porch supported by simple wooden posts. C (Roll #28-10)
546. 521 83rd Place South, ca. 1960, Minimal Traditional. One-story frame dwelling, brick veneer exterior wall material, concrete foundation, side-gable roof, three-bay facade, single-leaf entrance, single and triple 6/6 sash windows, small stoop with ironwork balustrade. NC (Roll #28-9)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 47

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
547. 527 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, partial-width gable roof porch supported by paneled posts. C (Roll #28-8)
548. 600 83rd Place South, ca. 1960, Modern. Two-story concrete block building, low-pitched hipped roof, three over three bay facade, single-leaf entrances located on both levels, aluminum casement windows, open carport supported by decorative metal posts. NC (Roll #28-5)
549. 601 83rd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, central interior chimney, three-bay facade, single-leaf entrance, 8/8 sash windows, central gable-roof porch supported by plain posts, wood shingle exterior wall material. C (Roll #28-7)
550. 603 83rd Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior-side chimney, three-bay facade, single-leaf entrance, partial-width shed roof porch, wood shingle exterior wall material. C (Roll #28-6)
551. 609 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, central single-leaf entrance, 5/1 sash windows, full-width gable roof porch supported by tall brick piers connected by low brick balustrade, weatherboard exterior wall material. C (Roll #8-3)
552. 612 83rd Place South, ca. 1960, Modern. Concrete block dwelling, low-pitched hipped roof, three-bay facade, single-leaf entrance, aluminum casement windows, small stoop reached by flight of steps in front of entrance. NC (Roll #28-4)
553. 613 83rd Place South, ca. 1950, Ranch. One-story frame dwelling, concrete foundation, low-pitched cross-hipped roof, three-bay facade, single and triple sash windows, small recessed porch supported by single decorative iron post, asbestos shingle exterior wall material. C (Roll #28-1)
554. 616 83rd Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, stucco exterior wall material, low-pitched hipped roof, three-bay facade, central single-leaf entrance, tripartite windows, small gable roof porch supported by decorative metal posts. C (Roll #28-2)
555. 617 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, complex roof line, three-bay facade, central single-leaf entrance, pairs of 4/1 sash windows, partial-width gable roof porch supported by tall piers, side porch and central interior chimney. C (Roll #27-24)
556. 621 83rd Place South, ca. 1940, Bungalow. One-story frame dwelling, brick foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, single and paired sash windows, gable roof porch supported by tall end brick piers connected by low-lying balustrade. C (Roll #27-19)
557. 622 83rd Place South, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof hidden behind low-lying parapet wall, exterior side chimney, three-bay facade, central single-leaf entrance, partial-width porch supported by decorative metal work posts. C (Roll #27-23)
558. 625 83rd Place South, ca. 1940, Bungalow. One-story frame dwelling, brick and concrete block foundation, cross-gable roof, three-bay facade, single-leaf entrance, three-quarter width gable-roof porch supported by two slender posts, aluminum siding. C (Roll #27-18)
559. 626 83rd Place South, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, former flat roof behind parapet wall now obscured by the addition of a gable roof resting above parapet, three-bay facade, single-leaf entrance, sash windows. NC (Roll #27-20)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 48

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
560. 628 83rd Place South, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof behind elaborate curvilinear parapet, semicircular porch supported by arched openings and connected by low-lying balustrade, side arched garden wall opening. C (Roll #27-17)
561. 629 83rd Place South, ca. 1940, Bungalow. One-story frame dwelling, concrete block pier foundation, side-gable roof, three-bay facade, central single-leaf entrance, single and paired sash windows, gable-roof porch supported by tall stucco piers. C (Roll #27-16)
562. 630 83rd Place South, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof hidden behind highly decorative curvilinear parapet, full-width porch supported by arched openings, three-bay facade, single-leaf entrance, paired sash windows, arched stucco garden entrance. C (Roll #27-14)
563. 633 83rd Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, low continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, small gable-roof porch supported by slender wooden posts. C (Roll #27-15)
564. 637 83rd Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, low continuous brick foundation, gable-on-hip roof with central interior chimney, three-bay facade with side porch, paired sash windows, central single-leaf entrance, small hipped roof porch. C (Roll #27-13)
565. 640 83rd Place South, ca. 1960, No Style. One-story frame dwelling, concrete block foundation, side-gable roof, five-bay facade, central single-leaf entrance set in elaborate faux-stone gable-roof entrance way. NC (Roll #27-12)
566. 641 83rd Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, primary side-gable roof, three-bay facade, central single-leaf entrance, paired sash windows, small gable-roof porch supported by slender columns, weatherboard exterior wall material. C (Roll #27-11)
567. 645 83rd Place South, ca. 1940, Commercial. One-story frame dwelling, continuous concrete foundation, front-facing gable roof, three-bay facade, double-leaf entrance, paired sash windows. Structure may have been built as commercial building but appears to have been heavily altered and does not contribute to district. NC (Roll #27-10)
568. 701 83rd Place South, ca. 1955, Ranch. One-story frame dwelling, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, single, paired and triple sash windows. C (Roll #27-9)
569. 705 83rd Place South, ca. 1955, Ranch. One-story frame dwelling, low-pitched hipped-roof, five-bay facade, side carport and recessed porch supported by decorative metalwork posts, single and paired sash windows. NC (Roll #27-8)
570. 707 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof, front-facing gable-roof porch supported by slender wooden posts, three-bay facade, single-leaf entrance, sash windows (replacements). C (Roll #27-7)
571. 713 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, three-bay facade, central single-leaf entrance, single and paired sash windows, gable-roof porch supported by tapered posts on low brick piers. C (Roll #27-6)
572. 715 83rd Place South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, single and paired sash windows, gable-roof porch supported by boxed supports, aluminum siding. C (Roll #27-5)
573. 725 83rd Place South, ca. 1940, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, three-bay facade, single-leaf entrance, picture and sash window, gable roof porch supported by tapered end posts on low brick piers. C (Roll #27-1)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 49

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
574. 727 83rd Place South, ca. 1940, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, sash windows, table roof porch supported by tapered posts on low brick piers. C (Roll #27-2)
575. 730 83rd Place South, ca. 1930, Bungalow. One-story frame dwelling, stucco foundation, side-gable roof, exterior side-chimney, three-bay facade, single-leaf entrance, paired sash windows, gable roof porch supported by slender squat wooden posts on tall brick piers connected by stucco balustrade. C (Roll #27-3)
576. 733 83rd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, cross-gable roof with front-facing gable over partially recessed porch, three-bay facade, single-leaf entrance, casement windows. NC (Roll #26-24)
577. 737 83rd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, three-bay facade, casement windows, recessed porch supported by slender wooden posts. NC (Roll #26-23)
578. 741 83rd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, exterior side chimney, front-facing gable wing, three-bay facade, partial-width shed roof porch. NC (Roll #26-22)
579. 747 83rd Place South, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation with full carport, cross-gable roof with front-facing gable wing, interior-side chimney, three-bay facade, single-leaf entrance, aluminum siding exterior wall material. NC (Roll #26-21)
580. 749 83rd Place South, ca. 1955, Modern. One-story frame dwelling, low-pitched hipped roof, concrete block foundation, shingle exterior wall material, three-bay facade, single-leaf entrance, sash and picture windows. NC (Roll #26-20)
581. 753 83rd Place South, ca. 1955, Modern. One-story frame dwelling, low-pitched hipped roof, interior chimney, four-bay facade, single-leaf entrance, sash and picture windows, concrete block foundation, shingle exterior wall material. NC (Roll #26-19)

84th Place South

582. 600 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof, three-bay facade, single-leaf entrance, sash windows, full-width recessed porch supported by tall end brick piers and wooden posts on low brick piers, weatherboard exterior wall material. C (Roll #31-23)
583. 601 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, side-gable roof with crest of rear ell resting center of main roofline, three-bay facade, central single-leaf entrance with sidelights, pairs of 4/1 sash windows, full-width shed roof porch with central portico, wooden columns. C (Roll #31-24)
584. 602 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick and stucco foundation, cross-gable roof, exterior-side chimney, three-bay facade, single-leaf entrance, three-quarter width shed-roof porch supported by lattice work posts on low brick piers. C (Roll #31-22)
585. 603 84th Place South, ca. 1930, Minimal Traditional. One-story frame dwelling, cross-gable roof with dominant front-facing clipped gable, exterior-side chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, weatherboard exterior wall material, small clipped-gable roof overhang, full-width terrace surrounded by decorative metal railing. C (Roll #32-1)
586. 605 84th Place South, ca. 1930, Bungalow. One-story frame dwelling, faux stonework applied to continuous foundation, front-facing gable roof, weatherboard exterior wall material, three-quarter width porch (enclosed), three-bay facade, central single-leaf entrance, metal louvered windows, former porch supported by posts and faux stonework piers and balustrade. C (Roll #32-2)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 50

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
587. 607 84th Place South, ca. 1930, Minimal Traditional. One-story frame dwelling, weatherboard and faux stonework exterior wall material, side clipped-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired 2/2 sash windows, entire facade covered with faux stonework, small metal porch. C (Roll #32-3)
588. 608 84th Place South, ca. 1955, Ranch. One-story frame dwelling on basement, concrete block foundation, low-pitched cross-hip roof, recessed wraparound porch, aluminum sash windows, asbestos shingle exterior wall material. NC (Roll #31-21)
589. 609 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, former full-width porch now partially enclosed creating two-bay facade, single-leaf entrance now located in side of porch enclosed, tapered piers supporting porch, continuous brick foundation. C (Roll #32-4)
590. 611 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable wing, three-bay facade, single-leaf entrance, paired 4/1 sash windows, near full-width gable roof porch supported by tall end brick piers, aluminum siding exterior wall material. C (Roll #32-5)
591. 612 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, side-gable roof, central interior chimney, weatherboard exterior wall material, three-bay facade, single-leaf entrance, sash windows, gable-roof porch supported by wooden piers. C (Roll #31-20)
592. 616 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with prominent gable-front addition to facade, aluminum siding and brick veneer exterior wall material, gable-roof porch. NC (Roll #31-19)
593. 624 84th Place South, ca. 1970, Neo-Traditional.. One-story frame dwelling, side-gable roof, concrete slab foundation, brick veneer exterior wall material, five-bay facade, single-leaf entrance, gable roof porch supported by wooden columns. NC (Roll #31-18)
594. 625 84th Place South, ca. 1950, Modern. One-story frame dwelling, continuous brick foundation, cross-hip roof with front-projecting hip wing, four-bay facade, central single-leaf entrance, single and paired multi-pane sash windows, aluminum siding exterior wall material. C (Roll #32-6)
595. 628 84th Place South, ca. 1950, Modern. One-story framed dwelling, continuous concrete block foundation, gable-on-hip roof, two-bay facade, sash and multi-pane picture windows, side-porch with side single-leaf entrance, asbestos shingle exterior wall material. C (Roll #31-17)
596. 631 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, weatherboard exterior wall material, central gable-roof entrance porch supported by two colonettes. C (Roll #32-7)
597. 632 84th Place South, ca. 1950, Modern. One-story frame dwelling, continuous concrete block foundation, gable-on-hip roof, three-bay facade, single-leaf entrance, single and paired sash windows, hip-roof porch supported by decorative metal posts. C (Roll #31-16)
598. 633 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, single aluminum sash windows, aluminum siding exterior wall material, gable-roof porch supported by two wooden posts. C (Roll #32-8)
599. 636 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, continuous concrete foundation, three-bay facade, two single-leaf entrances, front-facing gable-roof porch supported by decorative metal posts, asbestos shingle exterior wall material. C (Roll #31-15)
600. 637 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, interior chimney, three-bay facade, single-leaf entrance located far right off of small screened-in recessed porch, single sash and picture windows, asbestos shingle exterior wall material. C (Roll #32-9)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 51

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

601. 640 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, side-gable roof, three-bay facade, central single-leaf entrance, aluminum picture and sash windows, asbestos shingle exterior wall material, gable porch supported by slender posts. C (Roll #31-14)
602. 644 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, two-bay facade, multi-pane sash windows, side porch, single-leaf entrance off porch. C (Roll #31-13)
603. 700 84th Place South, ca. 1950, Pyramidal. One-story frame dwelling, continuous concrete foundation, hipped roof, three-bay facade, central single-leaf entrance, sash and casement windows, side hipped-roof wing. C (Roll #31-12)
604. 705 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick facade, brick veneer exterior wall material, gable-on-hip roof, central interior chimney, five-bay facade, central single-leaf entrance, sash windows, small gable-roof overhang. C (Roll #32-18)
605. 709 84th Place South, ca. 1952, Modern. One-story frame dwelling over full basement with garage, low-pitched cross-hip roof, three-bay facade, paired aluminum sash windows and central tripartite picture and sash window, single-leaf entrance off small recessed porch supported by single decorative metal post. C (Roll #32-19)
606. 713 84th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, five-bay facade, two-front facing wings connected by recessed porch supported by two decorative metal posts, central single-leaf entrance, paired sash windows, aluminum siding exterior wall material. C (Roll #32-20)
607. 716 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, primary side-gable roof with gable of rear ell resting on main ridge, exterior-end chimney, five-bay facade, single-leaf entrance, gable-roof porch supported by decorative metal posts. C (Roll #31-11)
608. 719 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, central three-bay block flanked by slightly recessed wings, exterior side-chimney, four-bay facade, central single-leaf entrance, small gable-roof porch supported by slender wooden posts, sash windows. C (Roll #32-21)
609. 720 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, central single-leaf entrance, sash windows, gable roof overhang. C (Roll #31-10)
610. 721 84th Place South, ca. 1955, Modern. One-story frame dwelling, concrete slab foundation, cross-gable roof, L-shaped dwelling, projecting front-facing wing with rear cross wing containing single leaf entrance, tripartite aluminum casement windows and open carport, small recessed porch opens onto carport. NC (Roll #32-22)
611. 723 84th Place South, ca. 1930, Bungalow. One-story frame dwelling, continuous concrete foundation, side-gable roof, exterior side-chimney, three-bay facade, single-leaf entrance, paired sash windows, three-quarter width gable roof porch supported by decorative metal posts on low brick balustrade. C (Roll #32-23)
612. 724 84th Place South, ca. 1940, No Style. Two-story frame dwelling, appears to have originally been constructed as garage apartments, cross-gable roof with front-facing gable wing on right end, five over four bay facade, two central bays on first level are garage doors, pairs of sash windows, exterior staircase rising at left to upstairs balcony. C (Roll #31-9)
613. 728 84th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, totally altered with the application of brick veneer exterior, changes to windows, doors, roofline. NC (Roll #31-8)
614. 729 84th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior-side chimney, four-bay facade, single-leaf entrance, 4/1 sash windows, gable-roof porch supported by tall end brick piers, side gable-roof carport. C (Roll #32-24)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 52

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

615. 732 84th Place South, ca. 1955, Modern. One-story frame dwelling on full basement, flat roof, patented stone exterior wall material, four-bay facade, aluminum casement windows, single-leaf entrance, partial-width flat roof porch supported by decorative metal supports, stone walkways and curbing. NC (Roll #31-7)
616. 736 84th Place South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, paired sash windows, asbestos shingle exterior wall material. C (Roll #31-6)
617. 737 84th Place South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, asbestos shingle and brick veneer exterior wall material, low-pitched cross-hipped roof, recessed wraparound porch, two-bay facade, aluminum sash windows. C (Roll #33-1)
618. 740 84th Place South, ca. 1940, Bungalow. One-story frame dwelling, continuous concrete foundation, front-facing gable roof, weatherboard exterior wall material, two-bay facade, single-leaf entrance, sash window, small gable-roof overhang. C (Roll #31-5)
619. 741 84th Place South, ca. 1955, Modern. One-story frame dwelling on full basement, low-pitched hipped roof, four-bay facade, single-leaf entrance, sash and picture windows, brick veneer exterior wall material, decorative metal porch supports. NC (Roll #33-2)

84th Street South

620. 508 84th Street South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hipped roof, three-bay facade, single-leaf entrance, single and paired vertical sash windows, hipped-roof porch supported by decorative ironwork posts. NC (Roll #28-17)
621. 512 84th Street South, ca. 1950, Modern. One-story frame dwelling resting on full basement, concrete block foundation, low-pitched hipped roof, interior chimney, three-bay facade, sash and picture windows, single-leaf entrance off recessed porch, decorative metal post, asbestos shingle wall material. C (Roll #28-18)
622. 518 84th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, sash windows, small gable-roof porch supported by decorative metal posts, aluminum siding exterior wall material. C (Roll #28-19)
623. 520 84th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, sash windows, small gable roof porch supported by decorative metal posts. C (Roll #28-20)
624. 521 84th Street South, ca. 1955, Ranch. Large one-story frame dwelling, brick veneer and siding exterior wall materials, low-pitched hipped roof, large exterior-end chimney, main 5-bay block with slightly recessed 2-bay block, aluminum sash and casement windows, single-leaf entrance, large picture window, NC (Roll #28-21)
625. 524 84th Street South, ca. 1965, Modern. One-story frame dwelling on full basement, concrete block foundation, cross-gable roof, four-bay facade, brick veneer and board and batten exterior wall material, gable roof porch supported by simple wooden posts. NC (Roll #28-22)
626. 604 84th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete foundation, side-gable roof with central gable-roof wing containing small recessed porch supported by decorative metal post and large picture window, four-bay facade, single-leaf entrance, aluminum sash windows. C (Roll #28-23)
627. 605 84th Street South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, cross-gable roof with dominant front-facing one-and-a-half story gable wing, brick veneer exterior wall material, four-bay facade, front-facing brick chimney, sash windows, former open porch (glassed-in) supported by arched brick openings, single-leaf entrance to left of main gable, small gable roof overhang. C (Roll #30-1)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 53

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

628. 607 84th Street South, ca. 1930, Bungalow. One-story frame dwelling, brick and stucco foundation, side-gable roof, three-bay facade, single-leaf entrance, 4/1 sash windows, gable roof porch supported by decorative metal posts, weatherboard exterior wall material. C (Roll #30-2)
629. 608 84th Street South, ca. 1950, Bungalow. One-story frame dwelling, concrete foundation, front-facing gable roof over full-width recessed porch supported by slender wooden posts on low brick piers, three-bay facade, single-leaf entrance, sash windows, asbestos shingle exterior wall material. C (Roll #28-24)
630. 611 84th Street South, ca. 1925, Bungalow. One-story frame dwelling on full basement, original house is discernible but has been heavily altered, large side addition and excavation of basement to form what appear to be separate apartment space, aluminum siding exterior wall material. NC (Roll #30-3)
631. 612 84th Street South, ca. 1940, Bungalow. One-story frame dwelling, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, sash windows, gable-roof porch supported by simple wooden posts on low brick piers, asbestos shingle exterior wall material. C (Roll #29-1)
632. 613 84th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, single-bay facade, carport, asbestos shingle exterior wall material. C (Roll #30-2)
633. 616 84th Street South, ca. 1940, No Style. One-story frame dwelling, low-pitched hipped roof, asbestos shingle exterior wall material, four-bay facade, single-leaf entrance. C (Roll #29-2)
634. 620 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, low-pitched hipped roof, three-bay facade, single-leaf entrance, single and triple 4/1 sash windows, gable-roof porch supported by tapered posts on low brick piers, aluminum siding exterior wall material. C (Roll #29-3)
635. 621 84th Street South, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, partial-width shed roof porch supported by decorative metal posts, aluminum siding exterior wall material. C (Roll #30-5)
636. 624 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, four-bay facade, former gable-roof porch enclosed, sash windows, side shed-roof addition, house appears to be much altered from original design. NC (Roll #29-4)
637. 625 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation with applied stucco, double front-facing gable roof, three-bay facade, single-leaf entrance, 4/1 sash windows, shed roof porch supported by decorative metal posts, aluminum siding exterior wall material. C (Roll #30-6)
638. 627 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, side gable roof, weatherboard and tar paper exterior wall material, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by wooden posts. C (Roll #30-7)
639. 628 84th Street South, ca. 1930, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, interior chimney, three-bay facade, partial-width recessed porch supported by single paneled post, weatherboard and patented stone exterior wall material, single-leaf entrance, single and paired 4/1 sash windows. C (Roll #29-5)
640. 632 84th Street South, ca. 1925, Bungalow. One-story frame dwelling on full basement, brick pier and concrete block foundation, side-gable roof, weatherboard exterior wall material, three-bay facade, single-leaf entrance, sash windows, gable roof porch with decorative ironwork supports. C (Roll #29-6)
641. 633 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, three-bay facade, single-leaf entrance, sash windows, gable-roof porch supported by decorative ironwork supports. C (Roll #30-8)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 54

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

642. 636 84th Street South, ca. 1970, Modern. One-story frame dwelling, aluminum siding exterior wall material, cross-gable roof, three-bay facade, single-leaf entrance, garage door opening. NC (Roll #29-7)
643. 637 84th Street South, ca. 1965, Modern. One-story frame dwelling with full garage in basement level, low-pitched hipped roof, five-bay facade, single-leaf entrance, sash aluminum windows, brick veneer exterior wall material. NC (Roll #30-9)
644. 647 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, low-pitched hip roof with central decorative gable wing with front-facing chimney, four-bay facade, decorative art glass windows, small recessed entrance porch supported by single brick pier. C (Roll #30-10)
645. 700 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation covered with stucco, side-gable roof with shed roof dormers, central interior chimney, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, central gable-roof porch supported by massive brick and stucco piers, decorative woodwork in porch gable. C (Roll #29-8)
646. 701 84th Street South, ca. 1925, Tudor Revival. One-story frame dwelling, cross-gable roof with corner cross-gables, continuous brick foundation, brick veneer exterior wall material, three-bay facade, paired 6/6 sash windows, central single-leaf entrance beneath small gable-roof overhang, minimal faux detailing in gables. C (Roll #30-11)
647. 705 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, continuous brick foundation, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by brick balustrade, weatherboard exterior wall material. C (Roll #30-12)
648. 711 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tapered posts on low brick piers, weatherboard exterior wall material, decorative brackets, exposed rafter ends. C (Roll #30-13)
649. 712 84th Street South, ca. 1950, Ranch. One-story frame dwelling, concrete foundation, low-pitched hip roof, three-bay facade, single-leaf entrance, replacement sash windows, hip roof porch supported by decorative ironwork posts, aluminum siding exterior wall material. C (Roll #29-9)
650. 716 84th Street South, ca. 1955, Ranch. One-story frame dwelling over basement level garage, asbestos shingle exterior wall material, low-pitched cross-hip roof, former partial-width recessed porch partially enclosed, decorative ironwork posts, two-bay facade, picture window. NC (Roll #29-10)
651. 717 84th Street South, ca. 1955, Modern. One-story frame dwelling, continuous concrete foundation, low-pitched gable on cross-hip roof, interior chimney, two-bay facade, band of 6/6 sash windows, small side-recessed porch supported by decorative metal posts, asbestos shingle exterior wall material. NC (Roll #30-14)
652. 720 84th Street South, ca. 1955, Ranch. One-story frame dwelling, concrete slab foundation, low-pitched hipped roof, three-bay facade with open carport, sash and picture windows, single leaf entrance on side off of recessed porch. NC (Roll #29-11)
653. 721 84th Street South, ca. 1955, No Style. Small one-story frame dwelling, side-gable roof, three-bay facade, partial width shed porch, aluminum windows. NC (Roll #30-15)
654. 723 84th Street South, ca. 1960, Ranch. One-story frame dwelling on basement, low-pitched hipped roof, interior chimney, four-bay facade, wooden siding and faux stonework applied to exterior, modern windows. NC (Roll#30-16)
655. 724 84th Street South, ca. 1955, Ranch. One-story frame dwelling, concrete slab and concrete block foundation, low-pitched hipped roof, recessed wraparound porch, decorative metal work posts, two bay facade, sash and picture windows. NC (Roll #29-12)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 55

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
656. 725 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, rubblestone and weatherboard exterior wall material, cross-gable roof, three-bay facade with central single-leaf entrance flanked by narrow 2/1 lights, replacement aluminum windows, gable-roof porch supported by wooden posts. C (Roll #36-12)
657. 728 84th Street South, ca. 1955, Ranch. One-story frame dwelling, poured concrete foundation, low-pitched cross-hip roof, asbestos shingle and brick veneer exterior wall material, four-bay facade, single-leaf entrance, vertical sash aluminum windows, partial-width recessed porch supported by decorative metal work posts. NC (Roll #29-13)
658. 732 84th Street South, ca. 1955, Ranch. One-story frame dwelling on full basement level garage, poured concrete foundation, low-pitched cross-hip roof, recessed wraparound porch supported by simple wooden posts, two bay facade, vertical aluminum windows, brick veneer exterior wall material. NC (Roll #29-14)
659. 733 84th Street South, ca. 1955, Modern. One-story frame dwelling on full basement with garage, gable on cross-hip roof, three-bay facade, single-leaf entrance, small recessed porch, central interior chimney. NC (Roll #30-18)
660. 736 84th Street South, ca. 1960, Modern. One-story frame dwelling on full basement, concrete block foundation, asbestos shingle and brick veneer exterior wall material, five-bay facade, single-leaf entrance, 6/6 sash windows, partial-width recessed porch supported by decorative metal work posts. NC (Roll #29-15)
661. 737 84th Street South, ca. 1955, Modern. One-story frame dwelling on full basement with garage, low-pitched cross-hip roof with central interior chimney, three-bay facade, single-leaf entrance off small recessed porch supported by decorative metal post. NC (Roll #30-19)
662. 740 84th Street South, ca. 1960, Modern. One-story frame dwelling on full basement, concrete block foundation, asbestos shingle and brick veneer exterior wall material, three-bay facade, partial-width recessed porch supported by decorative metal posts, single and triple sash windows. NC (Roll #29-16)
663. 741 84th Street South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, gable-on-hip roof, interior-end chimney, continuous concrete block foundation, two-bay facade, single-leaf entrance off small recessed porch supported by single decorative metal post. C (Roll #30-20)
664. 744 84th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, cross-gable roof with front-facing gable wing, three-bay facade, sash windows, single-leaf entrance, partial-width recessed porch supported by boxed posts. C (Roll #29-17)
665. 745 84th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, aluminum siding exterior wall material, gable-roof porch supported by wooden posts, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, side addition. C (Roll #30-21)
666. 748 84th Street South, ca. 1955, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, 6/6 sash windows, gable-roof porch supported by decorative metal posts, aluminum siding exterior wall material. NC (Roll #29-18)
667. 752 84th Street South, ca. 1960, Ranch. One-story frame dwelling over garage, low-pitched hipped roof with interior chimney, three-bay facade, aluminum casement windows, aluminum siding exterior wall material, NC (Roll #29-19)

85th Street South

668. 201 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, cross-gable roof with dominant double front-facing gable, front-facing chimney, four-bay facade, single-leaf entrance, paired and single sash windows, single-leaf entrance set in slightly-projecting pedimented door surround, weatherboard exterior wall material. C (Roll #42-12)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 56

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
669. 203 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, single sash windows, gable-roof porch supported by decorative metalwork supports, facade has been covered with brick veneer, sides covered with aluminum siding. NC (Roll #42-13)
670. 311 85th Street South, ca. 1910, Pyramidal. One-story frame dwelling, continuous brick foundation, hip-with-cross gable roof, interior chimney, five-bay facade, central single-leaf entrance, paired 4/1 sash windows, central gable-roof porch supported by groups of three classical colonettes. C (Roll #36-20)
671. 315 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof, three-bay facade, central single-leaf entrance, 12/12 sash windows, wooden shingle exterior wall material, rear ell. C (Roll #36-19)
672. 321 85th Street South, ca. 1930, Tudor Revival. One-story frame dwelling, continuous brick foundation, brick veneer exterior wall material, side-gable roof with front-facing gable-roof porch supported by tall end brick piers, faux half-timber work in gable, four-bay facade, paired and single 4/1 sash windows. C (Roll #36-18)
673. 401 85th Street South, ca. 1930, Tudor Revival. Large one-and-a-half story frame dwelling, brick veneer exterior wall material, side-gable roof with front-facing gable, front-facing chimney, side hipped-roof porch supported by tall end brick piers, four-bay facade, single-leaf entrance. C (Roll 336-17)
674. 405 85th Street South, ca. 1930, Tudor Revival. One-story frame dwelling, brick veneer exterior wall material, primary side-gable roof with rear ell, exterior-end chimney, central gable-roof porch supported by arched supports, five-bay facade, central single-leaf entrance, 1/1 sash windows. C (Roll #36-16)
675. 409 85th Street South, ca. 1952, Modern. One-story frame dwelling, brick veneer exterior wall material, low-pitched hipped roof, exterior-side chimney, concrete block foundation, three-bay facade, single-leaf entrance, aluminum sash windows. C (Roll #36-15)
676. 413 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling, concrete block foundation, hip roof with side-gable wing with exterior end chimney, four-bay facade, partial-width porch on side-gable wing, partial-width shed roof porch, 6/6 aluminum windows, asbestos shingle wall material. C (Roll #36-14)
677. 417 85th Street South, ca. 1952, Minimal Traditional. One-story frame, brick veneer exterior wall material (may be later addition), cross-gable roof with front-facing gable wing, front-facing chimney, three-bay facade, single-leaf entrance, 6/6 sash windows, small shed roof porch supported by single wooden post. C (Roll #36-13)
678. 500 85th Street South, ca. 1952, Modern. One-story frame dwelling, concrete block foundation, cross-hip roof, exterior-side chimney, two-bay facade, single-leaf entrance, band of metal casement windows, secondary side-porch. C (Roll #35-17)
679. 501 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, four-bay facade, former side porch (enclosed), multi-pane fixed windows, central single-leaf entrance beneath small shed roof porch, asbestos shingle exterior wall material. C (Roll #335-19)
680. 504 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling over basement level garage, concrete block foundation, cross-gable roof with double-front facing gable wing, three-bay facade, small recessed porch supported by decorative metal post, metal casement windows, single-leaf entrance to side off porch, asbestos shingle exterior wall material. C (Roll #35-16)
681. 505 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney located between main roofline and small side porch with louvered glass panels, four-bay facade, single-leaf entrance, metal casement windows, asbestos shingle exterior wall material. C (Roll #35-18)
682. 509 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable, former exterior-side chimney now located between main gable and hipped roof of small one-bay addition, four-bay facade, single-leaf entrance, picture window and vertical sash windows, asbestos shingle exterior wall material. C (Roll #35-15)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 57

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

683. 512 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, cross-gable roof with cross-hip wing, three-bay facade, single and paired sash windows, small recessed porch to right (glassed-in), asbestos shingle exterior wall material. C (Roll #35-13)
684. 513 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front facing gable wing, three-bay facade, former porch at left (glassed-in), metal casement windows, single-leaf entrance, asbestos shingle exterior wall material. C (Roll #35-14)
685. 514 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with later front-facing gable roof garage at extreme left, interior chimney, four-bay facade plus garage, louver and sash windows, single-leaf entrance. C (Roll #35-11)
686. 516 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, concrete block foundation, interior chimney located between side-gable roof and side addition with extremely low-pitched hipped (almost flat) roof with metal balustrade, five-bay facade, 6/6 sash windows, single-leaf entrance, aluminum siding exterior wall material. C (Roll #35-9)
687. 517 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, triple aluminum casement windows, side-porch with louvered glass windows, asbestos shingle exterior wall material. C (Roll #35-12)
688. 521 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney located between side-gable and flat roof addition to right, four-bay facade, single-leaf entrance, aluminum casement windows, single-leaf entrance. C (Roll #35-10)
689. 524 85th Street South, ca. 1960, Modern. One-story frame dwelling, relatively new brick veneer exterior wall material, low-pitched hip roof, three-bay facade, single-leaf entrance, vertical sash windows. NC (Roll #35-7)
690. 525 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior brick chimney between side-gable and low-pitched hipped roof addition to right, four-bay facade, single-leaf entrance, metal casement windows, asbestos shingle exterior wall material. C (Roll #35-8)
691. 528 85th Street South, ca. 1925, Tudor Revival. One-story frame dwelling, continuous brick foundation, cross-gable roof with two front-facing gable wings connected by small open terrace, left gable contains porch supported by tall end brick piers, three-bay facade consisting of French doors and tripartite sash windows, single-leaf entrance in side or right gable wing. C (Roll #35-5)
692. 529 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling over basement garage, concrete block foundation, side-gable roof, interior-side chimney between gable-roof and flat-roof addition to right, four-bay facade, single-leaf entrance and paired 1/1 sash windows. C (Roll #35-6)
693. 532 85th Street South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, cross-gable roof with dominant asymmetrical gable-roof porch supported by arched openings, brick veneer exterior wall material, three-bay facade, paired and triple 4/1 sash windows, single-leaf entrance. C (Roll #35-3)
694. 533 85th Street South, ca. 1950, Modern. One-story frame dwelling, concrete block foundation, hip roof with central interior chimney, three-bay facade with small recessed porch supported by slender wooden posts, paired 6/6 sash window and central bay window, single-leaf entrance located to side of small porch. C (Roll #35-4)
695. 537 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete foundation, cross-gable roof with front-facing gable wing, exterior-side chimney, three-bay facade, large multi-pane and diamond-shaped pane windows, single-leaf entrance, single-leaf entrance. C (Roll #35-2)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 58

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
696. 541 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, primary side-gable roof with central slightly projecting gable-wing, interior brick chimney, three-bay facade, aluminum sash (replacement) and casement windows, single-leaf entrance off small recessed porch supported by three plain posts, asbestos shingle exterior wall material. C (Roll #35-1)
697. 600 85th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, full-width recessed porch supported by tall end brick piers and tapered colonettes on low brick piers, low brick balustrades, three-bay facade, central single-leaf entrance, paired 4/1 sash windows, weatherboard exterior wall material. C (Roll #34-24)
698. 601 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof, front-facing gable wing, five-bay facade, single, paired and triple 6/6 sash windows, single-leaf entrance, weatherboard exterior wall material. C (Roll #35-0)
699. 603 85th Street South, ca. 1960, Split-level. Two-story side-gable section with flanking side gable one-story wing, frame construction, concrete slab foundation, one-story wing has three-bay facade and full recessed porch supported by five classical colonettes, two-bay section has 4/4 bay facade, exterior end chimney, single-leaf entrance, brick veneer and aluminum siding exterior wall material. NC (Roll #34-22)
700. 604 85th Street South, ca. 1955, Modern. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof, three-bay facade, single-leaf entrance, single and paired vertical sash windows, hip-roof porch supported by decorative metal posts. NC (Roll #34-23)
701. 608 85th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, exterior-side chimney, two-bay facade, triple 6/6 sash windows, partially recessed wraparound porch with slightly projecting gable roof supported by tall brick piers, single-leaf entrance off porch, decorative brackets. C (Roll #34-21)
702. 609 85th Street South, ca. 1930, Colonial Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, side-gable roof, interior chimney, 3/5 bay facade, three dormer windows, central single-leaf entrance set in gable-roof enframement, single 6/6 sash windows. C (Roll #34-19)
703. 612 85th Street South, ca. 1930, Minimal Traditional. One-story frame dwelling, continuous brick foundation, primary side-gable roof with small rear ell, central interior chimney, three-bay facade, single-leaf entrance, single 6/6 sash windows, gable-roof porch supported by wooden columns, aluminum siding exterior wall material. C (Roll #34-20)
704. 616 85th Street South, ca. 1925, Tudor Revival. One-story frame dwelling on full basement, brick veneer exterior wall material, primary side-gable roof with rear ell, exterior-end chimney, three-bay facade, central single-leaf arched entrance, paired 6/1 sash windows, gable-roof porch supported by arched openings connected by low brick balustrade. C (Roll #34-18)
705. 617 85th Street South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, cross-hip roof, four-bay facade, single-leaf entrance, vertical aluminum sash windows, basement garage opening. NC (Roll #34-17)
706. 620 85th Street South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation covered with stucco, front-facing gable roof, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by tall end stuccoed piers connected by low stucco balustrade, aluminum siding exterior wall material. C (Roll #34-14)
707. 621 85th Street South, ca. 1960, Ranch. One-story frame dwelling, continuous concrete block foundation, brick veneer exterior wall material, four-bay facade, single-leaf entrance, aluminum sash windows and large tripartite picture and sash window, interior-end chimney. NC (Roll #34-16)
708. 624 85th Street South, ca. 1952, Ranch. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hip roof, five-bay facade, metal casement windows, single-leaf entrance, decorative metal post supporting small recessed porch, asbestos shingle exterior wall material. C (Roll #34-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 59

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

709. 625 85th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, three-bay facade, single-leaf entrance, single and paired sash windows, full-width hipped-roof porch supported by three tall brick piers connected by low brick balustrade. C (Roll #34-15)
710. 629 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling on full basement, continuous brick foundation, cross-gable roof, exterior side-chimney, front-facing gable, three-bay facade, single and paired sash windows, single-leaf entrance beneath small gable roof overhang supported by large brackets, full-width terrace with metal balustrade, aluminum siding exterior wall material. C (Roll #34-12)
711. 632 85th Street South, ca. 1952, Modern. One-story frame dwelling on full basement, concrete block foundation, hip roof, four-bay facade, single-leaf entrance, paired vertical sash windows, former shingle-exterior wall material partially covered with brick veneer, gable-roof porch supported by decorative metal posts. C (Roll #34-10)
712. 633 85th Street South, ca. 1952, Modern. One-story frame dwelling on full basement, concrete block foundation, cross-hip roof, three-bay facade with open carport, single-leaf entrance, tripartite and paired sash windows, asbestos shingle exterior wall material. C (Roll #34-11)
713. 636 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling over full basement garage, side-gable roof, interior-chimney, four-bay facade, single-leaf entrance, paired vertical sash windows, gable roof porch supported decorative metal posts, aluminum siding and brick veneer exterior wall material. C (Roll #34-9)
714. 637 85th Street South, ca. 1952, Modern. One-story frame dwelling on full basement, concrete block foundation, cross-hip roof with central interior chimney, four-bay facade, single-leaf entrance, sash and casement windows, partial-width shed roof porch. C (Roll #34-8)
715. 640 85th Street South, ca. 1950, Minimal Traditional. One-and-a-half story frame dwelling, side-gable roof, continuous concrete foundation, interior-chimney located between open side porch and main block of the house, long six-bay facade of main house with ell and gable wing, front-facing gable containing gable-roof porch supported by pairs of plain posts, vertical aluminum sash windows, single-leaf entrance. C (Roll #34-5)
716. 641 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling, concrete foundation, side-gable roof with rear ell, four-bay facade, single-leaf entrance, sash and casement windows, aluminum siding exterior wall material, partial-width shed roof porch supported by slender wooden posts. C (Roll #34-7)
717. 645 85th Street South, ca. 1952, Modern. One-story frame dwelling, concrete foundation, asbestos shingle and brick veneer exterior wall material, cross-hip roof with interior chimney, four-bay facade, vertical sash aluminum windows, large picture window, single-leaf entrance, partial-width shed roof porch. C (Roll #34-6)
718. 700 85th Street South, ca. 1960, Ranch. One-story frame dwelling, continuous concrete foundation, cross-hip roof, four-bay facade with open carport, single-leaf entrance, aluminum casement windows, small recessed porch supported by single metal posts. NC (Roll #34-3)
719. 703 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with central interior chimney, six-bay facade, single-leaf entrance, 6/6 sash windows, small hipped-roof overhang supported by large brackets, weatherboard exterior wall material. C (#34-4)
720. 707 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable wing containing gable-roof entrance porch and front-facing brick chimney, four-bay facade, single-leaf entrance, single and paired 6/6 sash windows, aluminum siding exterior wall material. C (Roll#34-2)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 60

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
721. 709 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, paired sash windows, gable-roof porch supported by decorative metal posts. C (Roll #33-24)
722. 711 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, brick veneer exterior wall material, side-gable roof, central interior chimney, four-bay facade, central single-leaf entrance, single and paired 6/6 sash windows, small gable-roof entrance porch supported by decorative metal posts. C (Roll #33-21)
723. 712 85th Street South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, gable-on-hip roof, three-bay facade, single sash and tripartite picture-and-sash window, single-leaf entrance off side-porch supported by single post. C (Roll #34-1)
724. 714 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, single and tripartite sash windows, single-leaf entrance, wood shingle exterior wall material, small shed roof entrance porch supported by decorative metal posts. C (Roll #33-20)
725. 715 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof, interior chimney, three-bay facade, single-leaf entrance, single and paired sash window, small recessed porch in front-facing gable supported by slender wooden posts connected by decorative wooden arches. C (Roll #33-21)
726. 716 85th Street South, ca. 1960, Ranch. One-story frame dwelling over basement garage, wood siding and brick veneer exterior wall material, low-pitched hipped roof, four-bay facade, single-leaf entrance, paired sash windows. NC (Roll #33-22)
727. 717 85th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling on full basement, side-gable roof, interior chimney, side porch, four-bay facade, single-leaf entrance, 6/6 sash windows, gable-roof entrance porch supported by triple slender wooden posts. C (Roll #33-19)
728. 721 85th Street South, ca. 1940, Bungalow. One-story frame dwelling on full basement, primary side-gable roof, central gable roof wing may have originally been an open porch, central interior chimney, three-bay facade, aluminum casement and wooden sash windows. C (Roll #33-18)
729. 731 85th Street South, ca. 1960, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hip roof, five-bay facade, single-leaf entrance, 8/8 sash windows, partial width recessed porch, brick veneer (facade) and asbestos shingle exterior wall material. House may be earlier and undergone cosmetic changes. NC (Roll #33-16)
730. 732 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-hip roof, four-bay facade, single-leaf entrance, paired sash and picture window, small entrance porch supported by single wooden post. C (Roll #33-17)
731. 735 85th Street South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hip roof, recessed porch to left, two-bay facade, paired and tripartite sash windows, single-leaf entrance to side off front porch, asbestos shingle exterior wall material. C (Roll #33-14)
732. 736 85th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof with front-facing gable wing, asbestos shingle exterior wall material, four-bay facade, single, paired and picture window. C (Roll #33-15)
733. 740 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, central interior chimney, four-bay facade, recessed single-leaf entrance, 8/8 sash windows. C (Roll #33-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 61

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
734. 744 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, three-bay facade, small recessed porch to right supported by decorative metal post, sash windows, asbestos shingle exterior wall material. C (Roll #33-12)
735. 745 85th Street South, ca. 1960, Ranch. One-story frame dwelling, brick veneer exterior wall material, low-pitched cross-hip roof, three-bay facade, central single-leaf entrance, small recessed porch supported by simple decorative metal post, aluminum windows. C (Roll #33-11)
736. 748 85th Street South, ca. 1952, Minimal Traditional. One-story frame dwelling with basement level garage, continuous concrete block foundation, two-bay facade, aluminum sash windows, small recessed porch supported by decorative metal post, single-leaf entrance to side off porch. C (Roll #33-9)
737. 749 85th Street South, ca. 1952, Ranch. One-story frame dwelling, continuous concrete foundation, low-pitched cross-hipped roof, four-bay facade, single-leaf entrance, aluminum sash and picture windows, asbestos shingle exterior wall material, small recessed porch supported by metal post. C (Roll #33-10)
738. 752 85th Street South, ca. 1960, Ranch. One-story frame dwelling, continuous concrete foundation, low-pitched hipped roof, brick veneer exterior wall material, three-bay facade, single-leaf entrance off small recessed porch supported by decorative iron post, aluminum sash and casement windows. NC (Roll #33-7)
739. 753 85th Street South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched hipped roof, partial-width shed roof porch supported by decorative metal posts, aluminum sash windows, asbestos shingle exterior wall material. C (Roll #33-8)

86th Place South

740. 200 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, spraddle-roof, exterior-end chimney, five-bay facade, centrally-placed single-leaf entrance with transom, large single-glass windows (non-original), full-width recessed porch supported by wooden columns resting on brick balustrade. C (Roll #38-20)
741. 201 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof extending out over full-width recessed porch supported by tall end brick piers and interior wooden posts resting on low brick piers, three-bay facade, single-leaf entrance, single and paired sash windows, aluminum siding exterior wall material. C (Roll #39-23)
742. 209 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof extending out over full-width recessed porch supported by paneled posts on low brick piers, weatherboard exterior wall material, three-bay facade, central single-leaf entrance, large multi-pane windows, exposed rafter ends and decorative brackets. C (Roll #39-22)
743. 210 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick veneer exterior wall material, low-pitched hipped roof, interior chimney, three-bay facade, full-width recessed porch supported by decorative ironwork posts. House substantially altered. NC (Roll #38-19)
744. 213 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof with central interior chimney, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows, three-quarter width gable roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #39-21)
745. 214 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior and exterior side-chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, full-width recessed porch supported by paneled and tapered posts on low-brick piers. C (Roll #38-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 62

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

746. 217 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-clipped gable roof, full-width recessed porch supported by tapered posts on tall brick piers connected by low-brick balustrade, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #39-20)
747. 218 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior and exterior side-chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, full-width recessed porch supported by paneled and tapered posts on brick piers. C (Roll #38-17)
748. 221 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, spraddle-roof, centrally-placed shed roof dormer with four 3-pane windows, full-width recessed porch supported by paneled colonettes on low-brick piers. C (Roll #39-19)
749. 224 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, four-bay facade, single-leaf entrance, sash and picture windows, partial-width porch with gable roof at entrance. C (Roll #39-16)
750. 225 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof over full-width recessed porch supported by decorative ironwork posts, three-bay facade, single-leaf entrance, paired 4/1 sash windows, weatherboard exterior wall material. C (Roll #39-18)
751. 226 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, two interior chimneys, full-width recessed porch supported by pairs of posts on brick piers, four-bay facade, single-leaf entrance, 4/1 sash windows. C (Roll #38-16)
752. 228 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, spraddle-roof, central interior chimney, three-bay facade, single-leaf entrance flanked by paired 4/1 sash windows, full-width recessed porch supported by tapered posts on brick piers connected by open brickwork balustrades, weatherboard exterior wall material. C (Roll #38-15)
753. 232 86th Place South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof extending out over full-width recessed porch supported by paired posts on brick piers connected by wooden balustrades, three-bay facade, single-leaf entrance, sash windows, aluminum siding exterior wall material. C (Roll #38-14)
754. 233 86th Place South, ca. 1952, Modern. One-story frame dwelling, low-pitched cross-hipped roof, continuous concrete block foundation, three-bay facade, single-leaf entrance, aluminum sash windows, partial-width recessed porch. C (Roll #39-15)
755. 236 86th Place South, ca. 1925, Dutch Colonial Revival. Two-and-a-half story frame dwelling, front-facing gambrel roof, 1/2/2 bay facade, paired 4/1 sash windows in attic story, paired and triple 4/1 sash windows, single-leaf entrance with sidelights, single-leaf French door in second-bay position on second-floor, flat-roof porch supported by decorative ironwork posts, weatherboard exterior wall material. C (Roll #38-13)
756. 300 86th Place South, ca. 1960, Split-Level. Two-story frame dwelling, side-gable roof, brick veneer and vertical weatherboard exterior wall material, central single-leaf entrance, 6/6 sash windows, garage door on first level. NC (Roll #38-12)
757. 307 86th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof with central decorative wall gable, interior chimney, three-bay facade, centrally-place single-leaf entrance, sash and tripartite window. C (Roll #39-14)
758. 308 86th Place South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, cross-gable roof with dominant front-facing gable containing paired 4/1 sash window, front-facing chimney, three-bay facade on first floor, single and triple 4/1 sash windows, single-leaf entrance set beneath metal awning. C (Roll #38-11)
759. 309 86th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable wing, brick veneer facade, continuous brick foundation, three-bay facade, paired 6/6 sash windows, single-leaf entrance. House altered with application of brick veneer and alteration of former porch. NC (Roll #39-13)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 63

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

760. 311 86th Place South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous brick foundation, side-gable roof, three-bay facade, single-leaf entrance, 8/8 sash windows, side-porch, aluminum siding exterior wall material. C (Roll #39-14)
761. 312 86th Place South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, cross-gable roof with two front-facing gable wings, interior chimney, three-bay facade, central single-leaf entrance, paired multi-pane-over-one sash windows, gable-roof entrance porch and adjoining gable-roof porch supported by arched openings, partial-width terrace. C (Roll #38-10)
762. 320 86th Place South, ca. 1925, Tudor Revival. Large two-story frame dwelling, brick veneer exterior wall material, side-gable roof with small decorative gable off-centered to right, massive exterior-end chimney, 3/2 bay facade, single and paired 4/1 sash windows, single-leaf French door, one-story gable roof entrance porch supported by arched openings resting on brick piers, full terrace with brick balustrade. C (Roll #38-9)
763. 408 86th Place South, ca. 1970, Modern. One-story frame dwelling, brick veneer exterior wall material, side-gable roof, three-bay facade, single-leaf entrance, vertical sash windows, small gable-roof entrance porch supported by decorative ironwork posts. NC (Roll #38-4)
764. 412 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, low-pitched cross-hipped roof, four-bay facade, single-leaf entrance, vertical sash windows, small recessed porch supported by decorative ironwork posts, front-facing chimney, aluminum siding exterior wall material. C (Roll #38-3)
765. 416 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, low-pitched hipped roof, exterior-side chimney, three-bay facade, vertical sash windows, single-leaf entrance, hipped-roof porch supported by simple wooden posts and cross-braced balusters, wood shingle exterior wall material. C (Roll #38-2)
766. 420 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof with centrally-placed projecting gable-front wing, three-bay facade, small recessed porch to left, single-leaf entrance, single and tripartite windows, interior chimney. C (Roll #38-1)
767. 424 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, interior chimney located between main structure and side-gable roof porch, single-leaf entrance off porch, two-bay facade, single and paired sash windows. C (Roll #37-24)
768. 445 86th Place South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, five-bay facade, single sash and picture windows, small entrance stoop, house has been enlarged significantly from original design. NC (Roll #42-1)
769. 449 86th Place South, ca. 1950, Modern. One-story frame dwelling, gable-on-hip roof, four-bay facade, single-leaf entrance off small recessed porch supported by decorative metal post, single and triple windows, asbestos shingle exterior wall material. C (Roll #42-2)

86th Street South

770. 201 86th Street South, ca. 1925, Bungalow. One-story frame dwelling, hip-with-cross-gable roof, stucco foundation material, interior chimney, four-bay facade, 6/6 sash windows, single-leaf entrance, three-quarter width shed-roof porch supported by square posts on stucco piers and connected by stucco balustrade. C (Roll #38-22)
771. 207 86th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, former porch enclosed to create new two-bay facade, interior chimney, aluminum replacement windows. NC (Roll #38-23)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 64

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
772. 213 86th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, exterior-side chimney, front-facing gable wing contains single 6/6 windows and small recessed porch supported by single wooden post, aluminum siding exterior wall material. C (Roll #38-24)
773. 217 86th Street South, ca. 1925, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, near full-width gable-roof porch supported by wooden posts on low brick piers, aluminum siding exterior wall material. C (Roll #39-1)
774. 221 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, hip-with-cross-gable roof, interior chimney, small centrally-located decorative gable, front-facing gable at left, three-bay facade, paired and triple sash windows, single-leaf entrance on glassed-in porch at right. C (Roll #39-2)
775. 229 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing gable wing, interior chimney, three-bay facade, single-leaf entrance, paired 6/6 sash windows, partial-width shed roof porch supported by slender wooden colonettes. C (Roll #39-3)
776. 301 86th Street South, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-end chimney, three-bay faced, single-leaf entrance, paired 4/1 sash windows, gable-roof porch supported by tall end brick piers connected by low brick balustrade. C (Roll #39-4)
777. 305 86th Street South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, primary side-gable roof with asymmetrical front-facing gable-roof porch with arched openings, exterior-side chimney, three-bay facade, paired 6/6 sash windows, single-leaf entrance. C (Roll #39-5)
778. 309 86th Street South, ca. 1925, Tudor Revival. One-and-a-half story frame dwelling on full basement, brick veneer exterior wall material, cross-gable roof with front-facing gable at left and central gable-roof porch supported by arched openings, front-facing chimney to right of porch, three-bay facade, single and triple 4/1 sash windows, full-width terrace surrounded by open brickwork balustrade. C (Roll #39-6)
779. 310 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable wing, three-bay facade, paired sash and picture windows, single-leaf entrance, small gable-roof porch supported by decorative metal post, asbestos shingle exterior wall material. C (Roll #27-3)
780. 312 86th Street South, ca. 1952, Ranch. One-story frame dwelling, continuous concrete block foundation, brick veneer and vertical weatherboard exterior wall material, low-pitched hip roof, four-bay facade, vertical aluminum windows, wide-overhanging eaves. C (Roll #27-4)
781. 313 86th Street South, ca. 1970, Modern. One-story frame dwelling, cross-gable roof, brick veneer exterior wall material, four-bay facade, single-leaf entrance with sidelights, bay window, aluminum sash windows, gable-roof porch. NC (Roll #39-7)
782. 315 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, four-bay facade, 8/8 sash windows, single-leaf entrance, small gable-roof porch supported by slender wooden posts. C (Roll #39-8)
783. 319 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof with front-facing gable wing, three-bay facade, single and paired sash windows, single-leaf entrance, partial-width shed roof porch supported by wooden piers. C (Roll #39-9)
784. 410 86th Street South, ca. 1950, Minimal Traditional. One-and-a-half story frame dwelling, side-gable roof with two dormer windows, brick veneer and vertical and horizontal siding exterior wall material, four-bay facade, central single-leaf entrance, paired 6/6 sash windows and aluminum casement windows in fourth bay, central single-leaf entrance, gable-roof porch supported by decorative metal posts. C (Roll #37-10)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 65

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

785. 415 86th Street South, ca. 1955, Ranch. One-story frame dwelling, low-pitched hipped roof, three-bay facade with open carport, paired and triple sash windows, single-leaf entrance, asbestos-shingle exterior wall material. NC (Roll #37-13)
786. 416 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with interior chimney, four-bay facade, single and paired vertical sash windows, single-leaf entrance, aluminum siding exterior wall material. C (Roll #37-11)
787. 420 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, primary side-gable roof with a hipped-end extending down into front-facing gable wing, interior chimney, three-bay facade, single and paired sash windows, single-leaf entrance opening onto glassed-in recessed porch. C (Roll #37-12)
788. 424 86th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, cross-gable roof with centrally placed front-facing gable wing, interior chimney, three-bay facade, single-leaf entrance, single and paired sash windows, small gable-roof overhang, aluminum siding exterior wall material. C (Roll #37-14)
789. 428 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, subordinate side-gable wing containing screened-in porch, chimney located between porch and main house, three-bay facade, single and paired sash windows, single-leaf entrance off side porch, aluminum siding exterior wall material. C (Roll #37-15)
790. 430 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, single and paired vertical sash windows, single-leaf entrance, small shed-roof overhang. C (Roll #37-16)
791. 436 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof with small subordinate side-gable roof wing, two-bay facade, single and paired sash windows, small recessed porch to right, single-leaf entrance off porch. C (Roll #37-17)
792. 440 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof with small subordinate side-gable roof wing, interior chimney, four-bay facade, single-leaf entrance, sash and picture window, aluminum siding exterior wall material. C (Roll #37-18)
793. 444 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof with subordinate side-gable wing, interior chimney, four-bay facade, single-leaf entrance, single and paired sash aluminum windows. C (Roll #37-19)
794. 448 86th Street South, ca. 1940, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, cross-gable roof with centrally placed and slightly projecting gable-roof wing, interior chimney, four-bay facade, single-leaf entrance, vertical-sash windows, small gable-roof overhang. C (Roll #37-20)
795. 452 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof with slightly subordinate side-gable roof wings, interior chimney, four-bay facade, single and paired vertical sash windows, single-leaf entrance. C (Roll #37-21)
796. 456 86th Street South, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous concrete block foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, single and paired sash windows. C (Roll #37-22)
797. 462 86th Street South, ca. 1952, Modern. One-story frame dwelling, continuous concrete block foundation, low-pitched hipped roof, interior chimney, small recessed porch to left with side single-leaf entrance, two-bay facade, picture and sash windows, aluminum siding exterior wall material. C (Roll #37-23)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 66

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

Rugby Avenue

798. 7782 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, cross gable roof with double front facing gables and side-gable wing, two-bay facade, paired 6/6 sash windows and a large plate glass window installed when house was obviously remodeled. C (Roll #13-13)
799. 7784 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, interior and exterior-side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, partial-width gable roof porch supported by decorative metal posts. C (Roll #13-14)
800. 7788 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, complex cross-gable roofline, dominant side-gable roof with three-quarter width porch supported by tall brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows, exposed rafter ends. C (Roll #13-15)
801. 7792 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, exterior side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, exposed rafter ends, asbestos shingle exterior wall material, gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade. C (Roll #13-16)
802. 7801 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block and faux stone foundation, cross-gable roof with large front-facing gable wing, interior chimney, four-bay facade, pairs of 6/6 sash windows, single-leaf entrance, aluminum siding exterior wall material. C (Roll #13-12)
803. 7802 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, front-facing gable wing, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by tall end brick piers connected by low-lying brick balustrade, exterior side and interior rear chimneys, decorative brackets along eaves of overhang of secondary side entrance. C (Roll #13-17)
804. 7803 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with dominant front-facing gable, interior chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, small gable-roof porch supported by tall end brick piers connected by decorative openwork brick balustrade. C (Roll #13-11)
805. 7804 Rugby Avenue, ca. 1920, L-cottage. One-story L-shaped frame dwelling, continuous brick foundation covered in stucco, cross-hip roof, front-facing hip roof wing, three-bay facade, single-leaf entrance, aluminum vertical sash windows, single-leaf entrance, partial-width shed roof porch supported by slender posts, asbestos shingle exterior wall material. C (Roll #13-18)
806. 7806 Rugby Avenue, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, three-bay facade, single, paired and triple vertical sash windows, small recessed porch supported by decorative metal posts, side single-leaf entrance off porch. NC (Roll #13-19)
807. 7808 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side gable roof, exterior side chimney, single and paired 4/1 sash windows, single-leaf entrance, partial-width gable roof porch supported by tall end brick piers, exposed rafter ends and decorative brackets. C (Roll #13-20)
808. 7809 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, stucco over brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable-roof porch supported by decorative metal posts. C (Roll #13-10)
809. 7810 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior and exterior side chimney, three-bay facade, single-leaf entrance, paired windows, gable roof porch supported by tall end brick piers and connected by low brick balustrade. C (Roll #13-11)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 67

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
810. 7811 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing, exterior end chimney, three-bay facade, single-leaf entrance, 6/6 sash and tripartite window, partial-width shed roof porch supported by decorative metal posts. C (Roll #13-9)
811. 7815 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, concrete and brick foundation, dominant front-facing gable roof with decorative gable located along side, gable roof porch (glassed-in) creating two bay facade with single-leaf entrance to side of former porch, original 4/1 sash windows, 1/1 sash modern windows, wood siding exterior wall material, interior chimney. C (Roll #13-8)
812. 7820 Rugby Avenue, ca. 1950. Minimal Traditional. One-story frame dwelling, concrete block foundation, primary side-gable roof, interior chimney, four-bay facade, single-leaf entrance, 6/6 sash windows, small gable roof porch supported by slender posts. C (Roll #13-22)
813. 7821 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing and front-facing entrance gable, five-bay facade, single-leaf entrance, sash and tripartite windows. C (Roll #13-7)
814. 7823 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side gable roof, three-bay facade, paired sash windows, partial-width recessed porch supported by three slender posts. C (Roll #13-6)
815. 7824 Rugby Avenue, ca. 1940, Bungalow. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, 4/1 sash windows, single-leaf entrance, gable roof porch supported by slender posts. C (Roll #13-23)
816. 7827 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, 1/1 sash windows, single-leaf entrance, small gable roof porch supported by slender wooden posts, aluminum siding exterior wall material. C (Roll #13-5)
817. 7900 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame L-shaped dwelling, concrete block foundation, cross-gable roof, interior chimney, front-facing gable wing, three-bay facade, single-leaf entrance, sash and picture windows, single-leaf entrance set in side of front facing gable wing. C (Roll #13-24)
818. 7903 Rugby Avenue, ca. 1955, Modern. One-story frame dwelling, concrete foundation, cross-hip roof with two hipped roof wings at each end connected by small recessed porch or loggia, decorative metal work supports and balustrade, four-bay facade including last bay which is garage door opening, tripartite windows, single-leaf entrance. NC (Roll #13-4)
819. 7905 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete piers and stone foundation, side-gable roof, central interior chimney, four-bay facade, two single-leaf entrances, partial-width shed roof porch supported by decorative metal posts, decorative metal roof cresting. C (Roll #13-3)
820. 7906 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, L-shaped, cross-gable roof with front-facing gable wing, exterior-end chimney, three-bay facade, single-leaf entrance, partial-width shed roof porch supported by three square posts, asbestos shingle exterior wall material. C (Roll #14-1)
821. 7907 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete foundation, side-gable roof, interior chimney, two bay facade, single-leaf entrance, 4/4 sash window, partial-width shed roof porch supported by decorative ironwork posts. C (Roll #13-2)
822. 7909 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, concrete block foundation, three-bay facade, single-leaf entrance, gable roof porch supported by simple wooden posts, casement windows. C (Roll #13-1)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 68

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
823. 7910 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing, three-bay facade, paired and triple sash windows, single-leaf entrance, partial-width shed roof porch supported by decorative metal posts. C (Roll #14-2)
824. 7911 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, interior chimney, asbestos shingle exterior wall material, five-bay facade, 4/4 sash windows, single-leaf entrance, shed roof porch supported by decorative wooden posts. C (Roll #12-24)
825. 7914 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, five-bay facade, central single-leaf entrance flanked by plate-glass windows, paired 3/1 sash windows in outer bays, central gable roof porch supported by lattice work supports. C (Roll #14-3)
826. 7920 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, interior chimney, centrally placed front-facing gable wing, five-bay facade, single-leaf entrance, paired and triple 4/1 sash windows. C (Roll #14-4)
827. 7921 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, concrete block foundation, principal five bay facade connected by open carport to additionally end bay, 4/4 sash windows, single-leaf entrance, small brick stoop. C (Roll #12-23)
828. 7924 Rugby Avenue, ca. 1970, A-Frame. One-and-a-half story frame A-frame dwelling, 2/3 bay facade, central single-leaf entrance, faux diamond shaped panes, full-width deck. NC (Roll #14-5)
829. 7925 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, stucco over brick foundation, front-facing gable roof with secondary gable extending out over partially recessed wrap-around porch which has been partially enclosed, tapered posts on low brick piers supports, three-bay facade, single-leaf entrance, 3/1 sash windows. C (Roll #12-22)
830. 7926 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, concrete block foundation, central interior chimney, exposed rafter ends, four-bay facade, 3/1 sash windows, single-leaf entrance, shed-roof porch supported by four wooden posts. C (Roll #14-6)
831. 7930 Rugby Avenue, ca. 1970, Split-Level. Two-story frame dwelling, cross-gable roof, large front-facing gable wing, concrete foundation, wood siding, faux stone and brick veneer exterior wall material, three-bay facade, aluminum windows, single-leaf entrance. NC (Roll #14-17)
832. 7931 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, concrete block foundation, asbestos shingle and brick veneer exterior wall material, front-facing gable wing, three-bay facade, single-leaf entrance, sash and picture windows. C (Roll #12-21)
833. 7935 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof with two front-facing gable wings located at each end, four-bay facade, single-leaf entrance, sash and tripartite windows, interior chimney, partial width porch connecting two flanking wings, asbestos shingle exterior wall material. C (Roll #12-20)
834. 7939 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, exterior end chimney, five-bay facade, first bay located in slightly recessed wing, sash and tripartite windows, single-leaf entrance, small flat roofed porch supported by small wooden posts, asbestos shingle exterior wall material. C (Roll #12-19)
835. 7943 Rugby Avenue, ca. 1940, Minimal Traditional. One-story frame dwelling, side-gable roof with dominant front-facing gable that originally contained a porch which is now glassed-in, concrete block foundation, asbestos shingle and brick veneer exterior wall material, large multi-pane and 6/6 sash windows, side entrance off small recessed porch. C (Roll #12-18)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 69

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
836. 7947 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, exterior end chimney, three-bay facade, single-leaf entrance, vertical sash windows, partial-width hipped roof porch supported by decorative metal posts. C (Roll #12-17)
837. 8000 Rugby Avenue, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, asbestos shingle exterior wall material, cross-hip roof, four-bay facade, single-leaf entrance, single, paired and triple sash window. NC (Roll #14-8)
838. 8001 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, asbestos shingle exterior wall material, brick foundation, front-facing gable roof, exterior side chimney, full width clipped-gable roof porch supported by tall end brick piers, three-bay facade, single-leaf entrance, single and paired sash windows. C (Roll #12-16)
839. 8004 Rugby Avenue, ca. 1930, Bungalow. Small one-story frame dwelling, front-facing gable roof which extends out on the left side, concrete block foundation, two bay facade, single-leaf entrance, small hipped roof porch supported by metal posts, 3/1 sash windows, side entrance. C (Roll #14-9)
840. 8008 Rugby Avenue, ca. 1940, Bungalow. One-story frame dwelling, side-gable roof, concrete block foundation, three-bay facade, single-leaf entrance, single and tripartite windows, gable roof porch supported by slender posts. C (Roll #14-10)
841. 8009 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, dominant front-facing gable roof, rubblestone foundation, weatherboard exterior wall material, heavy decorative brackets, full-width recessed porch supported by triple wooden posts on tall end rubblestone piers, low-lying rubblestone balustrade, four-bay facade, single-leaf entrance, single and paired 4/1 sash windows. C (Roll #12-15)
842. 8010 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, concrete block foundation, side-gable roof, exterior side and interior chimney, weatherboard exterior wall material, three-bay facade, single-leaf entrance, paired sash windows, gable-roof porch supported by tall end stucco piers connected by stucco balustrade. C (Roll #14-11)
843. 8013 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, front-facing gable wing, exterior end chimney, three-bay facade, 6//1 sash and picture windows, single-leaf entrance, wood shingle exterior wall material. C (Roll #12-14)
844. 8017 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, front-facing gable wing, exterior end chimney, single sash and tripartite windows, single-leaf entrance. C (Roll #12-13)
845. 8022 Rugby Avenue, ca. 1955, Modern. One-story frame dwelling, cross-hip roof with front-facing hip roof wing, three-bay facade, weatherboard and brick veneer exterior wall material, single-leaf entrance, paired sash and picture windows, side entrance in projecting wing. NC (Roll #14-12)
846. 8025 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, continuous brick foundation, exterior-side chimney, small gable roof dormer, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by tall end brick piers connected by open brickwork balustrade, asbestos shingle exterior wall material. C (Roll #12-12)
847. 8028 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, rubblestone foundation, front-facing gable roof, full-width recessed porch supported by four tapered posts on low rubblestone piers, three-bay facade, single-leaf entrance, paired sash windows, exterior-side rubblestone chimney. C (Roll #14-13)
848. 8030 Rugby Avenue, ca. 1925, Tudor Revival. One-story frame dwelling, stucco exterior wall material, cross-hip roof with front-facing gable incorporating front-facing chimney, four-bay facade, single-leaf entrance set behind arched opening, front gable extending out into parapet wall with arched garden gate, single and paired sash windows. C (Roll #14-14)
849. 8033 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof, interior chimney, near-full width gable roof wing incorporating recessed porch and paired 4/1 sash window, porch screened-in and supported by single post. C (Roll #12-11)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 70

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
850. 8034 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, side-gable roof with rear ell, rubblestone foundation, three-bay facade, central single-leaf entrance, paired sash windows, central gable roof porch supported by round posts on rubblestone piers, side aluminum roof porch. C (Roll #14-15)
851. 8035 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, near full-width gable roof porch supported by tall end brick piers, screened-in porch, three-bay facade, single-leaf entrance, single and paired sash windows, aluminum siding exterior wall material. C (Roll #12-10)
852. 8036 Rugby Avenue, ca. 1970, Apartment Building. Two-story brick veneered apartment building, five-over-five bay facade, single and paired aluminum sash windows, double-leaf entrance, full height portico supported by two square columns. NC (Roll #14-16)
853. 8037 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, side-gable roof, exterior-end chimney, three-bay facade, central single-leaf entrance (French door), paired 4/1 sash windows, gable roof porch supported by squat tapered posts on tall brick piers. C (Roll #12-9)
854. 8038 Rugby Avenue, ca. 1980, Commercial Building – T’Lee’s Beauty Salon. Structure appears to incorporate an earlier wooden frame building which has been encased in brick veneer exterior, flat and gable roof, recessed entrance, multi-pane and plate-glass windows. NC (Roll #14-17)
855. 8052 Rugby Avenue, ca. 1940, Commercial Building – R&E Cleaners. Triple commercial block with staggered parapets as building conforms to the rising topography, bands of decorative brickwork and decorative brick panels located along cornice, brick construction, each block featured large plate glass display windows, two blocks have central double-leaf plated glass doors, metal awnings. C (Roll #12-8)
856. 8101 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, primary side gable roof with dominant front-facing gable-roof porch supported by tall end brick piers connected by low-lying brick balustrade, three-bay facade, single-leaf entrance, paired sash windows, weatherboard exterior wall material. C (Roll #12-7)
857. 8105 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, continuous brick foundation, cross-gable roof with front-facing gable wing, three-bay facade, single-leaf entrance, paired sash windows, partial-width shed roof porch supported by simple wooden posts, asbestos shingle exterior wall material. C (Roll #12-6)
858. 8109 Rugby Avenue, ca. 1930, Tudor Revival. One-and-a-half story frame dwelling, brick veneer exterior wall material, complex roofline with three front-facing gables, front-facing brick chimney, five-bay facade, single-leaf entrance, central gable-roof porch supported by large arched opening. C (Roll #12-5)
859. 8110 Rugby Avenue, ca. 1930, Tudor Revival. One-story frame dwelling on full rubblestone basement, brick veneer exterior wall material, cross-gable roof with front facing gable porch wing and front-facing decorative gable, three-bay facade, single-leaf entrance, 6/6 triple windows, double arches on porch, low brick balustrade, exterior side chimney. C (Roll #14-18)
860. 8114 Rugby Avenue, ca. 1925, Bungalow. One-and-a-half story frame dwelling, brick foundation, side gable/spraddle roofline, central gable-roof dormer window, full-width recessed porch supported by three tall brick piers, three-bay facade, single-leaf entrance, paired 4/1 sash windows, aluminum siding exterior wall material. C (Roll #14-19)
861. 8120 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with front-facing gable roof porch supported by tall end brick piers, four-bay facade includes two single-leaf entrance, single and paired sash windows, weatherboard exterior wall material. C (Roll #14-20)
862. 8121 Rugby Avenue, undetermined, no style-ruinous. Remnants of one story frame dwelling, evidence of cross-gable roof, interior chimney. NC (Roll #12-4)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 71

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
-
863. 8122 Rugby Avenue, ca. 1970, Modern. Brick veneer duplex, cross-hip roof, aluminum sash windows, single-leaf entrances, small recessed porch supported by single metal post. NC (Roll #14-21)
864. 8125 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, hipped roof, central interior chimney, three-bay facade, single-leaf entrance, single 1/1 sash windows, small hipped roof porch supported by tall metal posts, aluminum siding exterior wall material. C (Roll#12-3)
865. 8131 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, stucco-over-brick foundation, side-gable roof, three-bay facade, central single-leaf entrance, 2/2 sash windows, gable-roof porch supported by slender posts. C (Roll #12-1)
866. 8135 Rugby Avenue, ca. 1960, Ranch. One-story frame dwelling, concrete foundation, brick veneer exterior wall material, cross-hip roof, three-bay facade, single-leaf entrance, single vertical sash and tripartite window, small recessed porch supported by simple metal post. NC (Roll #11-24)
867. 8137 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling on basement, continuous brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, single sash windows, full-width recessed porch supported by four classical colonettes, weatherboard exterior wall material, decorative brackets. C (Roll #11-23)
868. 8140 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, brick foundation, front-facing gable roof, full width recessed porch supported by four metal posts, two-bay facade, side-exterior chimney capped off, weatherboard exterior wall material, sash windows. C (Roll #14-23)
869. 8141 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, front-facing gable roof, recessed partial-width porch supported by tall end brick pier, three-bay facade, single-leaf entrance, paired sash windows, clapboard and aluminum siding exterior wall material. C (Roll #11-22)
870. 8143 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling on full basement, continuous brick foundation covered with stucco, front-facing gable roof, front-facing gable-roof porch supported by tall end brick piers connected by low lying stuccoed balustrade, exterior-side chimney. C (Roll #11-21)
871. 8144 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, primary front-facing gable roof with two front-facing gable wings at each end connected by shed roof porch supported by two wooden posts, single and paired sash windows, single-leaf entrances located in side of each wing off porch. C (Roll #14-23)
872. 8146 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, low-pitched hipped roof, exterior-side chimney, full-width shed roof porch extending out into porte-cochere, multi-post porch supports connected by extensive brick balustrade, porch probably not original, three-bay facade, single-leaf entrance, paired 6/1 sash windows. C (Roll #14-24)
873. 8147 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling on full basement, continuous brick foundation, front-facing gable roof, three-bay facade, single-leaf entrance, paired sash windows, gable roof porch supported by tall end brick piers. C (Roll #11-20)
874. 8152 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, brick foundation, cross-gable roof, three-bay facade, single-leaf entrance, single and paired sash windows, three-quarter width gable-roof porch, weatherboard exterior wall material. C (Roll #15-1)
875. 8153 Rugby Avenue, ca. 1951, Modern. One-story frame dwelling on full basement, concrete block foundation, cross-hip roof with central interior chimney, three-bay facade, small recessed side porch supported by decorative metal posts, single-leaf entrance on side of porch, sash and casement windows. C (Roll #11-19)
876. 8157 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, concrete block foundation, cross-gable roof with front-facing gable wing, exterior-side chimney, three-bay facade, single-leaf entrance, paired sash and tripartite windows, partial-width shed roof porch supported by decorative metal posts. C (Roll #11-18)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 72

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
877. 8161 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, full-width gable roof porch supported by decorative metal posts (non-original), two-bay facade, single-leaf entrance flanked by sidelights, 4/1 sash window. C (Roll #11-17)
878. 8164 Rugby Avenue, ca. 1940. Minimal Traditional. One-story frame on continuous brick foundation, cross-gable roof with large decorative front-facing gable, front-facing brick chimney, gable roof overhang over front door, four-bay facade, small square single-light windows flanking chimney, single-leaf entrance, triple sash window, partial-width brick terrace across front. C (Roll #15-3)
879. 8165 Rugby Avenue, ca. 1970, Modern. One-story frame dwelling, brick veneer exterior wall material, hipped roof, four-bay facade, single-leaf entrance to side, four-bay facade, large 6/6 sash windows. NC (Roll #11-16)
880. 8168 Rugby Avenue, ca. 1940. Minimal Traditional. One-story frame dwelling on concrete block foundation, cross-gable roof, front-facing gable wing, exterior-side chimney, three-bay facade, paired sash and tripartite windows, small gable roof entrance porch supported by decorative metal posts. C (Roll #15-2)
881. 8169 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling on concrete block foundation, side-gable roof, three-bay facade, side single-leaf entrance off small recessed porch supported by decorative metal posts, single and tripartite windows. C (Roll #11-15)
882. 8172 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling on rubblestone foundation, cross-gable roof, exterior-side chimney, three-bay facade, single leaf entrance, paired sash windows, gable roof porch supported by colonettes on low rubblestone balustrade. C (Roll #15-3)
883. 8173 Rugby Avenue, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, hip roof with decorative gable-roof dormer, three-bay facade, side screened-in porch, paired and tripartite windows, aluminum siding exterior wall material. NC (Roll #11-14)
884. 8177 Rugby Avenue, ca. 1951, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, exterior-side chimney, front-facing gable wing, three-bay facade, single-leaf entrance, paired sash windows, aluminum siding exterior wall material. C (Roll #11-13)
885. 8178 Rugby Avenue, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, exterior-side chimney, front-facing gable wing, three-bay facade, single-leaf entrance, paired 3/1 sash windows, partial-width shed roof porch supported by tapered piers. C (Roll #15-4)
886. 8179 Rugby Avenue, ca. 1951, Modern. One-story frame dwelling, concrete block foundation, cross-hipped roof, central interior chimney, three-bay facade, single and tripartite window, small recessed porch supported by decorative metal post, asbestos shingle exterior wall material. C (Roll #11-12)
887. 8183 Rugby Avenue, ca. 1951, Modern. One-story frame dwelling, primary side-gable roof with dominant front-facing decorative gable, central interior chimney, three-bay facade, single and tripartite window, small recessed porch supported by decorative metal post, wood shingle exterior wall material, single-leaf entrance off side porch. C (Roll #11-11)
888. 8187 Rugby Avenue, ca. 1951, Modern. One-story frame dwelling on full basement, cross-hip roof, centrally-placed interior chimney, three-bay facade, single and tripartite window, small recessed porch to right containing side single-leaf entrance, wooden shingle exterior wall material. C (Roll #11-10)
889. 8201 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, exterior-rear and exterior-side chimneys, cross-gable roof with dominant front-facing gable, subordinate partial-width gable-roof porch supported by tall end brick piers connected by openwork brick balustrade, three-bay facade, paired 4/1 sash windows, single-leaf entrance, exposed rafter ends and decorative brackets and arches. C (Roll #11-9)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 73

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

890. 8202 Rugby Avenue, ca. 1952, Modern. One-story frame on full basement, concrete block foundation, primary hip roof with subordinate rear hip, side hip roof porch supported by decorative ironwork posts, exterior-side chimney on side-porch, wood shingle exterior wall material, three-bay facade, 8/8 sash windows, single-leaf entrance off side-porch. C (Roll #15-5)
891. 8204 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling on concrete block foundation, side-gable roof with exterior end chimney, asbestos shingle exterior wall material, three-bay facade, single-leaf entrance, single and paired sash windows, gable roof porch at right end supported by decorative ironwork posts. C (Roll #15-6)
892. 8205 Rugby Avenue, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof hidden behind low-lying decorative parapet wall, three-bay facade, original recessed porch glassed-in, single-leaf entrance, paired 1/1 sash windows, exterior-side chimney. C (Roll #11-8)
893. 8208 Rugby Avenue, ca. 1952, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, side-gable roof porch, single-leaf entrance off porch, three-bay facade, sash windows, front-facing chimney between 1st and 2nd bays. C (Roll #15-7)
894. 8209 Rugby Avenue, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof hidden behind low-lying decorative parapet wall with tile roof cresting, three-bay facade, single-leaf entrance, paired 1/1 sash windows, small recessed porch supported by single stuccoed pier, exterior side chimney. C (Roll #11-7)
895. 8211 Rugby Avenue, ca. 1925, Tudor Revival. One-story frame dwelling, continuous brick foundation, cross-gable roof with two front-facing gables, front-facing chimney, three-bay facade, single-leaf entrance, 4/1 sash windows, decorative gable entranceway for single-leaf entrance, gable-roof porch supported by tall end brick piers connected by low lying brick balustrade. C (Roll #11-6)
896. 8212 Rugby Avenue, ca. 1950, Modern. One-story frame dwelling, concrete block foundation, gable-on-hip roof, exterior side chimney, three-bay facade, single-leaf entrance, aluminum sash windows, asbestos shingle exterior wall material, hip roof porch supported by slender wooden posts. C (Roll #15-8)
897. 8215 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof, exterior-end chimney, three-bay facade, paired 1/1 sash windows, single-leaf entrance, gable roof porch supported by tall end brick piers connected by low brick balustrade, weatherboard exterior wall material. C (Roll #11-5)
898. 8216 Rugby Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, primary side-gable roof with decorative front-facing gable, side-gable roof porch supported by decorative ironwork posts, single-leaf entrance off side-porch, two-bay facade, 6/6 sash windows, exterior end chimney on side porch, shingle exterior wall material. C (Roll #15-9)
899. 8219 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roofline, gable of rear ell resting on ridge of cross-gable, exterior end chimney, partial-width centrally placed gable roof porch supported by two tall end brick piers connected by low-lying balustrade, three-bay facade, central single-leaf entrance, paired 4/1 sash windows. C (Roll #11-4)
900. 8221 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, complex cross-gable roofline, interior and exterior-end chimneys, stucco over continuous brick foundation, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by decorative metalwork posts. C (Roll #11-3)
901. 8224 Rugby Avenue, ca. 1925, Spanish Revival. One-story frame dwelling, stucco exterior wall material, flat roof hidden behind decorative curvilinear parapet, front-facing chimney, five-bay facade with attached garage, single-leaf entrance with multi-pane sidelights, single and paired sash windows. C (Roll #15-10)
902. 8225 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, stucco over continuous brick foundation, cross-gable roof with gable of rear ell resting on edge of main cross-gable, exterior end chimney, three-bay facade, central single-leaf entrance, paired single pane windows, gable-roof porch supported by simple squared posts resting on low stucco piers, low stuccoed banisters. C (Roll #11-2)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7 Page 74

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
903. 8229 Rugby Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, primary side-gable roof with dominant front-facing gable roof porch supported by four replacement posts, interior chimney, three-bay facade, single-leaf entrance, single and paired 1/1 sash windows. C (Roll #11-1)
904. 8230 Rugby Avenue, ca. 1925, No Style. One-story frame dwelling, concrete block foundation, primary front-facing gable roof, three-bay facade, single and paired 4/1 sash windows, rear side wing, house has been substantially altered with removal of porch and what appears to be alteration of original roofline. NC (Roll #15-11)
905. 8321 Rugby Avenue, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with central front-facing gable wing, interior chimney, three-bay facade, single, paired and tripartite windows, small partial-width shed roof porch supported by simple pole. NC (Roll #10-24)
906. 8235 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, gable roof porch supported by tall end brick piers connected by low brick balustrade, exposed rafter ends and decorative brackets. C (Roll #10-23)
907. 8236 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, front-facing gable roof, interior chimney, hipped roof porch supported by decorative ironwork posts, paired 4/1 sash windows, five-bay facade, single-leaf entrance, later side wing, exposed rafter end. C (Roll #15-12)
908. 8237 Rugby Avenue, ca. 1930, Bungalow. One-story frame dwelling, concrete block foundation, front-facing gable roof, interior chimney, five bay facade, single-leaf entrance, single and paired 4/4 sash windows, full width-hipped roof porch (screened-in), weatherboard exterior wall material. C (Roll #10-22)

Rugby Court

909. 7820 Rugby Court, ca. 1955, Minimal Traditional. One-story frame dwelling on full basement with garage door opening, concrete block foundation, cross-gable roof, exterior end chimney, dominant front-facing gable containing an aluminum sash window and recessed porch, three-bay facade, central single-leaf entrance, remaining bay is tripartite window, aluminum siding exterior wall material. NC (Roll #2-20)
910. 7821 Rugby Court, ca. 1955, Ranch. One-story frame dwelling on basement, poured concrete foundation, moderately pitched hipped roof, side open porch supported by decorative metal posts, three-bay facade, paired aluminum sash windows. NC (Roll #2-21)
911. 7823 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling on full basement, poured concrete foundation, cross-gable roof with front-facing gable wing, partial-width porch, exterior-end chimney, three-bay facade, single-leaf entrance, single and paired sash windows, asbestos shingle exterior wall material. C (Roll #2-22)
912. 7824 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling on basement, concrete block foundation, side gable roof with exterior-end chimney, four-bay facade, tripartite and sash windows, shed roof porch supported by simple posts, aluminum siding exterior wall material. C (Roll #2-19)
913. 7828 Rugby Court, ca. 1955, Ranch. One-story frame dwelling, low-pitched cross-hip roof, concrete block foundation, central exterior chimney, paired aluminum sash windows, side hip-roof porch supported by tapered wooden posts, aluminum siding exterior wall material. NC (Roll #2-18)
914. 7829 Rugby Court, ca. 1955, Minimal Traditional. One-story frame dwelling on full basement, poured concrete foundation, side-gable roof, central interior chimney, three-bay facade, single-leaf entrance, aluminum sash windows, small gable-roof porch supported by simple metal posts. NC (Roll #2-23)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 75

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
915. 7832 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, side-gable roof, central interior chimney, three-bay facade, multi-pane tripartite window, single-leaf entrance, partial-width overhang, decorative fieldstone applied to facade, aluminum siding exterior wall material. C (Roll #2-17)
916. 7833 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, poured concrete foundation, side-gable roof, exterior-side chimney, four bay facade, aluminum casement windows, single-leaf entrance, partial gable-roof porch supported by decorative metal posts, asbestos shingle exterior wall material. C (Roll #2-24)
917. 7836 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with central gable roof wing, interior chimney, three-bay facade, partial-width recessed porch to left supported by simple wooden post. C (Roll #2-16)
918. 7837 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, cross-gable roof, front-facing gable wing, exterior-end chimney, concrete block foundation, asbestos shingle exterior wall material, three-bay facade, large picture window, single-leaf entrance, sash windows. C (Roll #2-25)
919. 7840 Rugby Court, ca. 1950, Ranch. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, wide overhanging eaves, exterior end chimney, three-bay facade, large triple window, single-leaf entrance, aluminum sash windows, asbestos shingle exterior wall material. C (Roll #2-15)
920. 7841 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, poured concrete foundation, side-gable roof, interior chimney, three-bay facade, single-leaf entrance, gable-roof porch supported by decorative ironwork posts, aluminum siding exterior wall material. C (Roll #2-25)
921. 7844 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, four-bay facade, single-leaf entrance, central front-facing exterior chimney, aluminum sash windows, small shed roof entrance porch supported by decorative metal posts. C (Roll #2-14)
922. 7845 Rugby Court, ca. 1950. Minimal Traditional. One-story frame dwelling with later rear two-story wing, side-gable roof with exterior end chimney, four-bay facade, single-leaf entrance, gable roof porch supported by decorative ironwork posts, sash windows, aluminum siding exterior wall material. NC (Roll #3-1)
923. 7848 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, exterior end chimney, four-bay facade, aluminum sash windows, single-leaf entrance, small gable roof porch supported by decorative ironwork posts, aluminum siding exterior wall material. C (Roll #2-13)
924. 7849 Rugby Court, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, three-bay facade, single-leaf entrance, sash windows, gable-roof porch supported by tapered wooden posts, wooden shingle exterior wall material. C (Roll #3-2)
925. 7852 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, three-bay facade, single-leaf entrance, gable roof porch supported by decorative metal posts, aluminum casement windows, interior chimney, asbestos shingle exterior wall material. C (Roll #2-12)
926. 7853 Rugby Court, ca. 1940, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing exterior-end chimney, three-bay facade, single-leaf entrance, tripartite picture window, sash windows, partial-width porch extending out into porte-cochere supported by square wooden posts, wood shingle exterior wall material. C (Roll #3-3)
927. 7860 Rugby Court, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, primary side-gable roof with front-facing gable wing, interior chimney, four-bay facade, single-leaf entrance, aluminum sash windows, one tripartite window, single-leaf entrance, partial-width shed roof (aluminum) porch supported by decorative metal posts, aluminum siding exterior wall material. C (Roll #2-11)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 76

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

Vassar Avenue

928. 8207 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, continuous brick foundation, interior chimney, gable-roof porch supported by slender posts, three-bay facade, 2/2 vertical sash windows, central single-leaf entrance. C (Roll #10-9)
929. 8208 Vassar Avenue, ca. 1930, Bungalow. One-story frame dwelling, cross-gable roof, brick pier and concrete block foundation (partially enclosed), wide overhanging eaves, three-bay facade with recessed secondary bay on far right, single-leaf entrance, paired and single 4/1 sash windows. C (Roll #10-8)
930. 8220 Vassar Avenue, ca. 1955, Minimal Traditional. One-story frame dwelling on full concrete block basement, side-gable roof, four-bay facade, single-leaf entrance, gable-roof porch, sash and casement windows. NC (Roll #10-7)
931. 8221 Vassar Avenue, ca. 1970, Modern. One-story frame dwelling, concrete block foundation, gable-roof porch, four-bay facade, single-leaf entrance, paired 6/6 sash windows, exterior end chimney. NC (Roll #10-10)
932. 8224 Vassar Avenue, ca. 1955, Minimal Traditional. Two-story frame dwelling, split-level with a two-storied section with flanking one-story side wing, interior chimney, 6/6 paired and single sash windows, single-leaf entrance, small gable roof porch. NC (Roll #10-6)
933. 8226 Vassar Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, four-bay facade, single-leaf entrance, sash windows. C (Roll #10-5)
934. 8232 Vassar Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof, double front-facing gables, exterior-side chimney, four-bay facade, single-leaf entrance, 4/1 sash windows, gable roof porch supported by tapered posts connected by wooden balustrade. C (Roll #10-4)
935. 8236 Vassar Avenue, ca. 1930, Bungalow. One-story frame dwelling, continuous brick foundation, cross-gable roof with exterior side chimney, double front-facing gables, four bay facade, single-leaf entrance, 4/1 sash windows, gable roof porch supported by tapered piers connected by wooden balustrade. C (Roll #10-2)
936. 8242 Vassar Avenue, ca. ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, gable-on-hip roof, central interior chimney, two-bay facade, large multi-pane window and central picture window, small recessed side-porch supported by simple posts with cross-braces, single-leaf entrance located off side porch. C (Roll #10-2)
937. 8248 Vassar Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, dominant front-facing gable with secondary gable-roof porch supported by simple wooden posts, two bay facade, single-leaf entrance. C (Roll #10-1)
938. 8252 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling on continuous brick foundation, complex cross-gable roof, interior and exterior side chimney, three-bay facade, single-leaf entrance, paired 4/1 sash windows, gable roof porch supported by small squat posts on brick piers. C (Roll #9-24)
939. 8255 Vassar Avenue, ca. 1960, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, four-bay facade, single-leaf entrance, aluminum sash windows, small gable roof porch supported by decorative ironwork posts. NC (Roll #10-11)
940. 8256 Vassar Avenue, ca. 1925, Bungalow. Small one-story frame dwelling on rubblestone foundation, front-facing gable roof, former small porch enclosed, four-bay facade, single-leaf entrance, sash windows, vertical wooden siding. C (Roll #9-23)

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 7 Page 77

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

-
941. 8260 Vassar Avenue, ca. 1960, Modern. One-story frame dwelling, concrete block foundation, side gable roof, aluminum sash windows, four-bay facade, single-leaf entrance. NC (Roll #9-22)
942. 8300 Vassar Avenue, ca. 1940, Minimal Traditional. One-story frame dwelling on full basement, brick foundation, side clipped-gable roof with side chimney, side porch, three-bay facade, central single-leaf entrance, paired 6/6 sash windows, clipped gable roof porch supported by decorative metal posts. C (Roll #9-21)
943. 8301 Vassar Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof with front-facing gable wing, exterior side chimney, four-bay facade, 6/6 sash windows, three-quarter width shed-roof (screened-in) porch supported by simple wooden posts. C (Roll #10-12)
944. 8304 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, front-facing gable roof, exterior side and rear chimneys, former full-width hipped roof porch across front, now partially enclosed, single leaf entrance on front and to right side, asbestos shingle exterior wall material. C (Roll #9-20)
945. 8305 Vassar Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, interior chimney, three-bay facade, single-leaf entrance, hipped roof porch supported by simple wooden posts. C (Roll #10-13)
946. 8308 Vassar Avenue, ca. 1955, Ranch. One-story frame dwelling, concrete block foundation, low-pitched hipped roof, three-bay facade, single-leaf entrance, aluminum sash windows, interior chimney. NC (Roll #9-19)
947. 8309 Vassar Avenue, ca. 1950, Minimal Traditional. One-story frame dwelling, concrete block foundation, side-gable roof, three-bay facade, single-leaf entrance, 6/6 sash windows, small gable roof porch supported by decorative metal posts, asbestos shingles. C (Roll #10-14)
948. 8313 Vassar Avenue, ca. 1955, Ranch. One-story frame dwelling, cross-hipped roof, concrete foundation, brick veneer and asbestos shingle exterior wall material, four-bay facade, vertical sash windows, single-leaf entrance, small hipped-roof porch supported by decorative metal post. NC (Roll #10-15)
949. 8316 Vassar Avenue, ca. 1925, Bungalow. One-and-a-half story frame dwelling on full basement, cross-gable roof with double front-facing gables, four-bay facade, single-leaf entrance, single and paired sash windows, gable-roof porch supported by tall end brick piers, interior chimney. C (Roll #9-18)
950. 8317 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof, front-facing gable resting on ridge of side-gable roof porch, secondary front gable, three-bay facade, single-leaf entrance, paired and triple sash windows, porch supported by rubblestone piers, rubblestone foundation. C (Roll #10-16)
951. 8320 Vassar Avenue, ca. 1925, Minimal Traditional. One-and-a-half story frame dwelling, continuous brick foundation, side-gable roof with full-width shed roof wall dormer containing twin sash windows, small flat roof side roof porch, three-bay principal facade, central single-leaf entrance, paired sash windows, shed roof aluminum roof porch supported by metal posts, aluminum siding exterior wall material, side chimney. C (Roll #9-17)
952. 8321 Vassar Avenue, ca. 1955, Ranch. One-story frame dwelling, cross-hip roof, concrete foundation, brick and asbestos shingle exterior wall material, three-bay facade, single-leaf entrance, paired sash windows. NC (Roll #10-17)
953. 8324 Vassar Avenue, ca. 1955, Ranch. One-story frame dwelling, concrete block foundation, low-pitched cross-hip roof, four-bay facade, single-leaf entrance, single and paired sash windows, asbestos shingle exterior wall material. NC (Roll #9-16)
954. 8325 Vassar Avenue, ca. 1930, Bungalow. One-story frame dwelling, front-facing gable roof, continuous brick foundation, single and paired sash windows, single-leaf entrance, full-width recessed porch supported by two tall end brick piers, exposed rafter ends and decorative brackets. C (Roll #10-18)

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section 7.8 Page 78

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

955. 8333 Vassar Avenue, ca. 1930, Bungalow. One-story frame dwelling, cross-gable roof with double front-facing gables, gable roof porch supported by two tall end brick piers connected by low lying brick balustrade, paired sash windows, single-leaf entrance, exposed rafter ends and decorative brackets. C (Roll #10-19)
956. 8337 Vassar Avenue, ca. 1955, Minimal Traditional. One-story frame dwelling, concrete block foundation, cross-gable roof, front-facing gable wing, four bay facade, single-leaf entrance, vertical sash aluminum windows, aluminum siding exterior wall material. NC (Roll #10-20)
957. 8340 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, brick pier foundation, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, single and paired 4/1 sash windows, small gable roof porch supported by tall end brick piers. C (Roll #9-15)
958. 8341 Vassar Avenue, ca. 1955, Modern. One-story frame dwelling, concrete block foundation, cross-hipped roof, three-bay facade, vertical sash windows, small recessed porch supported by simple wooden posts, side single-leaf entrance off recessed porch. NC (Roll #10-21)
959. 8344 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, cross-gable roof with dominant front-facing gable, brick foundation, three-bay facade, central single-leaf entrance, paired sash windows, partial-width gable roof porch supported by tall end brick piers connected by low lying brick balustrade, aluminum siding exterior wall material. C (Roll #9-14)
960. 8348 Vassar Avenue, ca. 1925, Bungalow. One-story frame dwelling, continuous brick foundation, brick veneer exterior wall material, front-facing gable roof, interior chimney, three-bay facade, single-leaf entrance, multi-pane over single sash windows, partial-width gable-roof porch supported by tall end brick piers connected by brick balustrade, some aluminum siding. C (Roll #9-13)

**Statement of Significance
Criterion C – Architecture**

The South Highlands of East Lake neighborhood is eligible for the National Register under Criterion C for its architectural significance. The South Highlands of East Lake Historic District is the fourth district created from the East Lake development, one of Birmingham's earliest streetcar suburbs. The other historic districts are East Lake, Lakewood and Howard College Estates. Each of these districts reflects a separate phase of development by the East Lake Land Company. The properties encompassed in the district are representative local interpretations of their respective styles and also retain their architectural integrity. The South Highlands of East Lake neighborhood contains an impressive collection of early to mid-twentieth architecture reflecting the development and growth of this streetcar suburb from 1906 to 1952.

In 1886, Robert Jemison and a group of industrialists planned the East Lake neighborhood as a residential community that would be free of the smoke and other annoyances of an iron manufacturing town. The developers of East Lake laid off the district in a typical grid pattern with broad avenues and cross streets. The focal point of the development was a fine park, which boasted a lake, bath house, pavilions, a hotel, zoo and boat houses. By 1910, East Lake contained a town hall, schools, fire department, churches and dummy lines that connected the community with Birmingham and other industrial sites within the Birmingham District. East Lake soon enjoyed the reputation as the most complete of the smaller towns within the Birmingham District. Jemison had created an ideal suburban neighborhood for the average middle-class American. Due to the success of the original East Lake development, in 1906 the East Lake Land Company laid off the South Highlands and Central Highlands neighborhoods that lay immediately to the south and southwest of the original East Lake development.

The proposed South Highlands of East Lake Historic District is made up of approximately 54 whole and half city blocks with the historic East Lake neighborhood. This residential district lies south and northeast of the East Lake Historic District. The South Highlands of East Lake Historic District is made up of most of the original plat of the 1906 addition to East Lake and subsequent southerly and northeasterly historic outgrowth. The earliest houses in the district date circa 1910 illustrating that many of the houses were constructed soon after the subdivision was platted and developed.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 8 Page 79

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

Reflecting the historical development of this suburban neighborhood during the period of significance is a wealth of early twentieth century architecture. Included in the district are impressive examples of a variety of architectural styles, forms and trends including Craftsman/Bungalow, Tudor Revival, Colonial Revival, Spanish Revival and vernacular pyramidal roof and L and T-cottages. Particularly significant is the collection of Spanish Revival houses designed by Birmingham architect George Turner. The majority of structures are generally one to one-and-a-half stories and of frame construction. A number of structures have brick or stucco wall treatment. Generally, the dwellings are quite modest in terms of scale, materials, and design. The neighborhood has a high degree of integrity.

Overall, the South Highlands of East Lake Historic District is an early to mid-twentieth century middle-class neighborhood in Birmingham. The wealth of historic architecture clearly demonstrates the neighborhood's historical development during the period of significance.

Period of Significance

The period of significance extends from 1910, the date of the earliest house in the district, through 1952. During this period, the South Highlands of East Lake Historic District continued to be a stable, residential neighborhood, reflecting the development and design of its original plan.

Historical Summary

In 1985, the Birmingham Historical Society conducted an architectural and historical resource survey of three neighborhoods that border Village Creek in Jefferson County, Alabama. The results of that survey were compiled for the publication Village Creek: An Architectural and Historical Resources Survey of Ensley, East Birmingham and East Lake, Three Village Creek Neighborhoods, City of Birmingham, Marjorie L. White, Principal Investigator, and Carter L. Hudgins, Project Director, compiled the following history of the East Lake Neighborhood for that survey. Their findings serve as the principal text for this historical summary. The text taken from the Village Creek publication and the original reference endnotes are found in quotes at intervals throughout the summary. Additional research has been included in the text and, while footnoted, is found outside the quotes.

“In 1871 the site of the city of Birmingham was an old cornfield cleared of stumps and trees waiting for the tracks of the South and North Alabama Railroad to cross those of the Alabama and Chattanooga Line. Surveyors employed by the railroads and the Elyton Land Company drew rights-of-way and streets on maps of land where only rabbits lived, but few men accepted the promoters' claim that the projected city would ever become the El Dorado of the iron masters (The South, 5 April 1873).”

“Within a decade, however, Alice Furnace No. 1 on the city's western edge produced Birmingham's first pig iron and was followed quickly by imitators. Eleven companies put furnaces into production during the 1880s. Between 1886 and 1890, the height of the first iron boom, twenty-eight furnaces went into blast, and by 1890 Birmingham's mills produced 816,911 tons of iron, 8.8 percent of the nation's total production. Birmingham's share of the nation's iron production was at its peak.”

“America's iron industry was then in the midst of its greatest period of expansion and entrepreneurs by the dozens came to join the boom in Birmingham. Men, some already active in the Elyton Land Company and others... eager to emulate the land company's success, pooled their capital and acquired land near Birmingham which they hoped would also soon become bustling, industrial towns. East Lake, East Birmingham, and Ensley... were founded by speculators during Birmingham's pig iron boom. Village Creek meandered through or near (these three towns.) (While) East Birmingham and Ensley were, according to their promoters, favorably located for manufacturing enterprises and offered ideal sites for residences for working men... East Lake was planned as a residential community that would be free of the smoke, and other annoyances of an iron manufacturing town' (DuBose, 1887, 264-265).

“...(I)n 1886, a group of prominent Birmingham investors began plans for a community whose principal asset became its distance from sooty furnaces and the industrial haze. Promoters of East Lake, Alabama, wrote that Birmingham was destined to be ... constantly growing.' Crowded with population and 'obscured by the smoke of the furnaces, foundries and factories,' the city would be ideal for business, but its centre will be by no means the best location for homes.' Noise and smoky air were 'distractions men willingly bare in business hours, and refer to with pride,' but they were not acceptable as part of the normal home life. East Lake would provide a community

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 8 Page 80

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

of 'cheaper housing' where families of businessmen and workingmen could 'escape the smoke and other annoyances of an iron manufacturing town (East Lake Land Company, n.d.)."

"Principal investors Robert Jemison, Sr. and James A. Van Hoose, with the assent of 25 other men, incorporated the East Lake Land Company on July 7, 1886, with a capital stock of \$200,000. M. F. Porter, R. H. Haygood, J. R. Boddie, A. A. Clisby, W. H. Wood, G. M. Hanby, George Morris, and T. R. Lyons were, along with Jemison and Van Hoose, appointed the company's first board of directors (East Lake Land Company "Minutes," 1886, 7). Investment money ran toward iron production in the late 19th century Birmingham, and as a first order of business, the board of directors set priorities for their new company. The 'general purpose' of the East Lake Land Company proposed to carry on a general manufacturing and industrial business and engage in the quarrying of limestone and other stones...the manufacture of pig iron, steel, and all other articles which can be made or manufactured with coal or coke and iron ore as from wood, iron or steel either alone or in conjunction with any other material (East Lake Land Company "Minute Book" 7)."

"It was soon apparent, however, that Robert Jemison and his associates would sink most of their capital into the development of a new town rather than new furnaces and mines. None of the investors and directors of this land company were industrialists. In the years preceding Birmingham's industrial boom, some of these men had been prominent local merchants and attorneys; others were well-to-do farmers from eastern Jones Valley. It seems that these men shared a proclivity to make their profits by buying and selling a portion of their property to the Sloss Furnace Company for development of a lime quarry (Birmingham Age, 5 December 1886). The principal business of the East Lake Land Company would be the buying and selling of lands, the improvement of such lands...into lots, streets, and tracts, the construction of lake, race tracks, and other pleasure resorts.' The land company would also construct the businesses, canals, railways, water works, and railroads necessary to connect their community with Birmingham and provide the services necessary for the community's survival and expansion (East Lake Land Company "Minute Book." 7).

"A reporter from the Birmingham Age wrote that much of the talk of the initial stockholders meeting of the East Lake Land Company concerned a plan to build an ideal residence town. The men of the East Lake Land Company predicted that their town would 'quickly spring into the list of Alabama's finest.' It was, according to promotional pamphlets distributed by the company, the intention of its planners that their new town would remain 'strictly a residence suburb and pleasure resort' with 'genteel homes...ornamented with parks' (East Lake Land Company, n.d.)."

"Promoters of East Lake depicted their community as a place that would combine 'woodland graces' with the advantages of city life. Located beyond the eastern fringes of Birmingham, East Lake would be within easy reach of the finest farms in the county' and thus allow its residents to have 'first call on fresh vegetables and fruit, milk, butter, and poultry (Robert Jemison, Sr. Papers, n.d.). Well-established institutions would provide East Lake the amenities of urban life. Ruhama Baptist Church, a congregation established in 1818, would support the spiritual and intellectual growth (erecting an imposing Neo-classical building in 1926). Ruhama Female Institute, the East Lake Athenaeum, and Howard College, a Baptist-sponsored school of higher learning coaxed to East Lake from Marion, Alabama would add to the cultural and intellectual atmosphere of East Lake."

"This suburban paradise was not intended to be an exclusive development for the wealthy. Lots were to be kept to modest dimensions and houses built for 'the average purse...at prices within the reach of all.' Speculators were discouraged and social harmony was invoked by requiring every homeowner to improve his lot with ornamental plantings." Like most development companies, the East Lake Land Company did build some speculative houses in an attempt to create interest in the new suburb. Most of these speculative houses were located in the initial East Lake development. (East Lake Land Company, n.d.)."

In 1886, the Board of the land company authorized Col. Harding of Tuscaloosa to make maps of the grounds, showing contour lines, creek, railroad connections, streets and avenues, park grounds, and racetrack for the initial East Lake development. Of the initial 1,982 acres, 202 were laid off into 777 lots and by 1887 the East Lake Land Company had sold 457 lots. Lots were a uniform 50' x 165' and sold for \$400 for inside lots and \$500 for corner lots. As mentioned, Harding utilized a common grid pattern when laying off the original lots for the East Lake Land Company. The grid pattern was merely an extension of the same plan used for the central city core of Birmingham as well as Smithfield, Pratt City, Thomas, Ensley, Bessemer, Earle Place, Central Park and Ensley Highlands. It would be after 1903 that Robert Jemison, Sr. who also developed Earle Place, Central Park and Ensley Highlands would abandon the grid pattern for plans which complemented the natural terrain of the hills and mountains surrounding Birmingham. Jemison's later subdivisions, Glen Iris, Mountain Terrace, Forest Park, Mountain Brook, and Fairfield, were laid out according to the designs of professionally trained landscape architects. With South Highlands and Central Highlands of East Lake, laid out in 1906, Jemison continued to use the common grid pattern, although

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 8 Page 81

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

with South Highlands, he designed a broad thoroughfare, Rugby Avenue, which made an angular semi-circle through the neighborhood and accommodated the Ruby line of the South East Lake streetcar system. The Rugby line made a semi-circle from 1st Avenue South, down and around Rugby Avenue to 83rd Street where it met the through line from Birmingham to Roebuck. Intersecting streets in South Highlands were set at angles to Rugby Avenue, creating approximately 740 irregularly shaped rectangular and triangular lots. By 1910, the East Lake Land Company would abandon the grid system altogether when they annexed the Roebuck Springs addition, lying to the northeast of the South Highlands section. Roebuck Springs was a residential suburb that included the city's professionally designed golf course, pleasure drives, gardens, and clubhouses. (East Lake Land Company, "Minutes" 7: *Designs on Birmingham*, 6-2).

The success of the East Lake Land Company depended heavily on the construction of a railroad/streetcar line linking the suburb to Birmingham and other industrial sites. The first train on the line was to leave East Lake for Birmingham at 6 a.m. with trains departing every 30 minutes. The last train left Birmingham for East Lake at 9 p.m. As an incentive to relocate and build, residents of East Lake were given train passes for 1 year. The train fare was set at a nickel (East Lake Land Company, "Minutes," 7). "The East Lake dummy opened on October 8, 1887. Developed as a promotional device to encourage the sale of East Lake Company's lots, this streetcar line linked East Lake to Birmingham and its furnaces and the eastern fringe. A system of branch lines eventually emanated from a station built on 77th Street. When in 1912, East Lake streetcars were tied to the lines that extended 14 miles west to Bessemer, residents of the East Lake streetcars were tied to lines that reached most of the industrial sites in the Birmingham District (Hudson, 18). Robert Jemison, Sr. played a key role in the development of this network of streetcar lines which his son called the best in the Birmingham District (Jemison and Company Magazine, 1910, n. p.)."

"Despite the best intentions of the land company, East Lake did not grow as quickly as the rest of East Birmingham. East Lake may have enjoyed the air that bore the scent of 'comfort and prosperity,' but East Birmingham had cheaper housing and a source of employment, being closer to the foundries and factories. At the end of 1886, there were reported to be 15 substantial, comfortable and roomy dwellings in the community (East Lake Land Company brochure, n.d., Robert Jemison Sr. papers)." Nevertheless, in the early years of the project, the East Lake Land Company was often short of cash. Indeed, Robert Jemison was having a hard time convincing some of his partners that the company needed further improvements. As the June 15, 1888 board meeting, Jemison advocated enlarging the pleasure lake to the north and building an electric plant and waterworks. Too, Jemison cited the need for additional grading, the construction of an additional dummy line to service the North Highlands property, and the building of small parks, a floating boat house and dancing pavilion. He estimated the cost of making these enhancements to the East Lake property at \$100,000 to \$250,000. Announced at a time when board members for the company were unhappy with the railway rates and unprofitable boat rentals, Jemison's plea for further investment was difficult for most members to understand or support. Board members had long argued that the company should have retained control of the railway, an idea that Jemison opposed (East Lake Land Company, "Minutes," 7). As White and Hudgins note, "The collapse of the iron boom and the Panic of 1893 bore some of the blame for East Lake's slow start as did the company's slow progress of undertaking civic improvements such as sidewalks, curbs, gutters, sewers, and landscaping. Few of the improvements the company had promised were complete at the beginning of the 20th century (East Lake Land Company brochure, n.d., Robert Jemison, Sr. papers)."

"Robert Jemison, Sr. managed the East Lake Land Company until 1904 after which Webb W. Crawford assumed control. Crawford expanded East Lake with the initiation of streetcar routes and by offering more East Lake property for development and sale. In 1906, Crawford and the East Lake Land Company began to develop those lands to the south and west of the original neighborhood, creating Central Highlands, South Highlands of East Lake (to differentiate this development from the earlier South Highlands neighborhood located south of downtown Birmingham), Howard College Estates (NRHP 04/22/99) and Lakewood (NRHP 06/22/00). The streets of Central Highlands and South Highlands of East Lake were plotted in 1906 and three years later, on March 20, 1909, the plans for Lakewood were filed with the city engineer. Due to the close proximity of South Highlands of East Lake to Howard College, the officers of the East Lake Land Company named the streets and avenues for universities and college towns. Soon residents of South Highlands found themselves living on Ann Arbor, Oxford, Rugby, Columbia, Harvard, Yale, Princeton, and Vanderbilt Streets. Similarly, streets in Central Highlands neighborhood were named for European cities, such as London, Paris, Madrid, and Naples. By 1906, a new system of branch lines in East Lake was completed and by feeding into the older lines that then traveled between East Lake and Birmingham, these streetcar systems helped open new sections for residential development. East Lake boomed and soon, houses were dotting the scores of new lots opened up for sale in the South Highlands neighborhood.

In the early 1900s, Crawford and Bradley Sanders, a vice-president of the company and fellow developer, guided East Lake toward the goals established by Jemison and his colleagues in 1886. By feeding into the older streetcar lines that then traveled between East Lake and Birmingham, new lines – Lake Highlands No. 35 and Rugby No. 36 – opened the new sections of East Lake for residential development.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 8 Page 82

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

In 1902, East Lake was incorporated as an independent municipality, including 320 residences on lots whose average size was 50 by 200 feet. These residences were located on lots of the original East Lake development. In 1907 a town hall was constructed on 77th Street and by 1910, schools, a fire department, churches, and other modern conveniences had earned East Lake the reputation as the 'most complete of smaller towns in the Birmingham District (Jemison Magazine, May 1910, n.p.) After the opening of the new lines in 1906 and incorporation into the City of Birmingham in 1910, home construction in East Lake and in particular, South Highlands of East Lake began to increase. The first houses in the South Highlands neighborhood were located along 5th Avenue and near Howard College, adjacent to the original East Lake development. When it was annexed into the City of Birmingham in 1910, East Lake's population was estimated to be 3,000 (Cruikshank, 1920, 136).

South Highlands was a popular neighborhood during the 1910s and 1920s, as residential development rippled out to it from the center of Birmingham. During the "flush" economic times of the 1920s, homeowners built the majority of standing structures in the South Highlands neighborhood, usually selecting the Craftsman/Bungalow, Tudor Revival/English cottage, and Spanish Revival styles. The population of South Highlands consisted mainly of blue and white collar works such as mechanics, electricians, salesmen, managers, clerks, engineers, comptrollers, contractors, printers and lawyers, as well as professors and teachers for the nearby schools and colleges. These homebuilders selected the prevailing architectural styles and trends for their houses. Similarly, the South Highlands development mirrored the original East Lake development where 50 x 200 foot lots backed up to common alleyways. Setbacks of 20 to 25 were standard, providing a steady rhythm to the streetscape. With the Rugby line running down the middle of Rugby Avenue, South Highland's main thoroughfare, access to the streetcar system easily available, allowing transportation to practically anywhere in the Birmingham District. Contributing the popularity of the East Lake area was the fact that the park continued to be Birmingham's favorite site for picnics and Sunday afternoon drives. The lake was used for fishing and boating and the park for outings and special events. East Lake proved to be such a popular residential neighborhood that in 1923, extra streetcars had to be added to the East Lake and Tidewater lines.

Only a small amount of construction took place in the East Lake neighborhood in the 1930s. As the country emerged from the depression there was some construction in the district in the late 1930s but any real increase in construction was postponed by the war. During the 1940s, affected by World War II, building in South Highlands of East Lake ceased. Virtually no new construction took place in the entire East Lake development from 1941 to 1945. Conversely, the post World War II building boom also impacted South Highlands and the rest of East Lake. By the 1950s, a number of small but attractive dwellings quickly rose on the remaining vacant lots, filling in the streetscape. East Lake was described as a stable middle-class neighborhood filled with blue-collar workers and professors associated with nearby Howard College. Indeed, many residents in the neighborhood supplemented their income by renting rooms to Howard College undergraduates. Unfortunately, the educational institutions which the developers of East Lake worked so hard to attract to the area fared poorly. The East Lake Athenaeum was short-lived, lasting only ten years, from 1896 to 1906. The land upon which the Athenaeum was located is now the side of the Catholic nursing home and rests on the northeastern edge of the South Highlands district. Similarly, the Ruhama Female Institute had long since closed its doors when in 1957 the trustees of Howard College announced that the institution was moving to a new site on Lakeshore Drive in the Homewood area south of Birmingham. The removal of Howard College, which was subsequently renamed Samford University, was a blow to the entire East Lake neighborhood. The buildings of the college, lying to the southeast of the South Highlands section, were demolished in the 1960s. In addition, during the 1960s, plans were laid for the creation of a major interstate highway linking Atlanta and Birmingham. The four-lane interstate, I-20, was laid through the East Lake neighborhood, severing the southern half from the lake. East Lake, South Highlands, Central Highlands, Lakewood and Howard College Estates were cut off from the lake, park and adjoining neighborhoods to the north.

Today, South Highlands of East Lake is an economically stable, middle-class neighborhood. The district retains its character as a part of one of Birmingham's older communities. Within the district boundaries, one finds a wealth of early-to-mid twentieth century architecture, reflecting the development and evolution of one of Birmingham's earliest streetcar suburbs during the period of significance.

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET

Section 9, 10, photos Page 83

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

Section 9 – Bibliographical References

- Atkins, Leah Rawls. The Valley and the Hills: An Illustrated History of Birmingham and Jefferson County. Birmingham-Jefferson Historical Society: Birmingham, Alabama, 1981.
- Morris, Philip and Marjorie Longenecker White: Designs on Birmingham: A Landscape History of a Southern City and Its Suburbs. Birmingham Historical Society, Birmingham, Alabama, 1989.
- White, Marjorie Longenecker. The Birmingham District: An Industrial History and Guide. Birmingham Historical Society, Birmingham, Alabama, 1981.
- White, Marjorie Longenecker and Carter L. Hudgins. Village Creek: An Architectural and Historical Resources Survey of Ensley, East Birmingham and East Lake, Three Village Creek Neighborhoods, City of Birmingham. Birmingham Historical Society, Birmingham, Alabama, 1985.

Section 10

Verbal Boundary Description

The irregular boundaries of the South Highlands of East Lake Historic District are shown on the accompanying map with a scale of 1" = 200 feet.

Boundary Justification

The boundary lines for the South Highlands of East Lake Historic District were drawn to include the original South Highlands development and to include as many contributing resources and exclude as many non-contributing resources as possible.

Photos

The information contained in items 1-5 is the same for all photographs.

1. South Highlands of East Lake Historic District
2. Jefferson County, Alabama
3. Dawn Wise, photographer
4. Summer, 2002
5. Negatives on file, Alabama Historical Commission

Photo #1	8440 6 th Avenue South
Photo #2	600 84 th Place South
Photo #3	8336 84 th Place South
Photo #4	8400 Block of 5 th Avenue South
Photo #5	8336 5 th Avenue South
Photo #6	Streetscape, 5 th Avenue South
Photo #7	Streetscape, 5 th Avenue South
Photo #8	8201 6 th Avenue South
Photo #9	Streetscape, Rugby Avenue
Photo #10	Streetscape, Rugby Avenue
Photo #11	Streetscape, Rugby Avenue
Photo #12	Streetscape, 5 th Avenue South
Photo #13	Streetscape, corner of Rugby and 5 th Avenue South
Photo #14	Streetscape 81 st Street South
Photo #15	Streetscape of Rugby Avenue

**United States Department of the Interior
National Park Service**

**NATIONAL REGISTER OF HISTORIC PLACES
CONTINUATION SHEET**

Section photos Page 84

Name of Property: South Highlands of East Lake Historic District
County and State: Jefferson County, Alabama

Photo #16	Streetscape, 81 st Street South
Photo #17	Streetscape, 5 th Avenue South
Photo #18	Streetscape, 80 th Street South
Photo #19	Streetscape, 80 th Street South
Photo #20	Streetscape, 4 th Avenue South